ALLREDI™

MARCO® 130E REMOTE CONTROL SYSTEM CONVERSION KITS





Marco®
Powered by ALLREDI

PART NUMBERS AND SCHEMATICS GUIDE

Company Profile

Allredi was formed in the early 2020, when two of the largest distributors in the blasting, coating, safety, and environmental industry, APE Companies and Marco Group International, joined forces. While the qualities both companies are known for have not changed, a lot about our business is new. New abilities. New agilities. New ways to help you win. This calls for a new name, Allredi.

This name exemplifies what we have become. It is completely oriented to the needs of our customers. To your needs. It says that when you call us for anything – products, service, expert advice, anything – you can consider it done. Or even better, Allredi done.

We are your right-now supplier. From skills to SKUs, we deliver the goods fast. So you can be more agile every minute, every day. This is who we are. This is what our new name means. Go ahead and expect excellence, because we're bringing it.

Our Mission and Vision

To be the industry's preferred partner in surface preparation solutions through unrivaled technical expertise, customer experience, product availability, and tailored service offerings.

The Allredi Difference

- **Industry Experience** – With Allredi on your team, you have access to expertise which can only come from decades of industry leadership. We have organized our engineering department, production specialists, customer operations, and safety support into a "Center of Competence." As an Allredi customer, you have access to hundreds of years of cumulative experience related to your operations.
- **Manufacturing Excellence** – Allredi is a U.S. based manufacturer of equipment for the Surface Preparation and Protective Coatings industries. Allredi's engineers benchmark the industry to ensure that we design and manufacture superior products that set the "Gold Standard" for performance, safety, and quality.
- **Legendary Customer Service** – Allredi's legendary customer service team is staffed by friendly, highly-trained individuals who are focused on providing the highest level of product support, order accuracy, and customer satisfaction.
- **Product Availability** – We stock over 10,000 SKU's and have over 45 shipping locations to serve North American and International markets for all major brands of blasting, coating, environmental, and safety equipment. Allredi is your right-now supplier, so you can keep your projects moving. From our foundation of strong relationships, we have built a nationwide network that puts vast inventory and ready service close to our customers. We provide advanced expertise, and we deliver the goods fast – so you can easily access the products and services you need to me more agile every minute, every day.
- **Technology Leadership** – Our website provides: Operator's Manuals, Part Numbers and Schematics Guides, SDS information, and key product features and specifications, providing access to information 24/7.

TABLE OF CONTENTS

Company Profile **2**

Table of Contents **3**

Complete Remote Control System Conversion Kits **4-39**

3.0 and 3.5 Cu. Ft. Abrasive Blasting Pots
Part Numbers – 12-Volt DC 4-5
Single Outlet 6-7
Part Numbers – 120-Volt AC 8-9
Single Outlet 10-11

6.0 and 6.5 Cu. Ft. Abrasive Blasting Pots
Part Numbers – 12-Volt DC 12-13
Single Outlet 14-15
Part Numbers – 120-Volt AC 16-17
Single Outlet 18-19

120 Cu. Ft. and Larger Abrasive Blasting Pots
Part Numbers – 12-Volt DC 20-21
One Outlet 22-23
Two Outlet. 24-25
Three Outlet 26-27
Four Outlet 28-29

Part Numbers – 120-Volt AC 30-31
One Outlet 32-33
Two Outlet. 34-35
Three Outlet 36-37
Four Outlet 38-39

Pneumatic-to-Electric Conversion Kits **40-51**

120 Cu. Ft. and Larger Abrasive Blasting Pots
Part Numbers – 12-Volt DC 40-41
One Outlet 42-43
Two Outlet. 44-45
Three Outlet 44-45
Four Outlet 44-45

120 Cu. Ft. and Larger Abrasive Blasting Pots
Part Numbers – 120-Volt AC 46-47
One Outlet 48-49
Two Outlet. 50-51
Three Outlet 50-51
Four Outlet 50-51

Optional Accessories **52-56**
Power Converters 52-53
Battery Clamps 54
Electric Cord 55
Electric Control Line and Plugs 56

Literature References **57**


Maintenance Notes **58-59**

PART NUMBERS AND SCHEMATICS GUIDE

	12-VOLT DC ELECTRIC CONVERSION KITS – 3.0 AND 3.5 CU. FT. ABRASIVE BLASTING POT							
	Blastmaster® 1-1/2" Maxum III Abrasive Metering Valve							
Part Numbers	**Urethane**	**Tungsten Carbide**	**GateKeeper Air Valve**	**Abrasive Blasting Pot Muffler**	**Blastmaster® 151E Remote Control Switch**	**Electric Control Line** *(Includes Connectors)*	**Battery Clamps**	**Power Cord** *(Includes Connectors)*
10104973	X		1-1/2"	X	X	50 Ft.	X	25 Ft.
10104974		X	1-1/2"	X	X	50 Ft.	X	25 Ft.

For converting bare pot to electric remote control system.
Includes: Blastmaster® Maxum III Abrasive Metering Valve, 1-1/2" GateKeeper, Blastmaster® 151E Remote Control Switch, Electric Control Line, and various pipe fittings
Note that due to the wide variety of blast pots you may need to purchase additional fittings, bushing, etc.

PART NUMBERS AND SCHEMATICS GUIDE

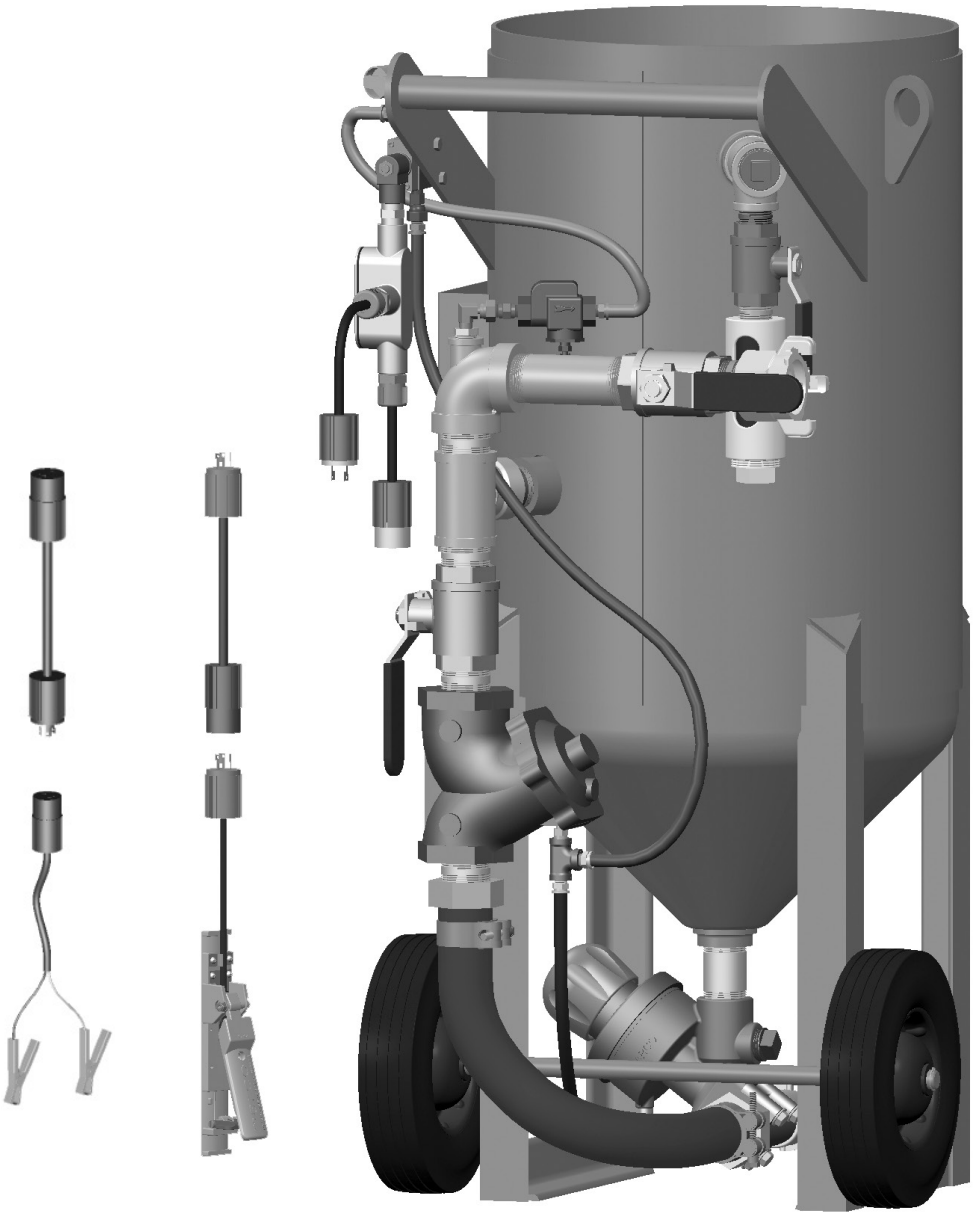

PART NUMBERS AND SCHEMATICS GUIDE


Complete 12-Volt DC Electric Conversion Kits – 3.0 and 3.5 Cu. Ft. Abrasive Blasting Pot

Item #	Part #	Description
Fig. 1		
—	**10104973**	**12-Volt DC Electric Conversion Kit – 3.0 and 3.5 Cu. Ft. (Urethane)**
—	**10104974**	**12-Volt DC Electric Conversion Kit – 3.0 and 3.5 Cu. Ft. (Tungsten Carbide)**
1	1011818	1/2" x 1/4" Bushing
2	1012326	1/4" Swivel 90° Fitting *(Two Required)*
3	1011828	1-1/2" NPT Elbow with 1/2" Side-Out
4	1017019	1/4" x 1/4" Brass Hex Nipple
5	10WS	Watts Strainer
6	1011211	1-1/2" x 5-1/2" NPT Pipe Nipple
7	10PAF025	1/4" Push-On Hose Fitting *(Five Required)*
8	1014015	1-1/2" NPT Close Nipple *(Five Required)*
9	1011100	Exhaust Muffler
10	1011601	1" NPT Full Port Brass Ball Valve
11	1011201	1-1/4" NPT Close Nipple *(Two Required)*
12	1011817	1-1/4" x 1-1/4" x 1" NPT Pipe Tee
13	1011902	1-1/4" NPT Pipe Plug
14	1012151	1" NPT Close Nipple
15	10ME4	1-1/2" NPT (F) 4-Lug Air Hose Fitting
16	1011603	1-1/2" NPT Full Port Brass Ball Valve *(Two Required)*
17	1011830	1-1/4" 45° Street Elbow
18	10PVFIT1	1/4" x 1/8" Hex Union
19	1011844	1/4" NPT Pipe Tee
20	10AH025	1/4" Push-On Air Hose – Per Foot
21	1011204	1-1/4" x 3" NPT Pipe Nipple
22	10101950	1-1/2" Maxum III Abrasive Metering Valve – Tungsten Carbide Sleeve *(For use with 10104974)*
—	10101946	1-1/2" Maxum III Abrasive Metering Valve – Urethane Sleeve *(For use with 10104973)*
23	10SB2S	1-1/2" Straight Thread Pot Coupling
24	10PAF0125	1/8" Push-On Air Hose Fitting
25	1014239	1/8" 90° Swivel Fitting
26	1006312	1-1/2" I.D. Air Hose Pusher Line Assembly
27	1013200	1-1/2" GateKeeper Air Valve
28	1011836	1-1/2" x 1-1/2" x 1-1/4" NPT Pipe Tee
29	1019051	Blastmaster® 190 12-Volt DC Electric Control Assembly – Complete
30	1015545	50' of 16/2 SO Power Cord with 3-Prong Twist-Lock Plugs Installed *(Includes Item #'s: 31, 34, and 35)*
31	1015555	3-Prong Twist-Lock Plug – Male *(Three Required)*
32	1015100	Blastmaster® 151E Remote Control Switch
33	1015544	Battery Clamp Kit with 3-Prong Twist Lock Plug Installed
34	1015556	3-Prong Twist-Lock Plug – Female *(Two Required)*
35	1015540	16/2 SO Power Cord – Per Foot
36	10SME025	1/4" Straight Swivel
37	1012323	1/4–20 Zinc Lock Nut with Nylon Insert *(Two Required)*
38	1019044	1/4–20 x 1-3/4" Zinc Bolt *(Two Required)*

See page 57 for product literature

PART NUMBERS AND SCHEMATICS GUIDE

Figure 1: Complete 12-Volt DC Electric Conversion Kits – 3.0 and 3.5 Cu. Ft. Abrasive Blasting Pot

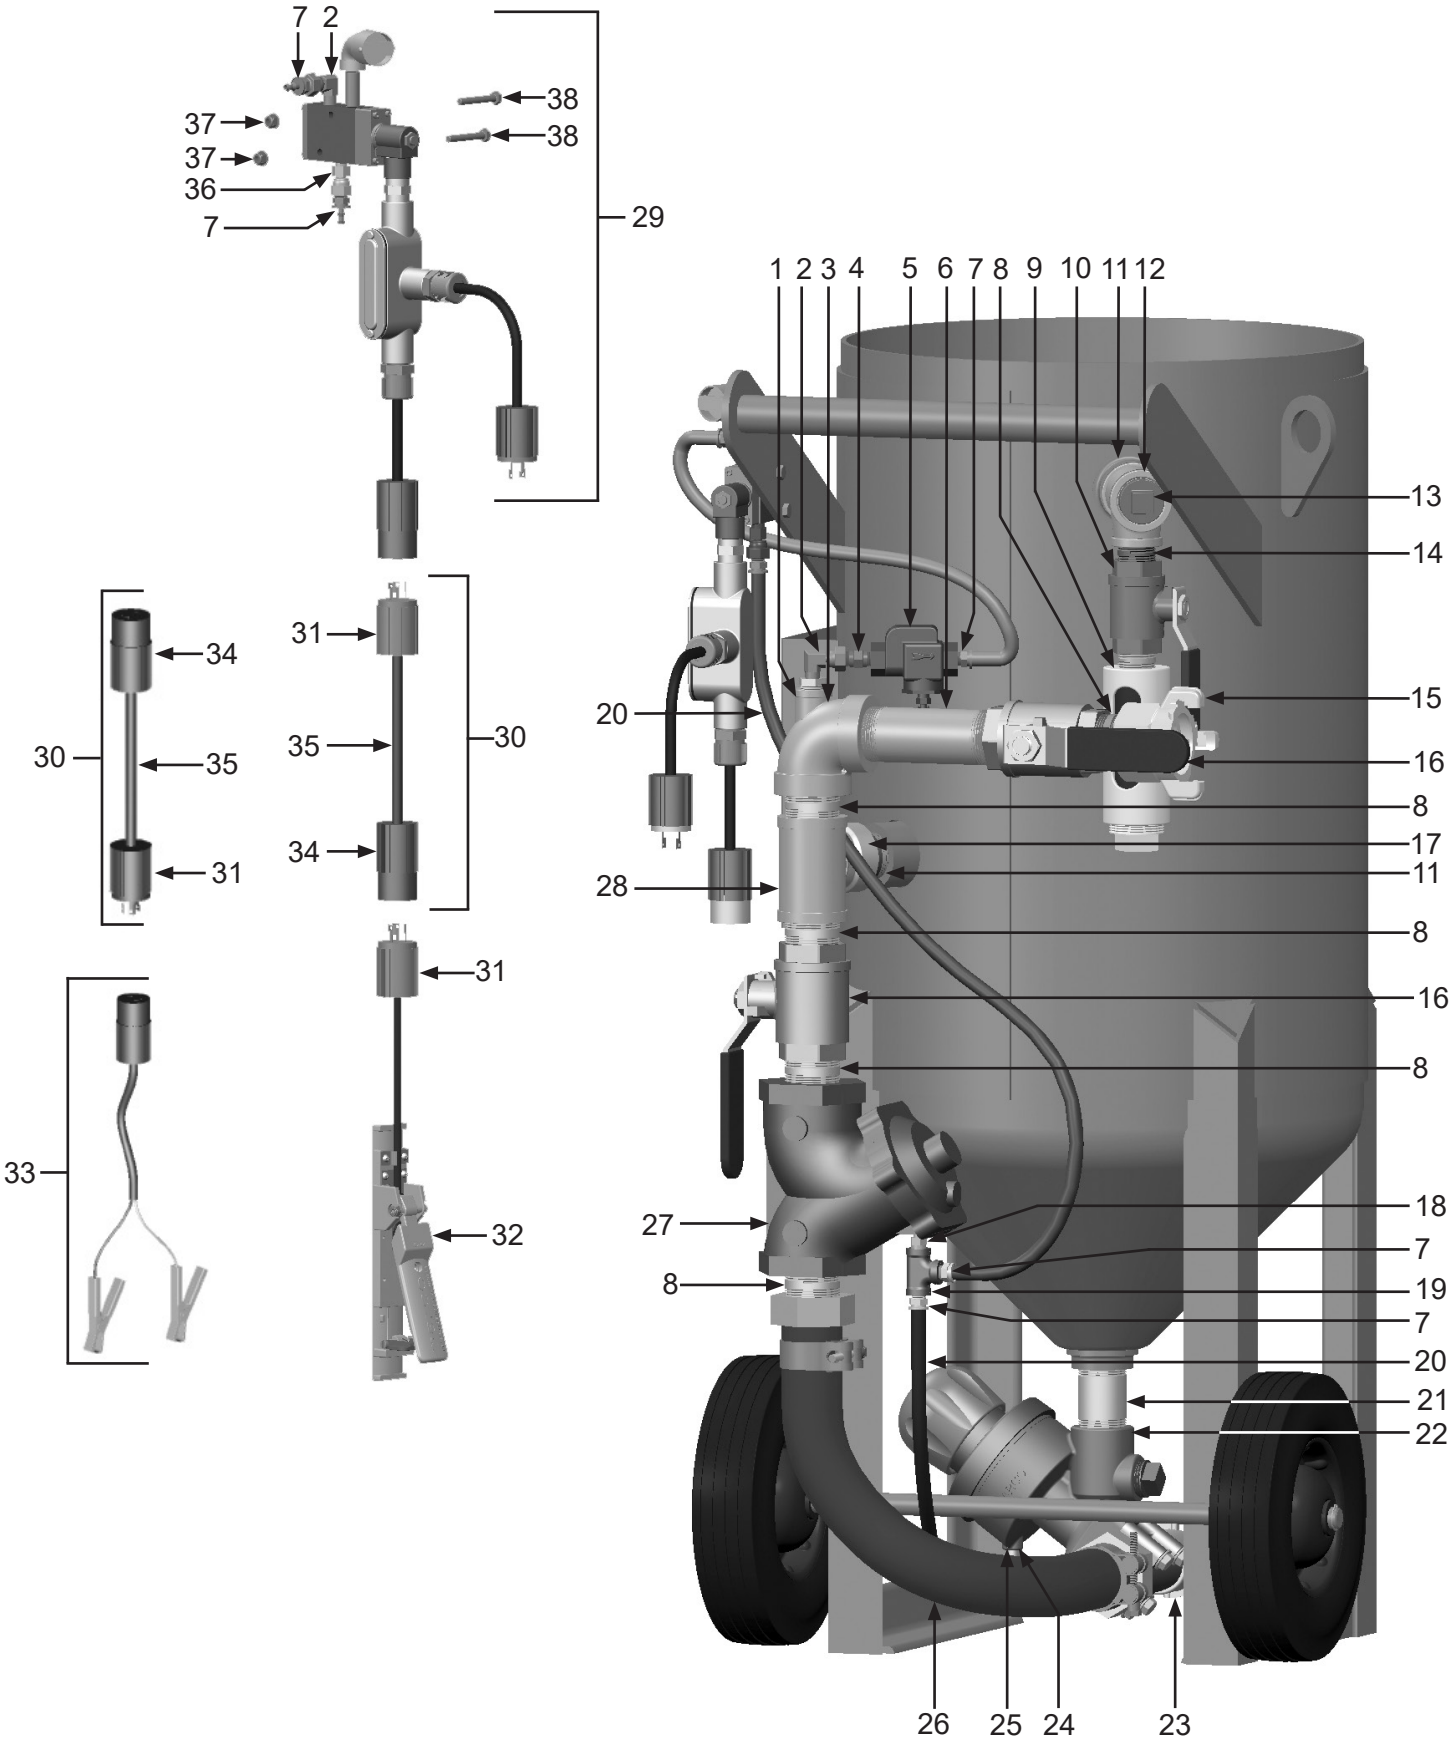


PART NUMBERS AND SCHEMATICS GUIDE

Part Numbers	120-VOLT AC ELECTRIC CONVERSION KITS – 3.0 AND 3.5 CU. FT. ABRASIVE BLASTING POT							
	Blastmaster® 1-1/2" Maxum III Abrasive Metering Valve		GateKeeper Air Valve	Abrasive Blasting Pot Muffler	Blastmaster® 151E Remote Control Switch	120-Volt AC to 12-Volt AC Power Converter	Electric Control Line *(Includes Connectors)*	Power Cord *(Includes Connectors)*
	Urethane	Tungsten Carbide						
10105503	X		1-1/2"	X	X	X	50 Ft.	25 Ft.
10105504		X	1-1/2"	X	X	X	50 Ft.	25 Ft.

For converting bare pot to electric remote control system.
Includes: Blastmaster® Maxum III Abrasive Metering Valve, 1-1/2" GateKeeper, Blastmaster® 151E Remote Control Switch, Electric Control Line, and various pipe fittings
Note that due to the wide variety of blast pots you may need to purchase additional fittings, bushing, etc.

PART NUMBERS AND SCHEMATICS GUIDE

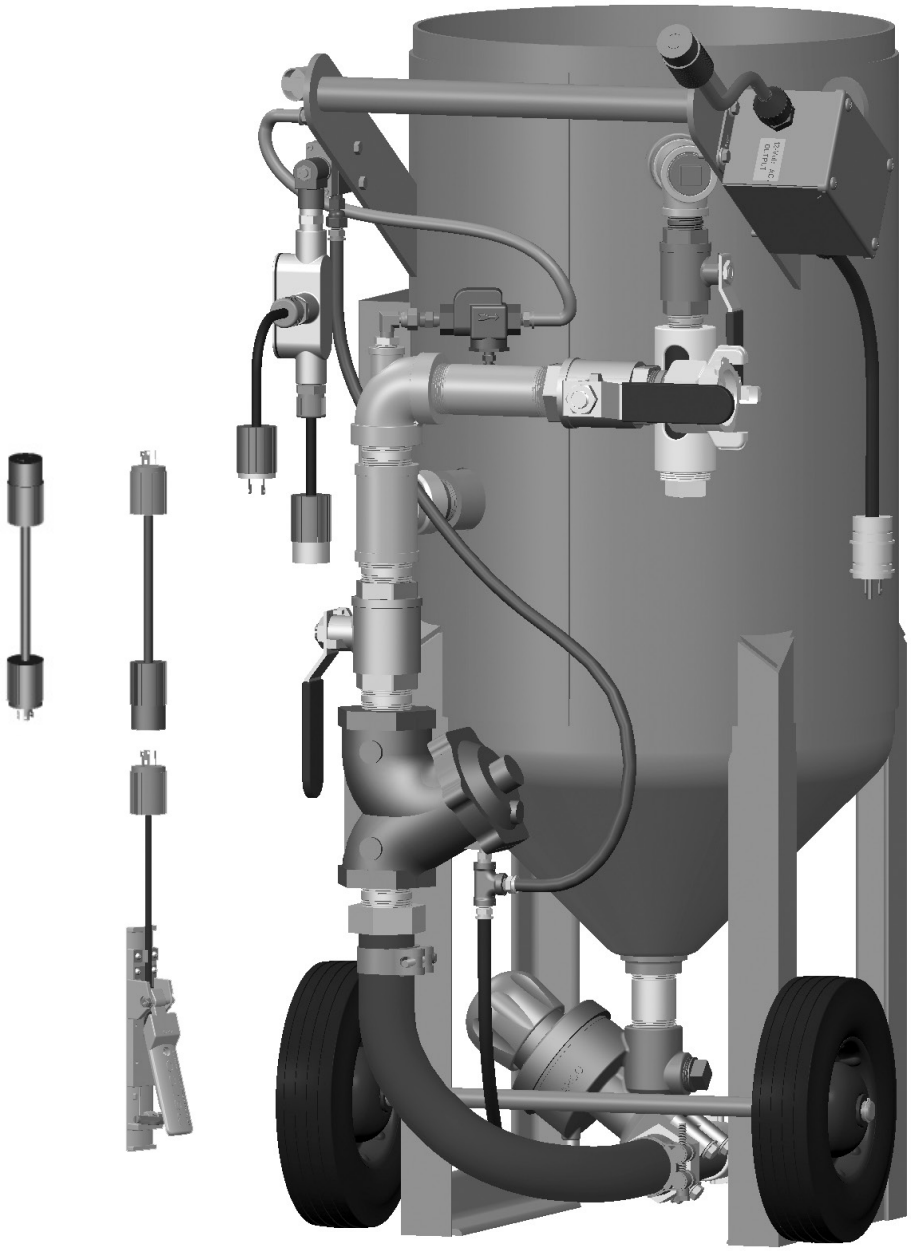


PART NUMBERS AND SCHEMATICS GUIDE

Complete 120-Volt AC Electric Conversion Kits – 3.0 and 3.5 Cu. Ft. Abrasive Blasting Pot

Item #	Part #	Description
Fig. 2		
—	**10105503**	**120-Volt AC Electric Conversion Kit – 3.0 and 3.5 Cu. Ft. (Urethane)**
—	**10105504**	**120-Volt AC Electric Conversion Kit – 3.0 and 3.5 Cu. Ft. (Tungsten Carbide)**
1	1011818	1/2" x 1/4" Bushing
2	1012326	1/4" Swivel 90° Fitting *(Two Required)*
3	1011828	1-1/2" NPT Elbow with 1/2" Side-Out
4	1017019	1/4" x 1/4" Brass Hex Nipple
5	10WS	Watts Strainer
6	1011211	1-1/2" x 5-1/2" NPT Pipe Nipple
7	10PAF025	1/4" Push-On Hose Fitting *(Five Required)*
8	1014015	1-1/2" NPT Close Nipple *(Five Required)*
9	1011100	Exhaust Muffler
10	1011601	1" NPT Full Port Brass Ball Valve
11	1011201	1-1/4" NPT Close Nipple *(Two Required)*
12	1011817	1-1/4" x 1-1/4" x 1" NPT Pipe Tee
13	1011902	1-1/4" NPT Pipe Plug
14	1012151	1" NPT Close Nipple
15	10ME4	1-1/2" NPT (F) 4-Lug Air Hose Fitting
16	1011603	1-1/2" NPT Full Port Brass Ball Valve *(Two Required)*
17	1011830	1-1/4" 45° Street Elbow
18	10PVFIT1	1/4" x 1/8" Hex Union
19	1011844	1/4" NPT Pipe Tee
20	10AH025	1/4" Push-On Air Hose
21	1011204	1-1/4" x 3" NPT Pipe Nipple
22	10101950	1-1/2" Maxum III Abrasive Metering Valve – Tungsten Carbide Sleeve *(For use with 10105504)*
—	10101946	1-1/2" Maxum III Abrasive Metering Valve – Urethane Sleeve *(For use with 10105503)*
23	10SB2S	1-1/2" Straight Thread Pot Coupling
24	10PAF0125	1/8" Push-On Air Hose Fitting
25	1014239	1/8" 90° Swivel Fitting
26	1006312	1-1/2" I.D. Air Hose Pusher Line Assembly
27	1013200	1-1/2" GateKeeper Air Valve
28	1011836	1-1/2" x 1-1/2" x 1-1/4" NPT Pipe Tee
29	1019052	Blastmaster® 190 12-Volt AC Electric Control Assembly – Complete
30	1015545	50' of 16/2 SO Power Cord with 3-Prong Twist-Lock Plugs Installed *(Includes Item #'s: 31, 33, and 34) (Two Required)*
31	1015555	3-Prong Twist-Lock Plug – Male *(Three Required)*
32	1015100	Blastmaster® 151E Remote Control Switch
33	1015556	3-Prong Twist-Lock Plug – Female *(Two Required)*
34	1015540	16/2 SO Power Cord – Per Foot
35	10SME025	1/4" Straight Swivel
36	1012323	1/4–20 Zinc Lock Nut with Nylon Insert *(Six Required)*
37	1019044	1/4–20 x 1-3/4" Zinc Bolt *(Two Required)*
38	1030020	120-Volt AC to 12-Volt AC Power Converter
39	1014017	1/4" Flat Washer *(Four Required)*
40	1012154	1/4–20 x 1" Hex Bolt *(Four Required)*

See page 57 for product literature

Figure 2: Complete 120-Volt AC Electric Conversion Kits – 3.0 and 3.5 Cu. Ft. Abrasive Blasting Pot

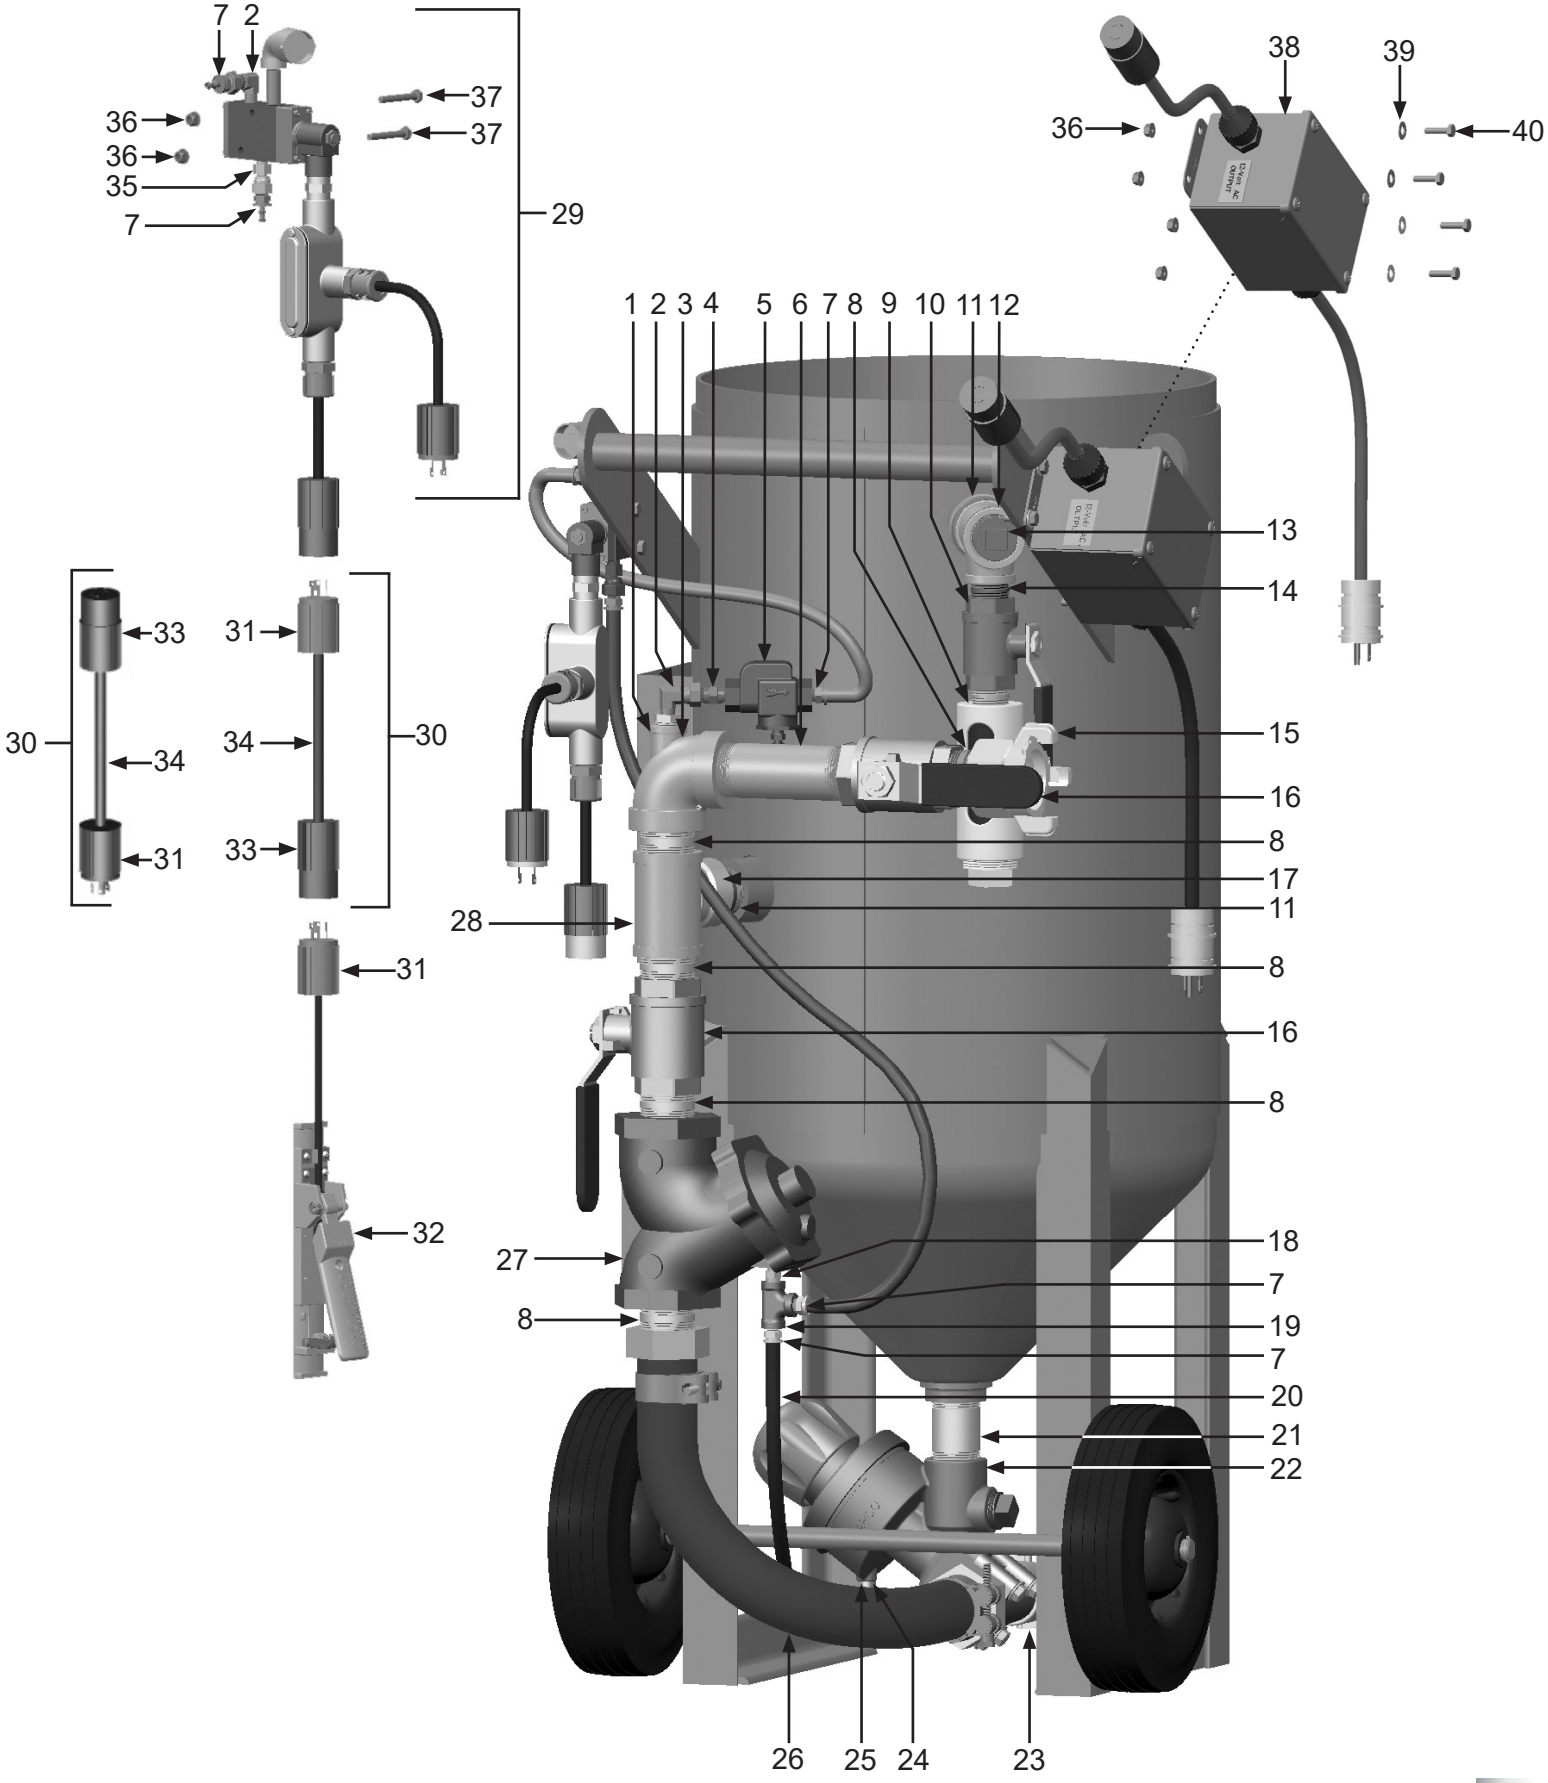


PART NUMBERS AND SCHEMATICS GUIDE

	12-VOLT DC ELECTRIC CONVERSION KITS – 6.0 AND 6.5 CU. FT. ABRASIVE BLASTING POT							
	Blastmaster® 1-1/2" Maxum III Abrasive Metering Valve							
Part Numbers	**Urethane**	**Tungsten Carbide**	**GateKeeper Air Valve**	**Abrasive Blasting Pot Muffler**	**Blastmaster® 151E Remote Control Switch**	**Electric Control Line** *(Includes Connectors)*	**Battery Clamps**	**Power Cord** *(Includes Connectors)*
10105928	X		1-1/2" High-Flow	X	X	50 Ft.	X	25 Ft.
10104975		X	1-1/2" High-Flow	X	X	50 Ft.	X	25 Ft.

For converting bare pot to electric remote control system.
Includes: Blastmaster® Maxum III Abrasive Metering Valve, 1-1/2" High-Flow GateKeeper, Blastmaster® 151E Remote Control Switch, Electric Control Line, and various pipe fittings
Note that due to the wide variety of blast pots you may need to purchase additional fittings, bushing, etc.

PART NUMBERS AND SCHEMATICS GUIDE

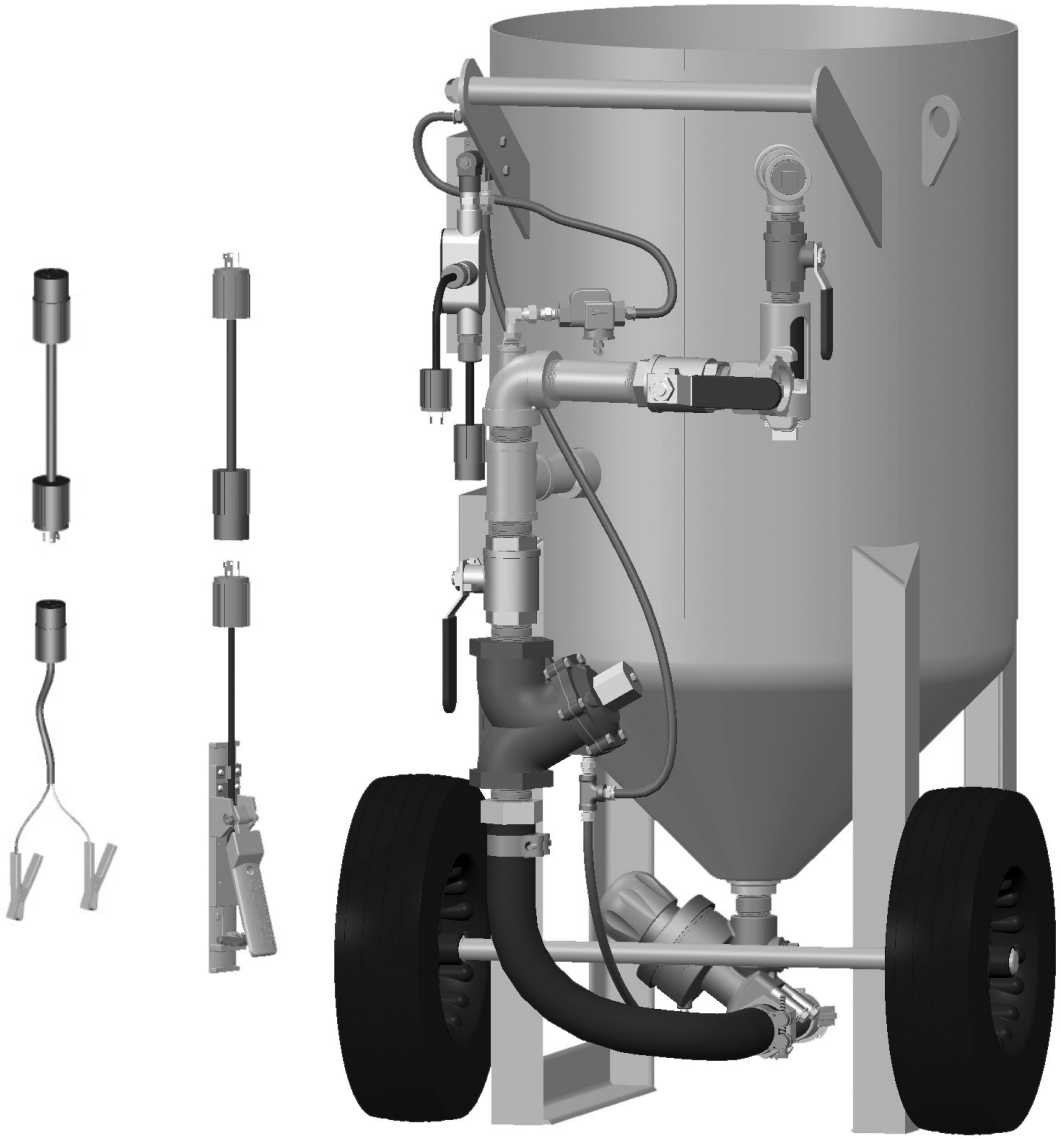


PART NUMBERS AND SCHEMATICS GUIDE

Complete 12-Volt DC Electric Conversion Kits – 6.0 and 6.5 Cu. Ft. Abrasive Blasting Pot

Item #	Part #	Description
Fig. 3		
—	**10105928**	**12-Volt DC Electric Conversion Kit – 6.0 and 6.5 Cu. Ft. (Urethane)**
—	**10104975**	**12-Volt DC Electric Conversion Kit – 6.0 and 6.5 Cu. Ft. (Tungsten Carbide)**
1	1011818	1/2" x 1/4" Bushing
2	1012326	1/4" Swivel 90° Fitting *(Two Required)*
3	1011828	1-1/2" NPT Elbow with 1/2" Side-Out
4	1017019	1/4" x 1/4" Brass Hex Nipple
5	10WS	Watts Strainer
6	1011211	1-1/2" x 5-1/2" NPT Pipe Nipple
7	10PAF025	1/4" Push-On Hose Fitting *(Five Required)*
8	1014015	1-1/2" NPT Close Nipple *(Five Required)*
9	1011100	Exhaust Muffler
10	1011601	1" NPT Full Port Brass Ball Valve
11	1011201	1-1/4" NPT Close Nipple
12	1011817	1-1/4" x 1-1/4" x 1" NPT Pipe Tee
13	1011902	1-1/4" NPT Pipe Plug
14	1012151	1" NPT Close Nipple
15	10ME4	1-1/2" NPT (F) 4-Lug Air Hose Fitting
16	1011603	1-1/2" NPT Full Port Brass Ball Valve *(Two Required)*
17	1011204	1-1/4" x 3" Galvanized Nipple
18	1017019	1/4" x 1/4" Brass Hex Nipple, 250 psi
19	1011844	1/4" NPT Pipe Tee
20	10AH025	1/4" Push-On Air Hose – Per Foot
21	1011813	1-1/4" x 2" Pipe Nipple
22	10101950	1-1/2" Maxum III Abrasive Metering Valve – Tungsten Carbide Sleeve *(For use with 10104975)*
—	10101946	1-1/2" Maxum III Abrasive Metering Valve – Urethane Sleeve *(For use with 10105928)*
23	10SB2S	1-1/2" Straight Thread Pot Coupling
24	10PAF0125	1/8" Push-On Air Hose Fitting
25	1014239	1/8" 90° Swivel Fitting
26	1006312	1-1/2" I.D. Air Hose Pusher Line Assembly
27	1013600	1-1/2" High-Flow GateKeeper Air Valve
28	1011836	1-1/2" x 1-1/2" x 1-1/4" NPT Pipe Tee
29	1019051	Blastmaster® 190 12-Volt DC Electric Control Assembly – Complete
30	1015545	50' of 16/2 SO Power Cord with 3-Prong Twist-Lock Plugs Installed *(Includes Item #'s: 31, 34, and 35) (Two Required)*
31	1015555	3-Prong Twist-Lock Plug – Male *(Three Required)*
32	1015100	Blastmaster® 151E Remote Control Switch
33	1015544	Battery Clamp Kit with 3-Prong Twist Lock Plug Installed
34	1015556	3-Prong Twist-Lock Plug – Female *(Two Required)*
35	1015540	16/2 SO Power Cord – Per Foot
36	10SME025	1/4" Straight Swivel
37	1012323	1/4–20 Zinc Lock Nut with Nylon Insert *(Two Required)*
38	1019044	1/4–20 x 1-3/4" Zinc Bolt *(Two Required)*

See page 57 for product literature

Figure 3: Complete 12-Volt DC Electric Conversion Kits – 6.0 and 6.5 Cu. Ft. Abrasive Blasting Pot

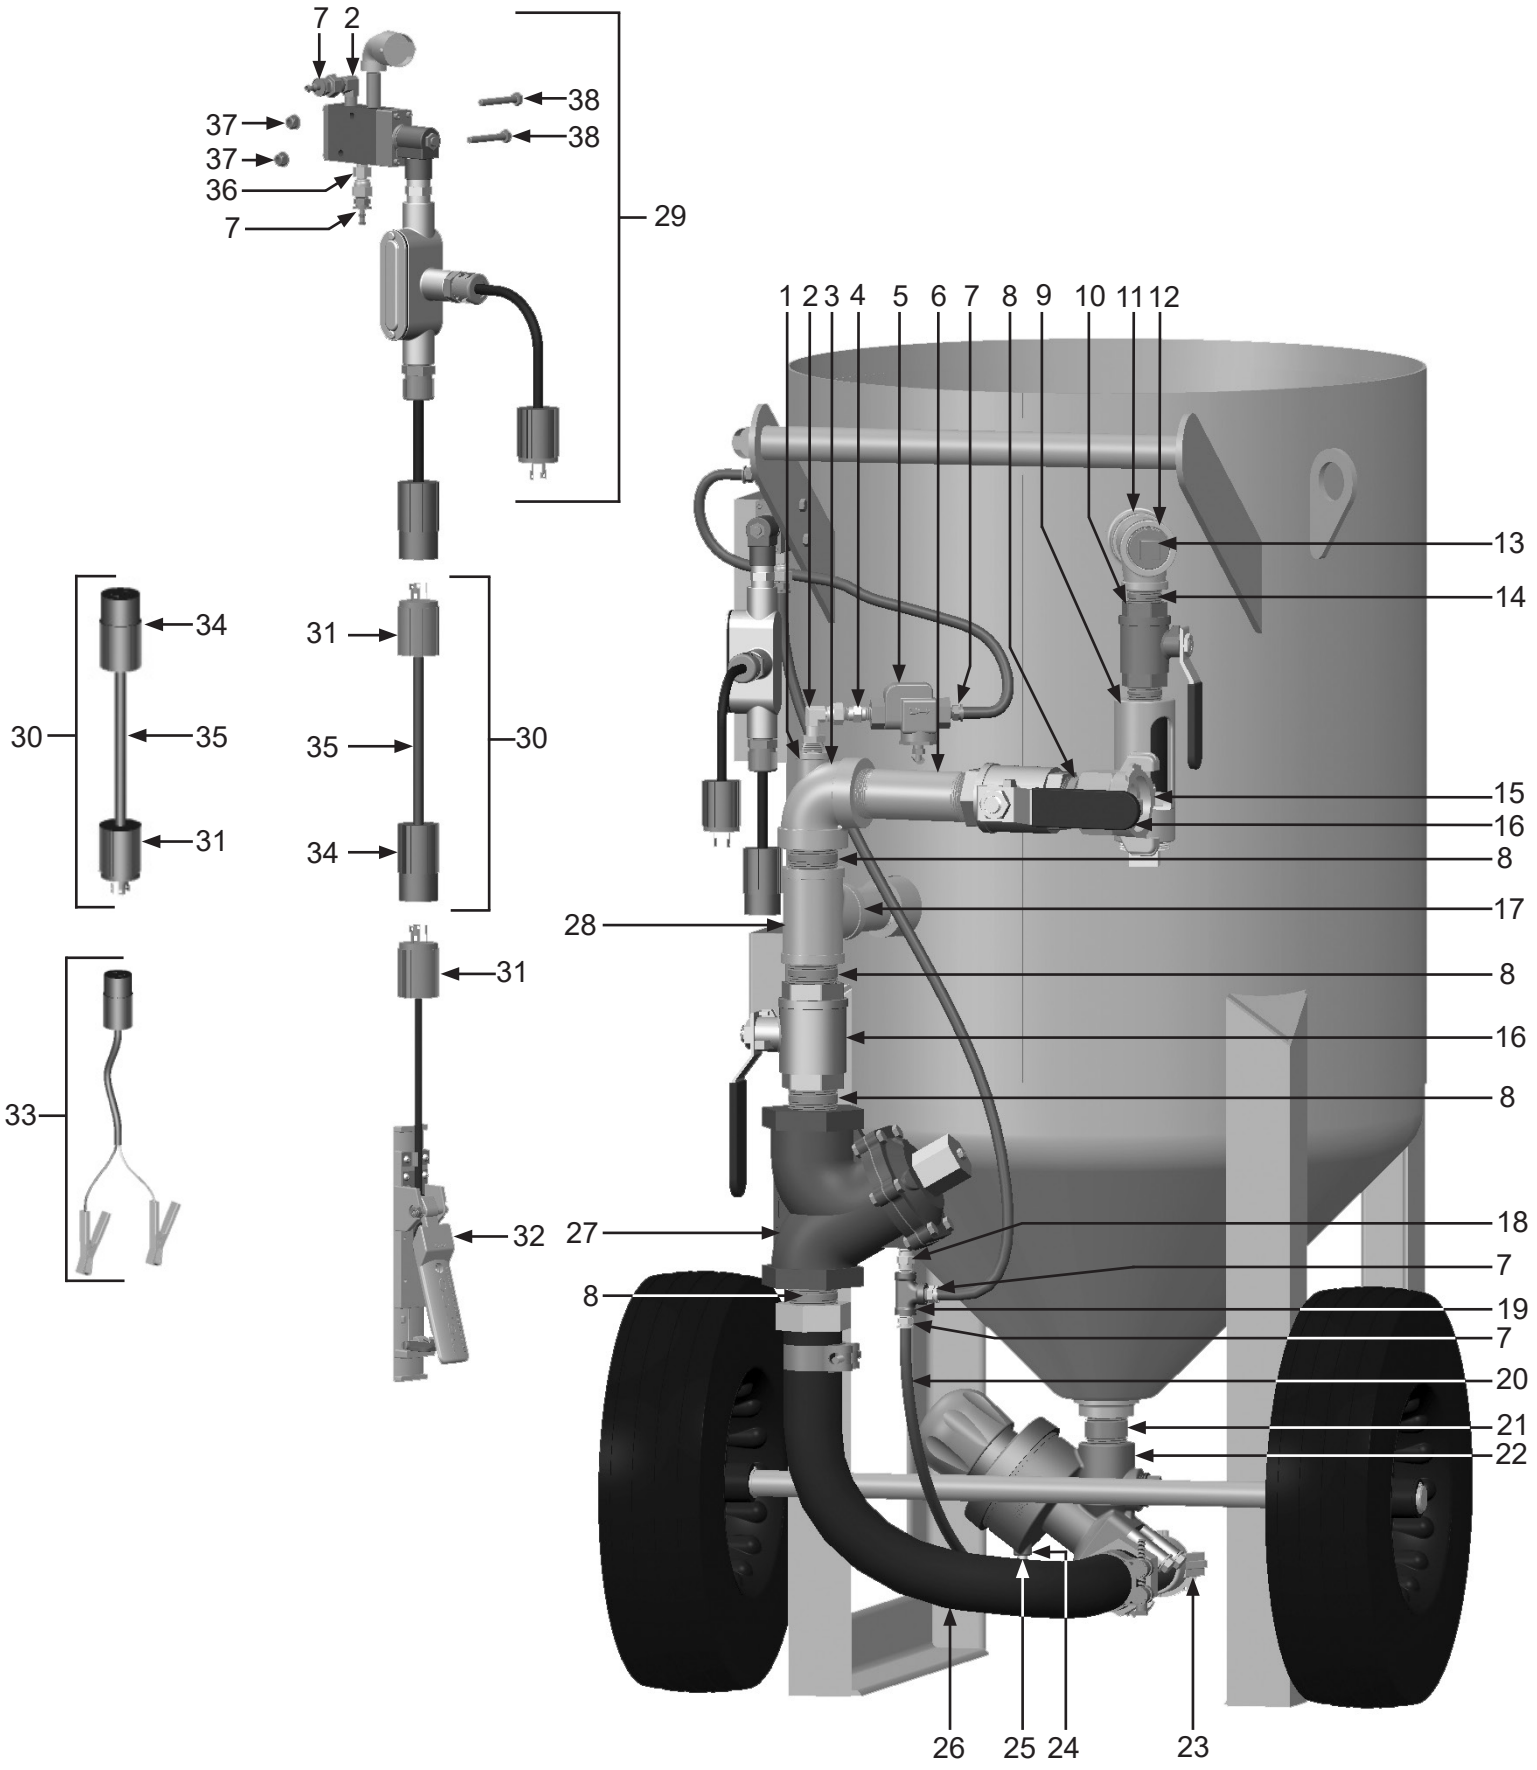


PART NUMBERS AND SCHEMATICS GUIDE

	120-VOLT AC ELECTRIC CONVERSION KITS – 6.0 AND 6.5 CU. FT. ABRASIVE BLASTING POT							
	Blastmaster® 1-1/2" Maxum III Abrasive Metering Valve							
Part Numbers	**Urethane**	**Tungsten Carbide**	**GateKeeper Air Valve**	**Abrasive Blasting Pot Muffler**	**Blastmaster® 151E Remote Control Switch**	**120-Volt AC to 12-Volt AC Power Converter**	**Electric Control Line** *(Includes Connectors)*	**Power Cord** *(Includes Connectors)*
10105929	X		1-1/2" High-Flow	X	X	X	50 Ft.	25 Ft.
10105505		X	1-1/2" High-Flow	X	X	X	50 Ft.	25 Ft.

For converting bare pot to electric remote control system.
Includes: Blastmaster® Maxum III Abrasive Metering Valve, 1-1/2" High-Flow GateKeeper, Blastmaster® 151E Remote Control Switch, Electric Control Line, and various pipe fittings
Note that due to the wide variety of blast pots you may need to purchase additional fittings, bushing, etc.

PART NUMBERS AND SCHEMATICS GUIDE

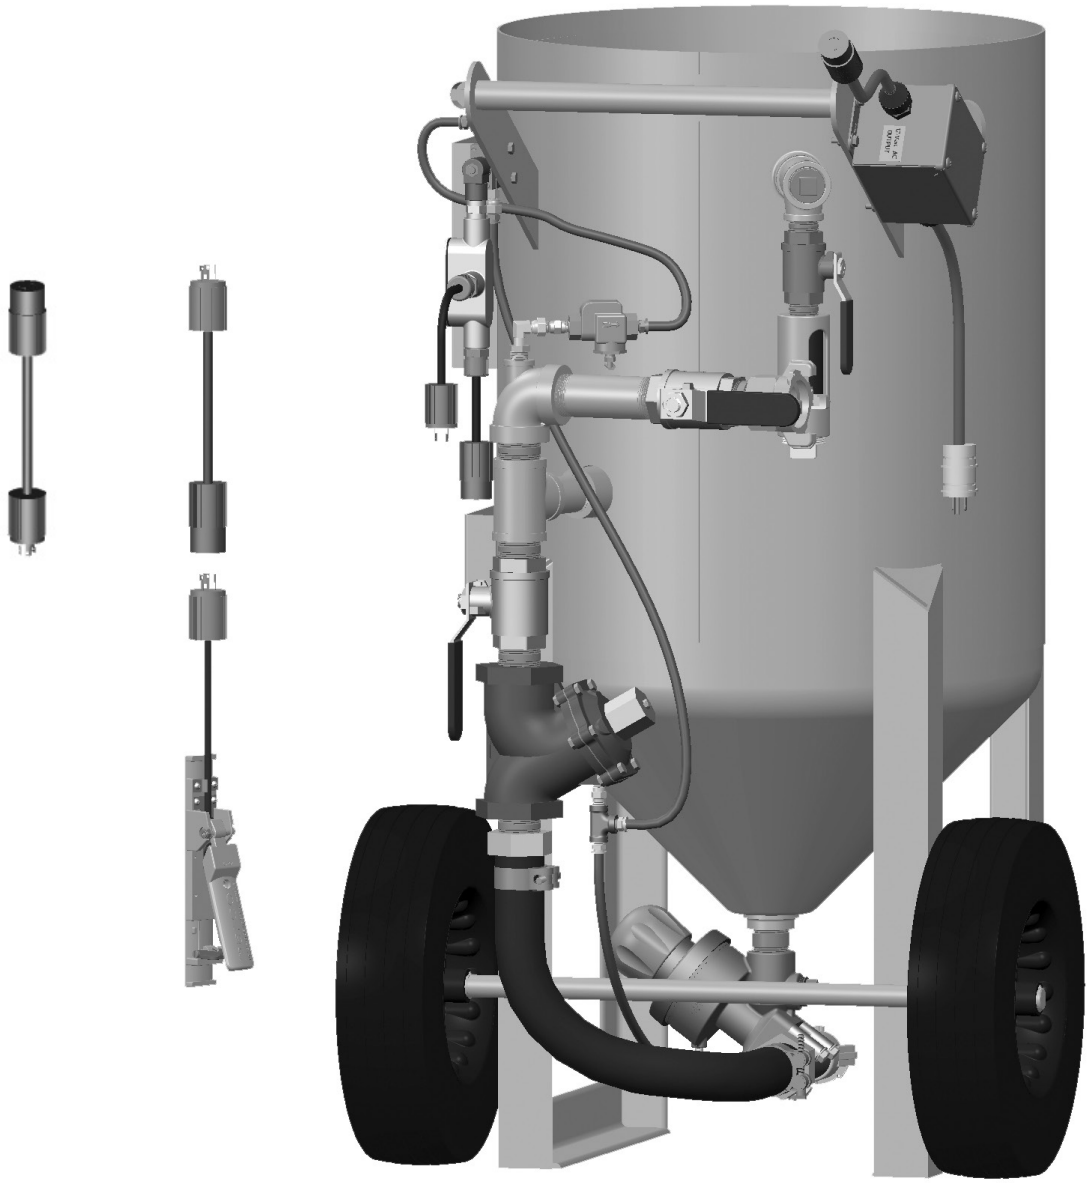


PART NUMBERS AND SCHEMATICS GUIDE

Complete 120-Volt AC Electric Conversion Kits – 6.0 and 6.5 Cu. Ft. Abrasive Blasting Pot

Item #	Part #	Description
Fig. 4		
—	**10105929**	**120-Volt AC Electric Conversion Kit – 6.0 and 6.5 Cu. Ft. (Urethane)**
—	**10105505**	**120-Volt AC Electric Conversion Kit – 6.0 and 6.5 Cu. Ft. (Tungsten Carbide)**
1	1011818	1/2" x 1/4" Bushing
2	1012326	1/4" Swivel 90° Fitting *(Two Required)*
3	1011828	1-1/2" NPT Elbow with 1/2" Side-Out
4	1017019	1/4" x 1/4" Brass Hex Nipple
5	10WS	Watts Strainer
6	1011211	1-1/2" x 5-1/2" NPT Pipe Nipple
7	10PAF025	1/4" Push-On Hose Fitting *(Five Required)*
8	1014015	1-1/2" NPT Close Nipple *(Five Required)*
9	1011100	Exhaust Muffler
10	1011601	1" NPT Full Port Brass Ball Valve
11	1011201	1-1/4" NPT Close Nipple
12	1011817	1-1/4" x 1-1/4" x 1" NPT Pipe Tee
13	1011902	1-1/4" NPT Pipe Plug
14	1012151	1" NPT Close Nipple
15	10ME4	1-1/2" NPT (F) 4-Lug Air Hose Fitting
16	1011603	1-1/2" NPT Full Port Brass Ball Valve *(Two Required)*
17	1011204	1-1/4" x 3" Galvanized Nipple
18	1017019	1/4" x 1/4" Brass Hex Nipple, 250 psi
19	1011844	1/4" NPT Pipe Tee
20	10AH025	1/4" Push-On Air Hose – Per Foot
21	1011813	1-1/4" x 2" Pipe Nipple
22	10101950	1-1/2" Maxum III Abrasive Metering Valve – Tungsten Carbide Sleeve *(For use with 10105505)*
—	10101946	1-1/2" Maxum III Abrasive Metering Valve – Urethane Sleeve *(For use with 10105929)*
23	10SB2S	1-1/2" Straight Thread Pot Coupling
24	10PAF0125	1/8" Push-On Air Hose Fitting
25	1014239	1/8" 90° Swivel Fitting
26	1006312	1-1/2" I.D. Air Hose Pusher Line Assembly
27	1013600	1-1/2" High-Flow GateKeeper Air Valve
28	1011836	1-1/2" x 1-1/2" x 1-1/4" NPT Pipe Tee
29	1019052	Blastmaster® 190 12-Volt AC Electric Control Assembly – Complete
30	1015545	50' of 16/2 SO Power Cord with 3-Prong Twist-Lock Plugs Installed *(Includes Item #'s: 31, 33, and 34) (Two Required)*
31	1015555	3-Prong Twist-Lock Plug – Male *(Three Required)*
32	1015100	Blastmaster® 151E Remote Control Switch
33	1015556	3-Prong Twist-Lock Plug – Female *(Two Required)*
34	1015540	16/2 SO Power Cord – Per Foot
35	10SME025	1/4" Straight Swivel
36	1012323	1/4–20 Zinc Lock Nut with Nylon Insert *(Six Required)*
37	1019044	1/4–20 x 1-3/4" Zinc Bolt *(Two Required)*
38	1030020	120-Volt AC to 12-Volt AC Power Converter
39	1014017	1/4" Flat Washer *(Four Required)*
40	1012154	1/4–20 x 1" Hex Bolt *(Four Required)*

See page 57 for product literature

Figure 4: Complete 120-Volt AC Electric Conversion Kits – 6.0 and 6.5 Cu. Ft. Abrasive Blasting Pot

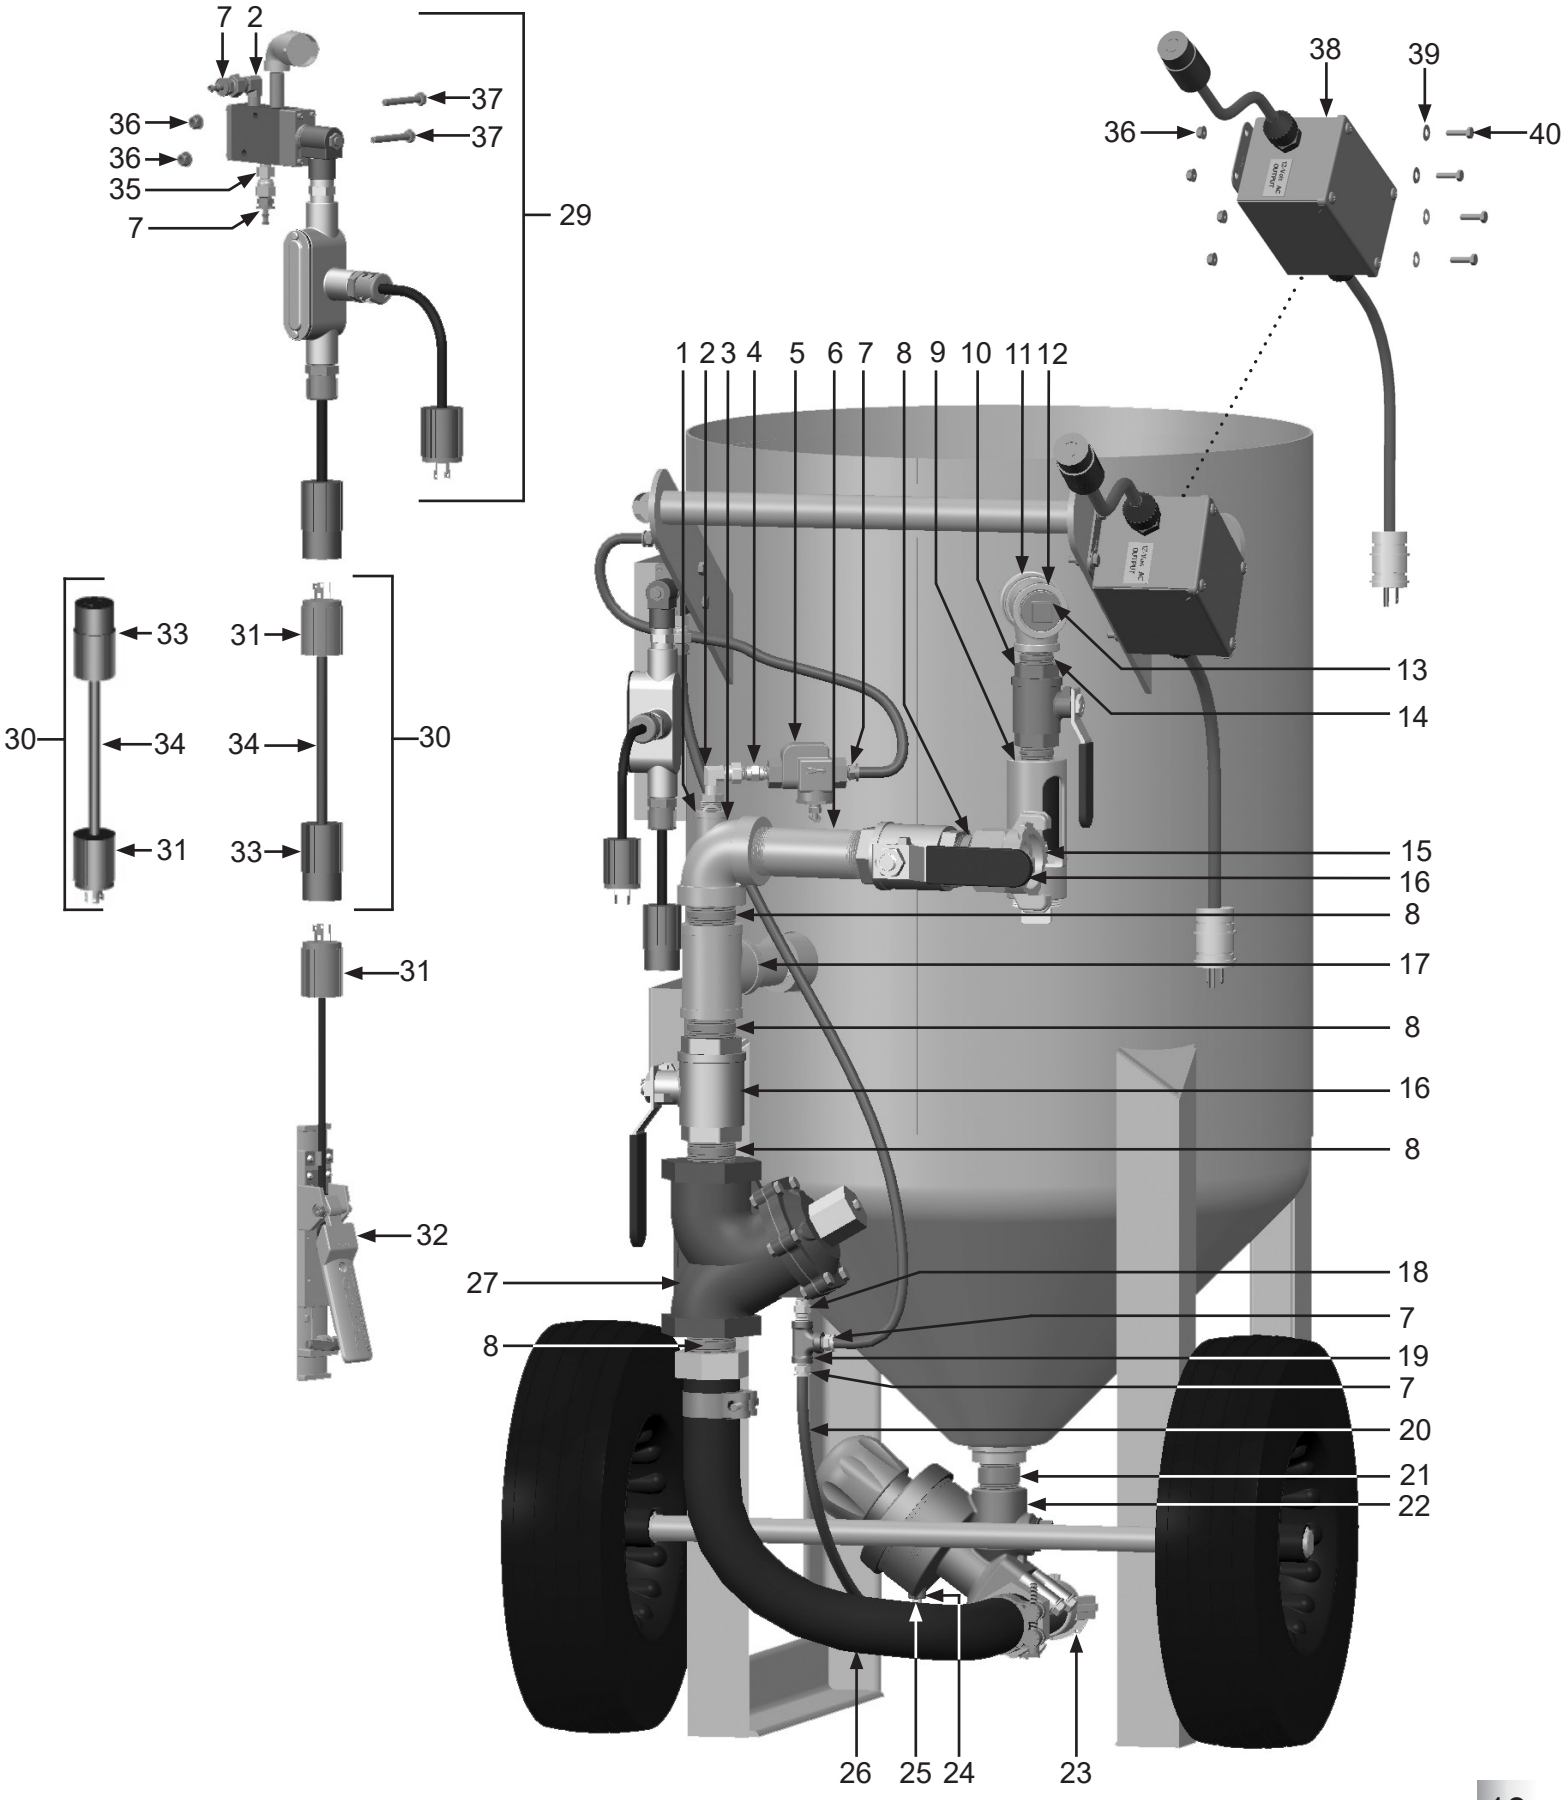


PART NUMBERS AND SCHEMATICS GUIDE

12-VOLT DC ELECTRIC CONVERSION KITS – 120 CU. FT. AND LARGER ABRASIVE BLASTING POT

Part Numbers	Number of Outlets				Blastmaster® 1-1/2" Maxum III Abrasive Metering Valve		GateKeeper Air Valve	Electric Remote Control Switch	Electric Control Line *(Includes Connectors)*	Junction Box	Battery Clamps	Power Cord *(Includes Connectors)*
	1	2	3	4	Urethane	Tungsten Carbide						
10106190	X				X		1-1/2" High-Flow	151E	50 Ft.		X	25 Ft.
10106191	X					X	1-1/2" High-Flow	151E	50 Ft.		X	25 Ft.
10105064		X			X		1-1/2" High-Flow	151E	50 Ft.	X	X	25 Ft.
10104993		X				X	1-1/2" High-Flow	151E	50 Ft.	X	X	25 Ft.
10105065			X		X		1-1/2" High-Flow	151E	50 Ft.	X	X	25 Ft.
10104994			X			X	1-1/2" High-Flow	151E	50 Ft.	X	X	25 Ft.
10105066				X	X		1-1/2" High-Flow	151E	50 Ft.	X	X	25 Ft.
10104995				X		X	1-1/2" High-Flow	151E	50 Ft.	X	X	25 Ft.
10109053				X		X	1-1/2” High-Flow	156E	50 Ft.	X	X	25 Ft.
10110555				X		X	1-1/2” High-Flow	155E	50 Ft.	X	X	25 Ft.

For converting bare pot to electric remote control system.
Includes: Blastmaster® Maxum III Abrasive Metering Valve, Blastmaster® 130E Remote Control System with 1-1/2" High-Flow GateKeeper, Pusher Line, Junction Box, Blastmaster® 190 Remote Control Valve
Note that due to the wide variety of blast pots you may need to purchase additional fittings, bushing, etc.

PART NUMBERS AND SCHEMATICS GUIDE

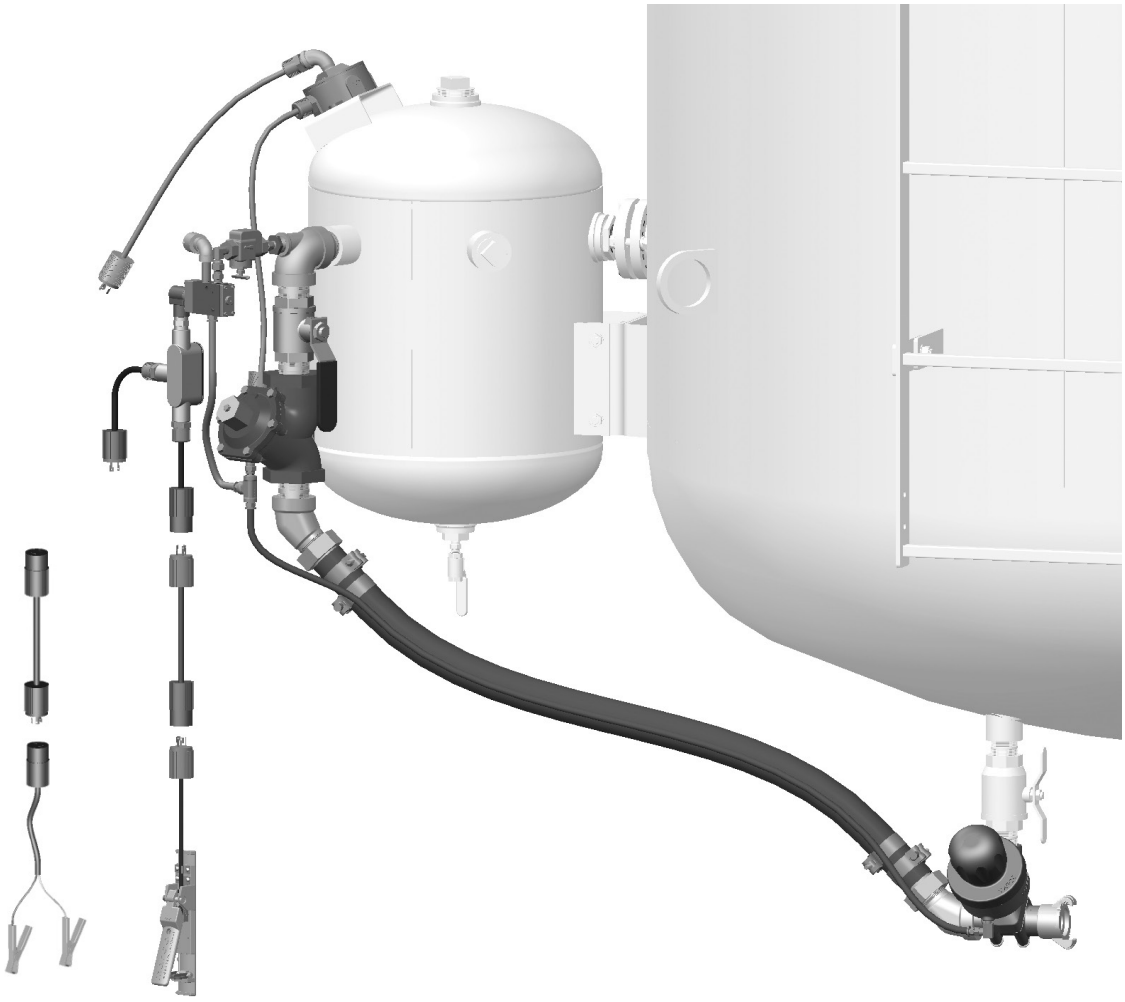


PART NUMBERS AND SCHEMATICS GUIDE

Complete 12-Volt DC Electric Conversion Kit – 120 Cu. Ft and Larger Abrasive Blasting Pot – 1-Outlet

Item #	Part #	Description
Fig. 5		
—	**10106190**	**12-Volt DC Electric Conversion Kit – 120 Cu. Ft. and Larger – 1-Outlet (Urethane)**
—	**10106191**	**12-Volt DC Electric Conversion Kit – 120 Cu. Ft. and Larger – 1-Outlet (Tungsten Carbide)**
1	1014015	1-1/2” Close Nipple *(Four Required)*
2	10AH112B	1-1/2" I.D. Air Hose - Per Foot
3	10101950	1-1/2" Maxum III Abrasive Metering Valve – Tungsten Carbide Sleeve *(For use with 10106191)*
—	10101946	1-1/2" Maxum III Abrasive Metering Valve – Urethane Sleeve *(For use with 10106190)*
4	1011201	1-1/4" NPT Close Nipple
5	10SB2S	1-1/2" NPT Brass Tank Coupling
6	1014239	1/8" 90° Swivel Fitting
7	10PAF0125	1/8" Push-On Air Hose Fitting
8	1011805	1-1/2" NPT 45° Street Elbow *(Two Required)*
9	10SFE4	1-1/2" NPT Swivel Female Air Hose Fitting *(Two Required)*
10	10103738	1-1/2" T-Bolt Hose Clamp *(Four Required)*
11	10AH025	1/4" Push-On Air Hose - Per Foot
12	10PAF025	1/4" Push-On Hose Fitting *(Three Required)*
13	1011844	1/4" NPT Pipe Tee
14	1017019	1/4" NPT Hex Nipple *(Three Required)*
15	1013600	1-1/2" High-Flow GateKeeper Air Valve
16	1011603	1-1/2" NPT Full Port Brass Ball Valve
17	1011829	1-1/2" NPT Elbow with 3/4" Side-Out
18	10SME025	1/4" Straight Swivel
19	1019010	12-Volt DC 190 Electric Solenoid
20	10DE025	1/4" NPT Dust Eliminator
21	1011824	1/4" Street Elbow
22	1012326	1/4" Swivel 90° Fitting
23	10WS	Watts Strainer
24	10100524	3/4” X 1/4” Bushing
25	1015100	Blastmaster® 151E Remote Control Switch
26	1015555	3-Prong Twist-Lock Plug – Male
27	1015556	3-Prong Twist-Lock Plug – Female
28	1015540	16/2 SJ Power Cord – Per Foot
29	1015545	50' of 16/2 SO Power Cord with 3-Prong Twist-Lock Plugs Installed *(Includes Item #’s: 26, 27, and 28) (Two Required)*
30	1019051	Blastmaster® 190 12-Volt DC Electric Control Assembly – Complete *(Includes Item #’s: 19, 20, and 21)*
31	1015544	Battery Clamp Kit with 3-Prong Twist-Lock Plug Installed

See page 57 for product literature

Figure 5: Complete 12-Volt DC Electric Conversion Kit – 120 Cu. Ft and Larger Abrasive Blasting Pot – 1-Outlet

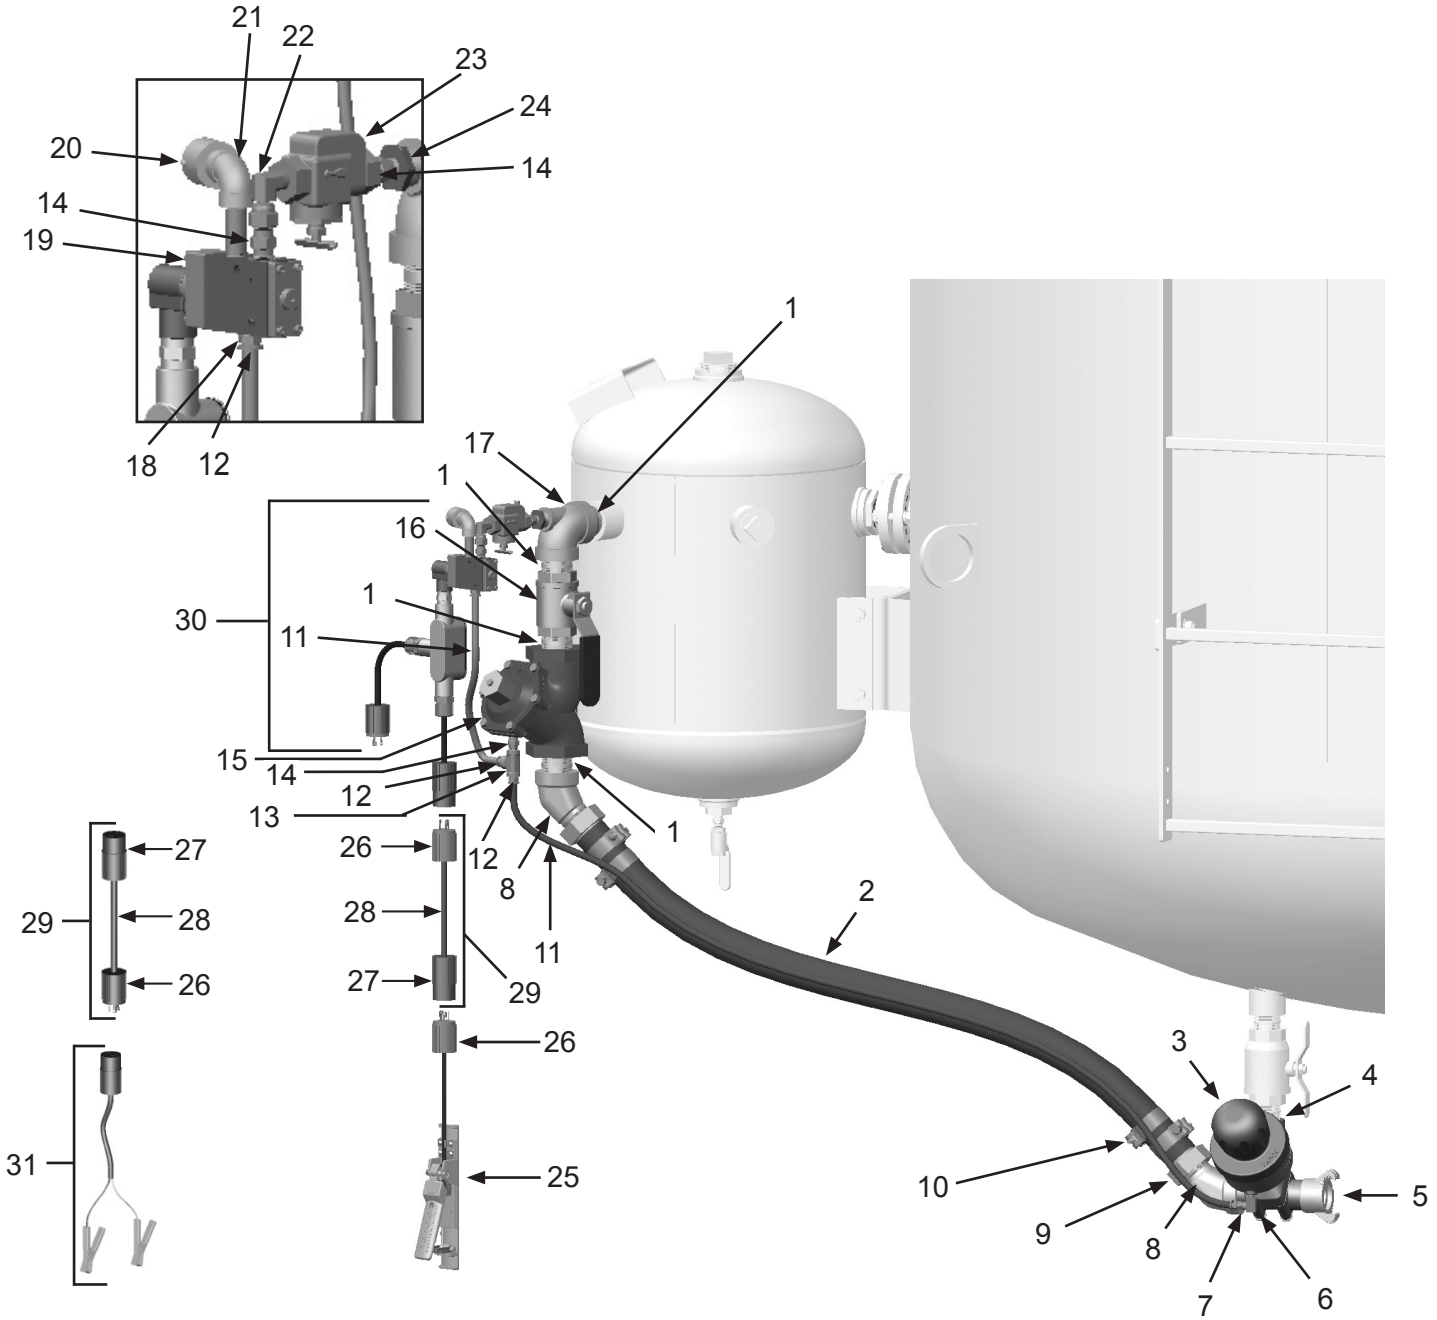


PART NUMBERS AND SCHEMATICS GUIDE

Complete 12-Volt DC Electric Conversion Kit – 120 Cu. Ft and Larger Abrasive Blasting Pot – 2-Outlet

Item #	Part #	Description
Fig. 6		
—	**10105064**	**12-Volt DC Electric Conversion Kit – 120 Cu. Ft. and Larger – 2-Outlet (Urethane)**
—	**10104993**	**12-Volt DC Electric Conversion Kit – 120 Cu. Ft. and Larger – 2-Outlet (Tungsten Carbide)**
1	1014015	1-1/2” Close Nipple *(Eight Required)*
2	10AH112B	1-1/2" I.D. Air Hose - Per Foot
3	10101950	1-1/2" Maxum III Abrasive Metering Valve – Tungsten Carbide Sleeve *(Two Required) (For use with 10104993)*
—	10101946	1-1/2" Maxum III Abrasive Metering Valve – Urethane Sleeve *(Two Required) (For use with 10105064)*
4	1011201	1-1/4" NPT Close Nipple *(Two Required)*
5	10SB2S	1-1/2" NPT Brass Tank Coupling *(Two Required)*
6	1014239	1/8" 90° Swivel Fitting *(Two Required)*
7	10PAF0125	1/8" Push-On Air Hose Fitting *(Two Required)*
8	1011805	1-1/2" NPT 45° Street Elbow *(Four Required)*
9	10SFE4	1-1/2" NPT Swivel Female Air Hose Fitting *(Four Required)*
10	10103738	1-1/2" T-Bolt Hose Clamp *(Eight Required)*
11	10AH025	1/4" Push-On Air Hose - Per Foot
12	10PAF025	1/4" Push-On Hose Fitting *(Six Required)*
13	1011844	1/4" NPT Pipe Tee *(Two Required)*
14	1017019	1/4" NPT Hex Nipple *(Three Required)*
15	1013600	1-1/2" High-Flow GateKeeper Air Valve *(Two Required)*
16	1011603	1-1/2" NPT Full Port Brass Ball Valve *(Two Required)*
17	1011829	1-1/2" NPT Elbow with 3/4" Side-Out *(Two Required)*
18	10SME025	1/4" Straight Swivel *(Two Required)*
19	1019010	12-Volt DC 190 Electric Solenoid *(Two Required)*
20	10DE025	1/4" NPT Dust Eliminator *(Two Required)*
21	1011824	1/4" Street Elbow *(Two Required)*
22	1012326	1/4" Swivel 90° Fitting *(Two Required)*
23	10WS	Watts Strainer *(Two Required)*
24	10100524	3/4” X 1/4” Bushing *(Two Required)*
25	1015100	Blastmaster® 151E Remote Control Switch *(Two Required)*
26	1015555	3-Prong Twist-Lock Plug – Male *(Two Required)*
27	1015556	3-Prong Twist-Lock Plug – Female *(Two Required)*
28	1015540	16/2 Power Cord – Per Foot
29	1015545	50' of 16/2 Power Cord with 3-Prong Twist-Lock Plugs Installed *(Includes Item #’s: 26, 27, and 28) (Three Required)*
30	1019051	Blastmaster® 190 12-Volt DC Electric Control Assembly –Complete *(Includes Item #’s: 19, 20, and 21) (Two Required)*
31	1015544	Battery Clamp Kit with 3-Prong Twist-Lock Plug Installed
32	10100559	2-Outlet Power Distribution Box

See page 57 for product literature

Figure 6: Complete 12-Volt DC Electric Conversion Kit – 120 Cu. Ft and Larger Abrasive Blasting Pot – 2-Outlet

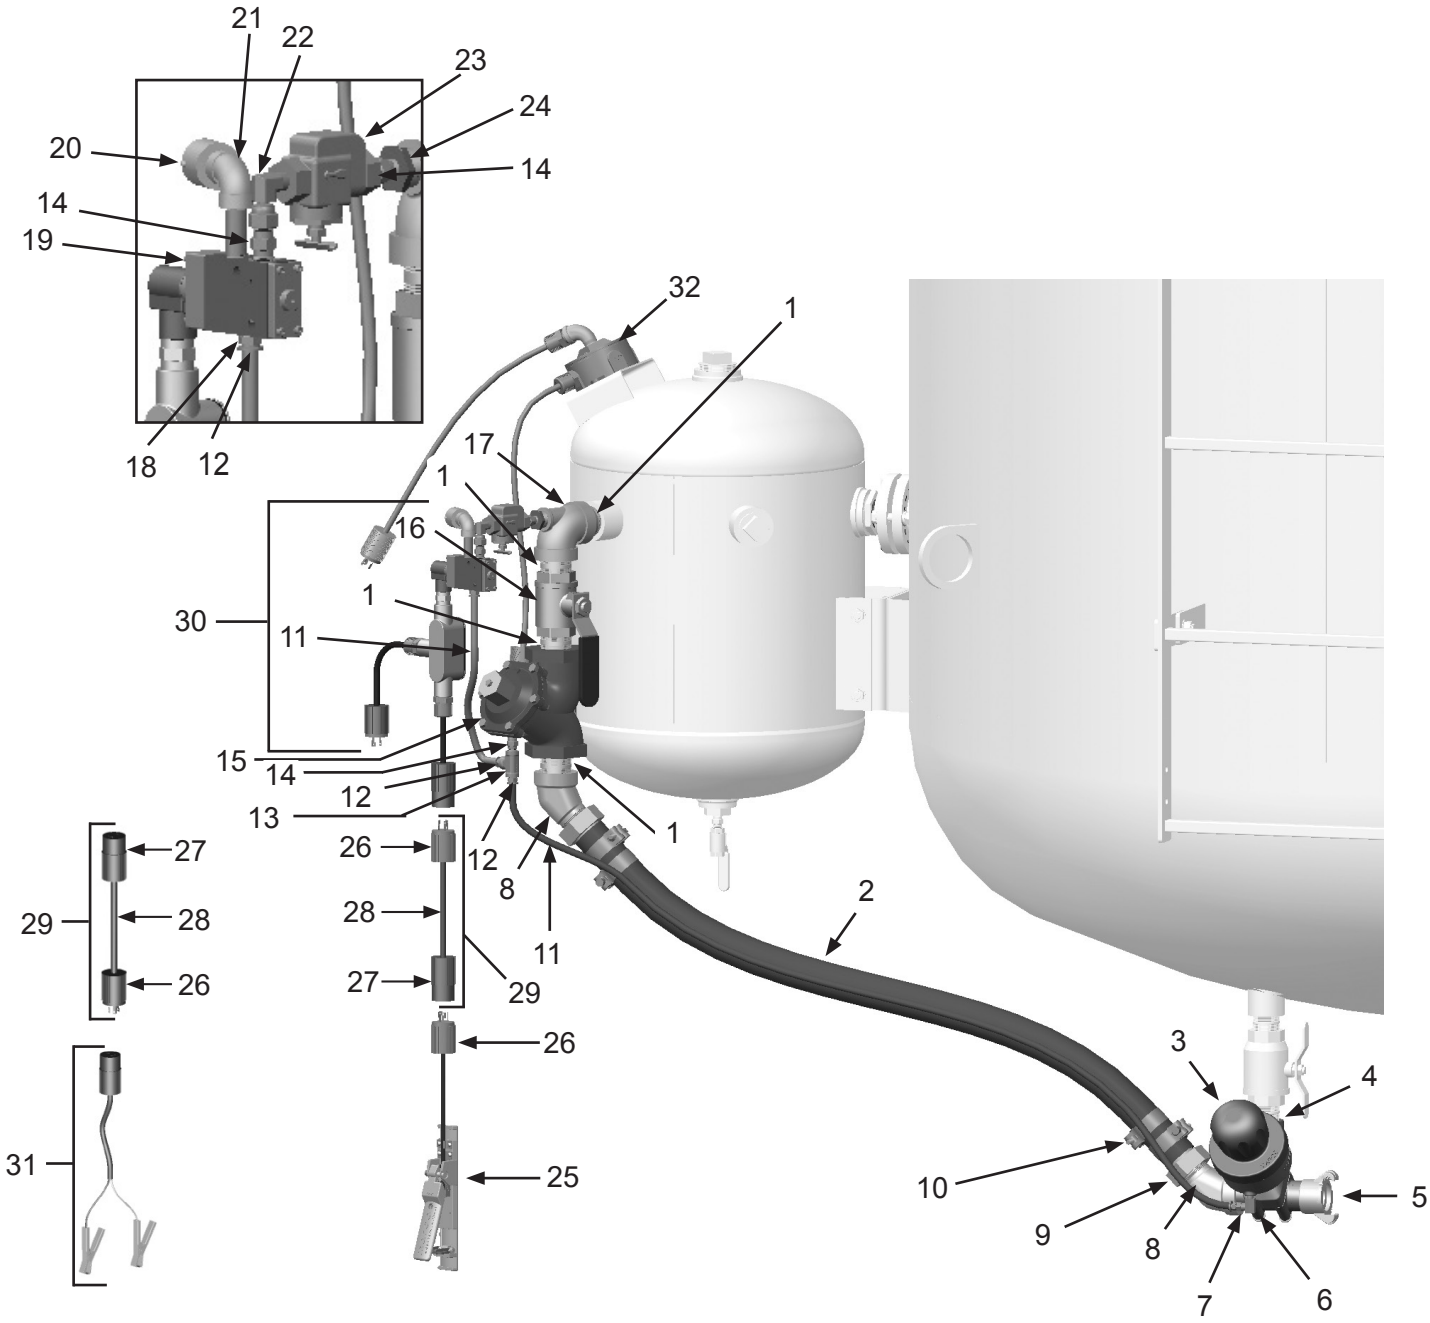


Complete 12-Volt DC Electric Conversion Kit – 120 Cu. Ft and Larger Abrasive Blasting Pot – 3-Outlet

Item #	Part #	Description
Fig. 7		
—	**10105065**	**12-Volt DC Electric Conversion Kit – 120 Cu. Ft. and Larger – 3-Outlet (Urethane)**
—	**10104994**	**12-Volt DC Electric Conversion Kit – 120 Cu. Ft. and Larger – 3-Outlet (Tungsten Carbide)**
1	1014015	1-1/2" Close Nipple *(Twelve Required)*
2	10AH112B	1-1/2" I.D. Air Hose - Per Foot
3	10101950	1-1/2" Maxum III Abrasive Metering Valve – Tungsten Carbide Sleeve *(Three Required) (For use with 10104994)*
—	10101946	1-1/2" Maxum III Abrasive Metering Valve – Urethane Sleeve *(Three Required) (For use with 10105065)*
4	1011201	1-1/4" NPT Close Nipple *(Three Required)*
5	10SB2S	1-1/2" NPT Brass Tank Coupling *(Three Required)*
6	1014239	1/8" 90° Swivel Fitting *(Three Required)*
7	10PAF0125	1/8" Push-On Air Hose Fitting *(Three Required)*
8	1011805	1-1/2" NPT 45° Street Elbow *(Six Required)*
9	10SFE4	1-1/2" NPT Swivel Female Air Hose Fitting *(Six Required)*
10	10103738	1-1/2" T-Bolt Hose Clamp *(12 Required)*
11	10AH025	1/4" Push-On Air Hose - Per Foot
12	10PAF025	1/4" Push-On Hose Fitting *(Nine Required)*
13	1011844	1/4" NPT Pipe Tee *(Three Required)*
14	1017019	1/4" NPT Hex Nipple *(Nine Required)*
15	1013600	1-1/2" High-Flow GateKeeper Air Valve *(Three Required)*
16	1011603	1-1/2" NPT Full Port Brass Ball Valve *(Three Required)*
17	1011829	1-1/2" NPT Elbow with 3/4" Side-Out *(Three Required)*
18	10SME025	1/4" Straight Swivel *(Three Required)*
19	1019010	12-Volt DC 190 Electric Solenoid *(Three Required)*
20	10DE025	1/4" NPT Dust Eliminator *(Three Required)*
21	1011824	1/4" Street Elbow *(Three Required)*
22	1012326	1/4" Swivel 90° Fitting *(Three Required)*
23	10WS	Watts Strainer *(Three Required)*
24	10100524	3/4” X 1/4” Bushing *(Three Required)*
25	1015100	Blastmaster® 151E Remote Control Switch *(Three Required)*
26	1015555	3-Prong Twist-Lock Plug – Male *(Three Required)*
27	1015556	3-Prong Twist-Lock Plug – Female *(Three Required)*
28	1015540	16/2 Power Cord – Per Foot
29	1015545	50' of 16/2 Power Cord with 3-Prong Twist-Lock Plugs Installed *(Includes Item #’s: 26, 27, and 28) (Four Required)*
30	1019051	Blastmaster® 190 12-Volt DC Electric Control Assembly – Complete *(Includes Item #’s: 19, 20, and 21) (Three Required)*
31	1015544	Battery Clamp Kit with 3-Prong Twist-Lock Plug Installed
32	10100560	3-Outlet Power Distribution Box

See page 57 for product literature

Figure 7: Complete 12-Volt DC Electric Conversion Kit – 120 Cu. Ft and Larger Abrasive Blasting Pot – 3-Outlet

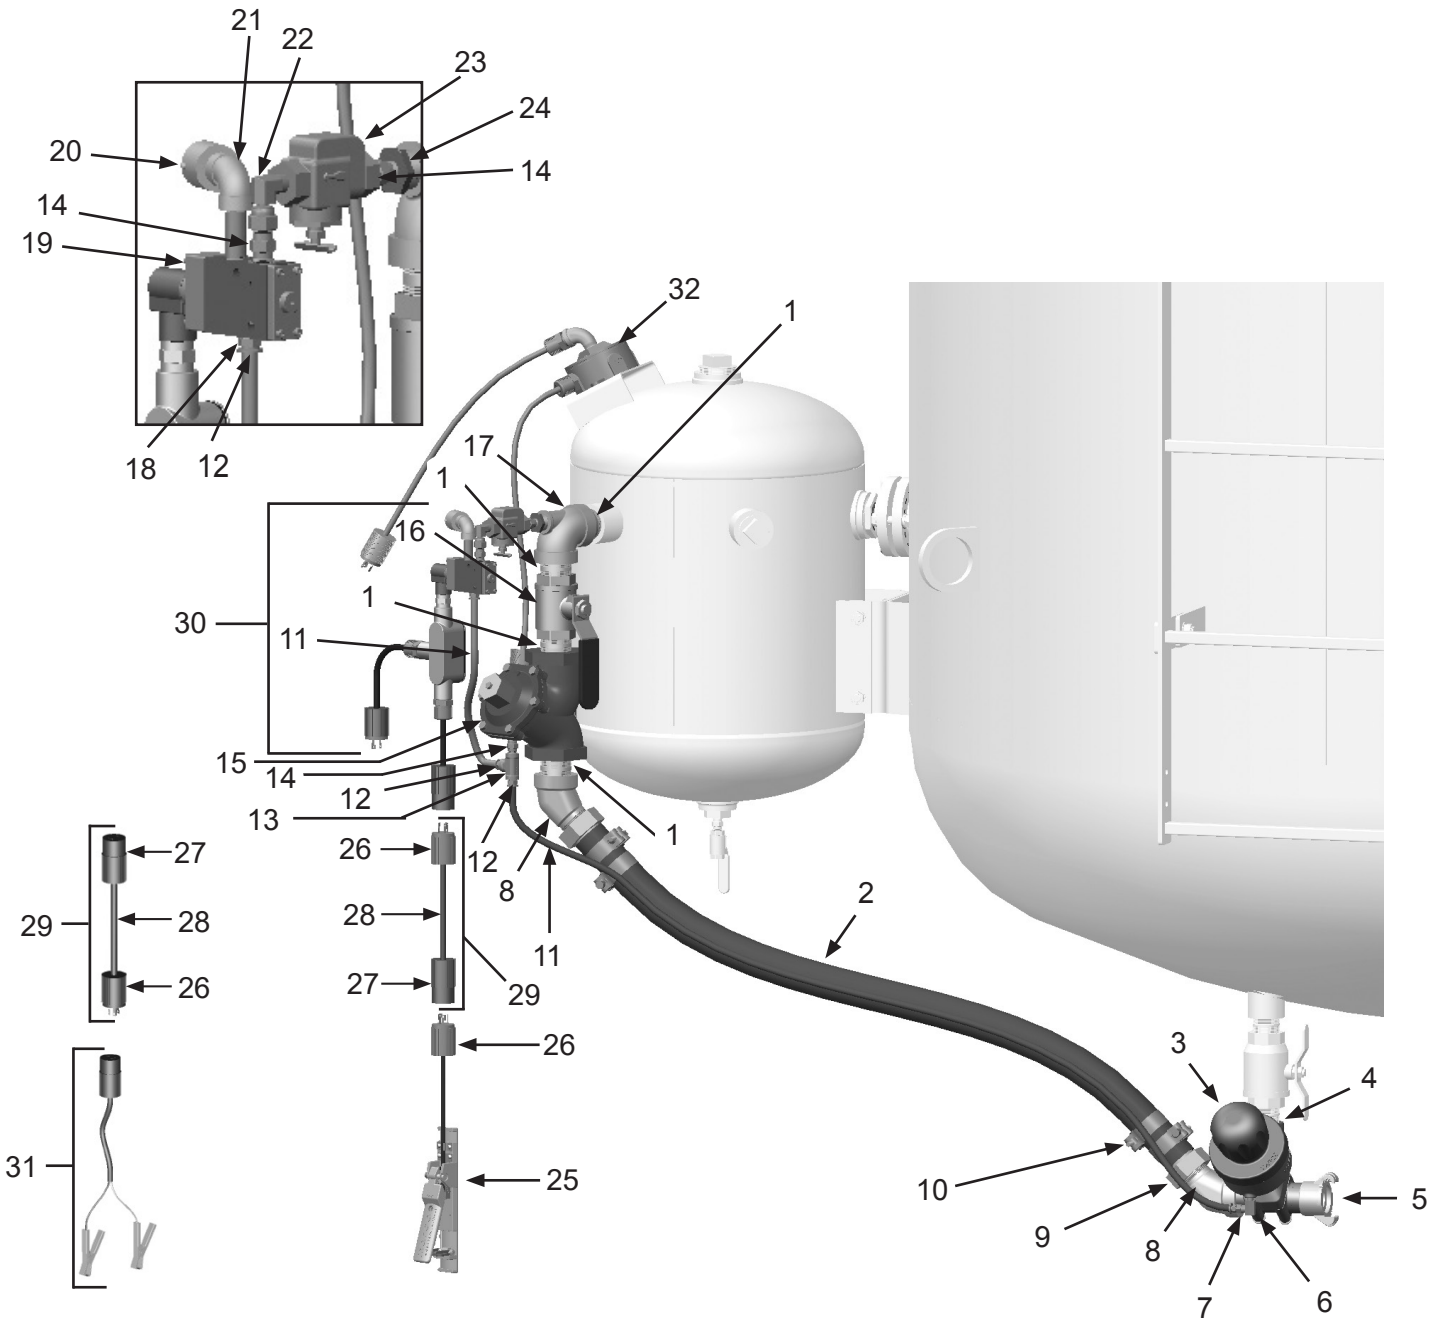


PART NUMBERS AND SCHEMATICS GUIDE

Complete 12-Volt DC Electric Conversion Kit – 120 Cu. Ft and Larger Abrasive Blasting Pot – 4-Outlet

Item #	Part #	Description
Fig. 8		
—	**10105066**	**12-Volt DC Electric Conversion Kit – 120 Cu. Ft. and Larger – 4-Outlet (Urethane)**
—	**10104995**	**12-Volt DC Electric Conversion Kit, 151E – 120 Cu. Ft. and Larger – 4-Outlet (Tungsten Carbide)**
—	**10109053**	**12-Volt DC Electric Conversion Kit, 156E – 120 Cu. Ft. and Larger – 4-Outlet (Tungsten Carbide)**
—	**10110555**	**12-Volt DC Electric Conversion Kit, 155E – 120 Cu. Ft. and Larger – 4-Outlet (Tungsten Carbide)**
1	1014015	1-1/2” Close Nipple *(16 Required)*
2	10AH112B	1-1/2" I.D. Air Hose - Per Foot
3	10101950	1-1/2" Maxum III Abrasive Metering Valve – Tungsten Carbide Sleeve (*Four Required*) *(For use with 10104995)*
—	10101946	1-1/2" Maxum III Abrasive Metering Valve – Urethane Sleeve (*Four Required*) *(For use with 10105066)*
4	1011201	1-1/4" NPT Close Nipple (*Four Required*)
5	10SB2S	1-1/2" NPT Brass Tank Coupling (*Four Required*)
6	1014239	1/8" 90° Swivel Fitting *(Four Required)*
7	10PAF0125	1/8" Push-On Air Hose Fitting (*Four Required*)
8	1011805	1-1/2" NPT 45° Street Elbow *(Six Required)*
9	10SFE4	1-1/2" NPT Swivel Female Air Hose Fitting *(Eight Required)*
10	10103738	1-1/2" T-Bolt Hose Clamp *(16 Required)*
11	10AH025	1/4" Push-On Air Hose - Per Foot
12	10PAF025	1/4" Push-On Hose Fitting *(12 Required)*
13	1011844	1/4" NPT Pipe Tee *(Four Required)*
14	1017019	1/4" NPT Hex Nipple *(12 Required)*
15	1013600	1-1/2" High-Flow GateKeeper Air Valve *(Four Required)*
16	1011603	1-1/2" NPT Full Port Brass Ball Valve (*Four Required*)
17	1011829	1-1/2" NPT Elbow with 3/4" Side-Out (*Four Required*)
18	10SME025	1/4" Straight Swivel (*Four Required*)
19	1019010	12-Volt DC 190 Electric Solenoid *(Four Required)*
20	10DE025	1/4" NPT Dust Eliminator (*Four Required*)
21	1011824	1/4" Street Elbow (*Four Required*)
22	1012326	1/4" Swivel 90° Fitting *(Four Required)*
23	10WS	Watts Strainer (*Four Required*)
24	10100524	3/4” X 1/4” Bushing *(Four Required)*
25	1015100	Blastmaster® 151E Remote Control Switch (*Four Required*)
—	1015600	Blastmaster® 156E Remote Control Switch *(For 10109053, Four Required)*
—	1015500	Blastmaster® 155E Remote Control Switch *(For 10110555, Four Required)*
26	1015555	3-Prong Twist-Lock Plug – Male (*Four Required*)
27	1015556	3-Prong Twist-Lock Plug – Female (*Four Required*)
28	1015540	16/2 Power Cord – Per Foot
29	1015545	50' of 16/2 Power Cord with 3-Prong Twist-Lock Plugs Installed *(Includes Item #’s: 26, 27, and 28)* (*Five Required*)
30	1019051	Blastmaster® 190 12-Volt DC Electric Control Assembly – Complete *(Includes Item #’s: 19, 20, and 21)* (*Four Required*)
31	1015544	Battery Clamp Kit with 3-Prong Twist-Lock Plug Installed
32	10100561	4-Outlet Power Distribution Box

See page 57 for product literature

Figure 8: Complete 12-Volt DC Electric Conversion Kit – 120 Cu. Ft and Larger Abrasive Blasting Pot – 4-Outlet

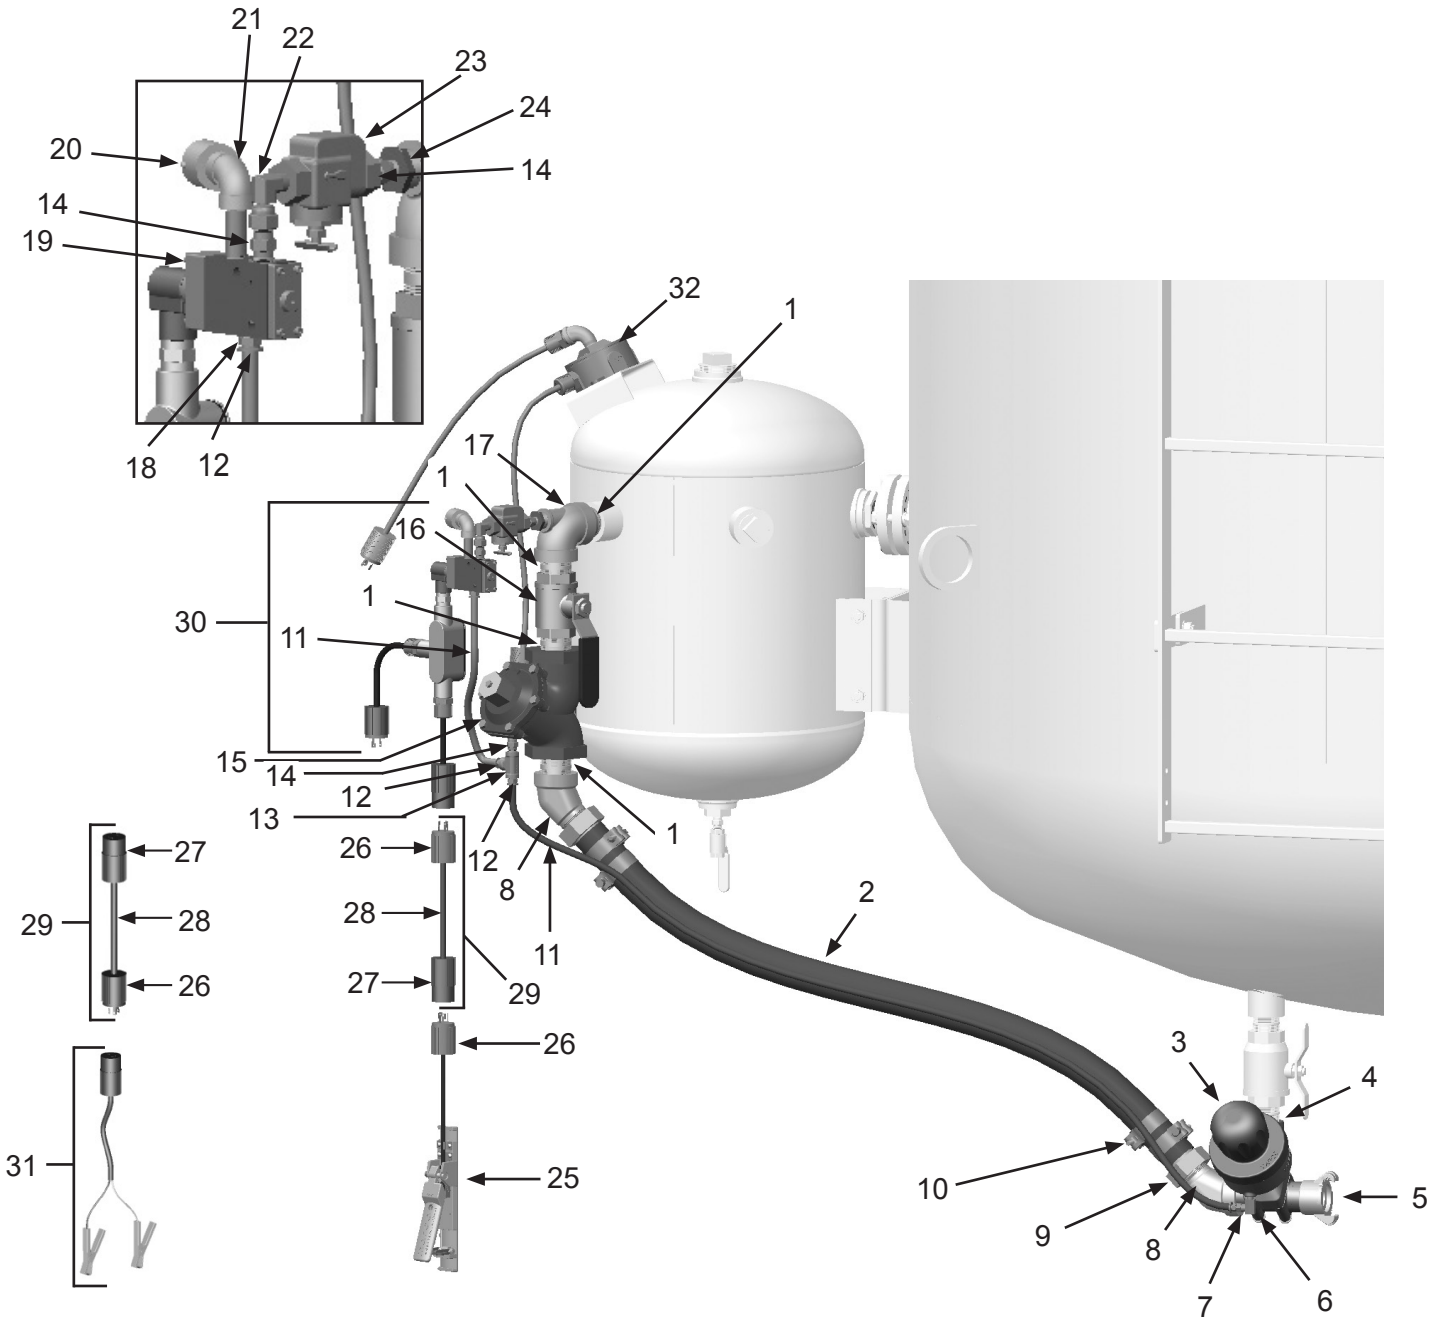

PART NUMBERS AND SCHEMATICS GUIDE

	120-VOLT AC ELECTRIC CONVERSION KITS – 120 CU. FT. AND LARGER ABRASIVE BLASTING POT										
	Number of Outlets				Blastmaster® 1-1/2" Maxum III Abrasive Metering Valve						
Part Numbers	**1**	**2**	**3**	**4**	**Urethane**	**Tungsten Carbide**	**GateKeeper Air Valve**	**Blastmaster® 151E Remote Control Switch**	**Electric Control Line** *(Includes Connectors)*	**Junction Box**	**120-Volt AC to 12-Volt AC Power Converter**
10106176	X				X		1-1/2" High-Flow	X	50 Ft.		X
10106177	X					X	1-1/2" High-Flow	X	50 Ft.		X
10105518		X			X		1-1/2" High-Flow	X	50 Ft.	X	X
10105512		X				X	1-1/2" High-Flow	X	50 Ft.	X	X
10105519			X		X		1-1/2" High-Flow	X	50 Ft.	X	X
10105513			X			X	1-1/2" High-Flow	X	50 Ft.	X	X
10105520				X	X		1-1/2" High-Flow	X	50 Ft.	X	X
10105514				X		X	1-1/2" High-Flow	X	50 Ft.	X	X

For converting bare pot to electric remote control system.
Includes: Blastmaster® Maxum III Abrasive Metering Valve, Blastmaster® 130E Remote Control System with 1-1/2" High-Flow GateKeeper, Pusher Line, Junction Box, Blastmaster® 190 Remote Control Valve
Note that due to the wide variety of blast pots you may need to purchase additional fittings, bushing, etc.

PART NUMBERS AND SCHEMATICS GUIDE




PART NUMBERS AND SCHEMATICS GUIDE

Complete 120-Volt AC Electric Conversion Kit – 120 Cu. Ft and Larger Abrasive Blasting Pot – 1-Outlet

Item #	Part #	Description
Fig. 9		
—	**10106176**	**120-Volt AC Electric Conversion Kit – 120 Cu. Ft. and Larger – 1-Outlet (Urethane)**
—	**10106177**	**120-Volt AC Electric Conversion Kit – 120 Cu. Ft. and Larger – 1-Outlet (Tungsten Carbide)**
1	1014015	1-1/2” Close Nipple *(Four Required)*
2	10AH112B	1-1/2" I.D. Air Hose - Per Foot
3	10101950	1-1/2" Maxum III Abrasive Metering Valve – Tungsten Carbide Sleeve *(For use with 10106177)*
—	10101946	1-1/2" Maxum III Abrasive Metering Valve – Urethane Sleeve *(For use with 10106176)*
4	1011201	1-1/4" NPT Close Nipple
5	10SB2S	1-1/2" NPT Brass Tank Coupling
6	1014239	1/8" 90° Swivel Fitting
7	10PAF0125	1/8" Push-On Air Hose Fitting
8	1011805	1-1/2" NPT 45° Street Elbow *(Two Required)*
9	10SFE4	1-1/2" NPT Swivel Female Air Hose Fitting *(Two Required)*
10	10103738	1-1/2" T-Bolt Hose Clamp *(Four Required)*
11	10AH025	1/4" Push-On Air Hose - Per Foot
12	10PAF025	1/4" Push-On Hose Fitting *(Three Required)*
13	1011844	1/4" NPT Pipe Tee
14	1017019	1/4" NPT Hex Nipple *(Three Required)*
15	1013600	1-1/2" High-Flow GateKeeper Air Valve
16	1011603	1-1/2" NPT Full Port Brass Ball Valve
17	1011829	1-1/2" NPT Elbow with 3/4" Side-Out
18	10SME025	1/4" Straight Swivel
19	1019011	12-Volt AC 190 Electric Solenoid
20	10DE025	1/4" NPT Dust Eliminator
21	1011824	1/4" Street Elbow
22	1012326	1/4" Swivel 90° Fitting
23	10WS	Watts Strainer
24	10100524	3/4” X 1/4” Bushing *(One Required)*
25	1015100	Blastmaster® 151E Remote Control Switch
26	1015555	3-Prong Twist-Lock Plug – Male
27	1015556	3-Prong Twist-Lock Plug – Female
28	1015540	16/2 SJ Power Cord – Per Foot
29	1015545	50' of 16/2 SO Power Cord with 3-Prong Twist-Lock Plugs Installed *(Includes Item #’s: 26, 27, and 28) (Two Required)*
30	1019052	Blastmaster® 190 12-Volt AC Electric Control Assembly – Complete *(Includes Item #’s: 19, 20, and 21)*
31	10100713	120-Volt AC to 12-Volt AC Power Converter *(Includes Item # 32)*
32	1030026	120 Volt AC Plug - Male - 3 Prong

See page 57 for product literature

Figure 9: Complete 120-Volt AC Electric Conversion Kit – 120 Cu. Ft and Larger Abrasive Blasting Pot – 1-Outlet

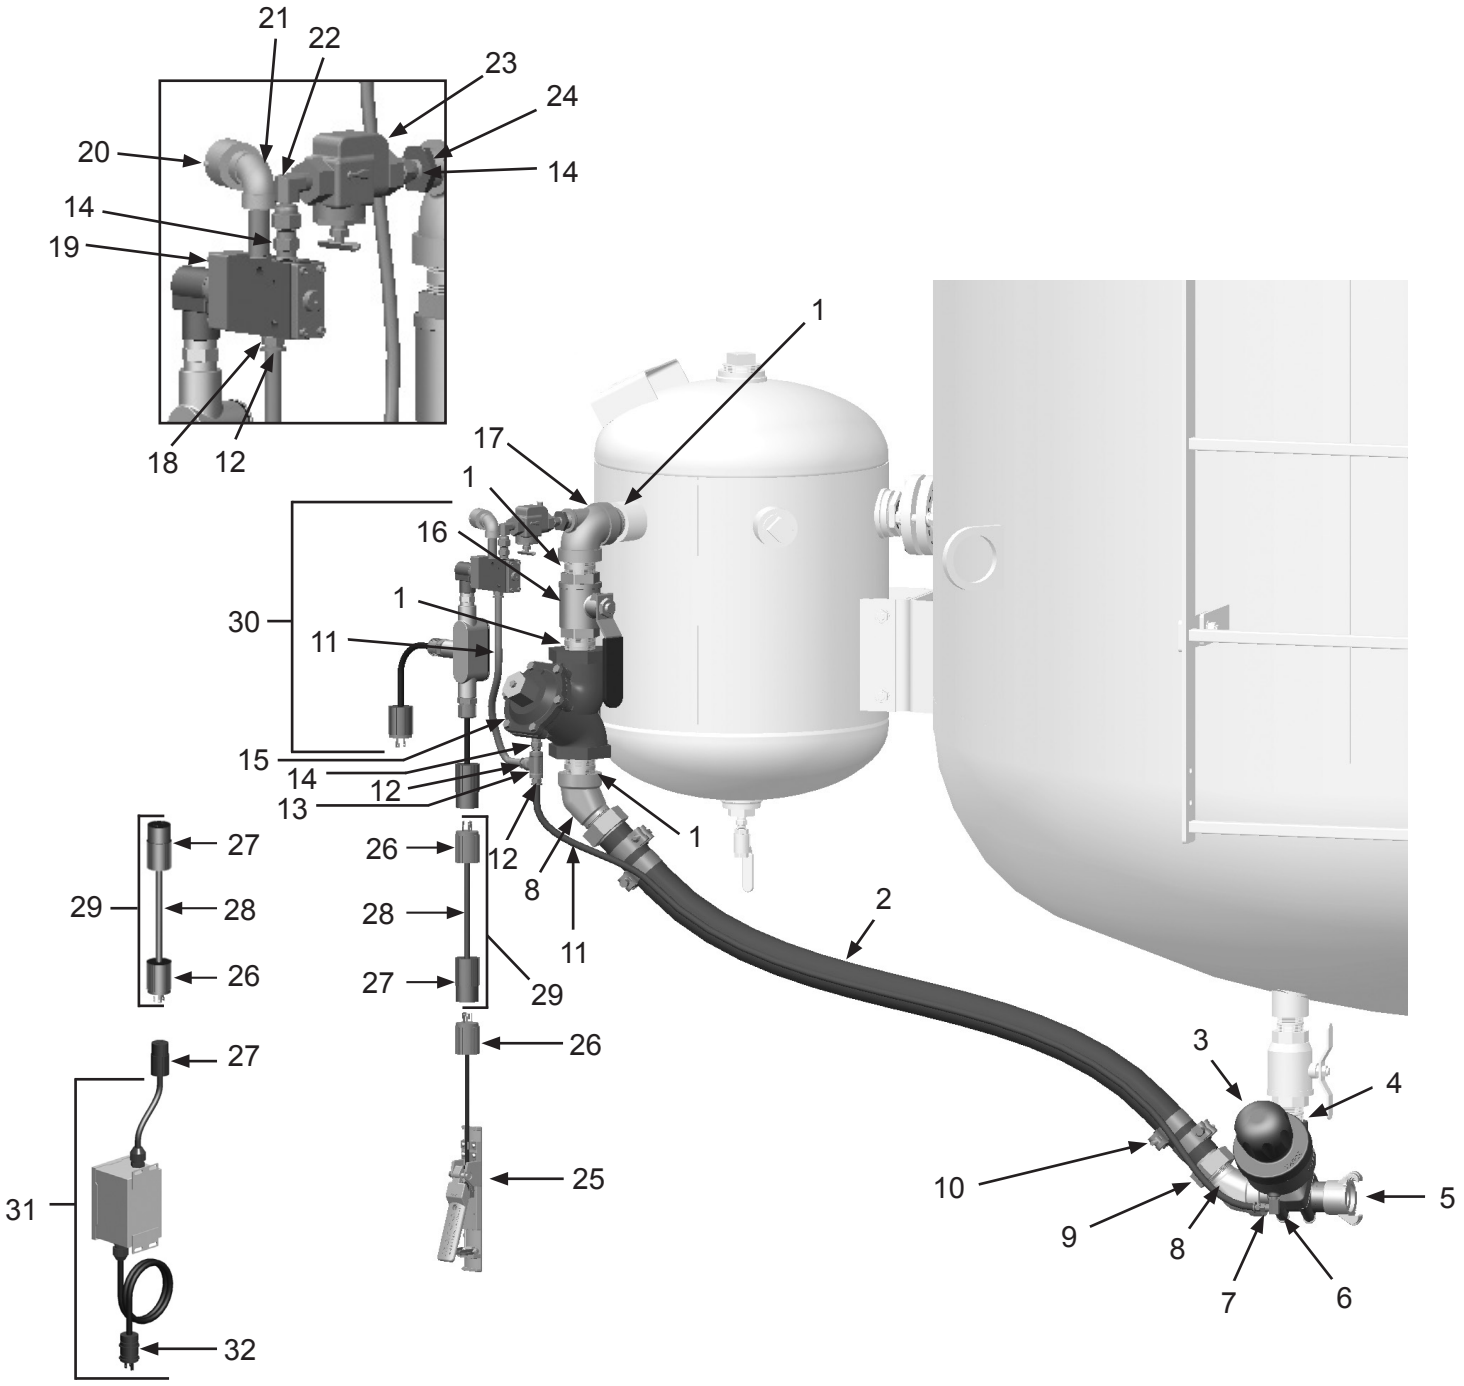


PART NUMBERS AND SCHEMATICS GUIDE

Complete 120-Volt AC Electric Conversion Kit – 120 Cu. Ft and Larger Abrasive Blasting Pot – 2-Outlet

Item #	Part #	Description
Fig. 10		
—	**10105518**	**120-Volt AC Electric Conversion Kit – 120 Cu. Ft. and Larger – 2-Outlet (Urethane)**
—	**10105512**	**120-Volt AC Electric Conversion Kit – 120 Cu. Ft. and Larger – 2-Outlet (Tungsten Carbide)**
1	1014015	1-1/2" Close Nipple *(Eight Required)*
2	10AH112B	1-1/2" I.D. Air Hose - Per Foot
3	10101950	1-1/2" Maxum III Abrasive Metering Valve – Tungsten Carbide Sleeve *(Two Required) (For use with 10105512)*
—	10101946	1-1/2" Maxum III Abrasive Metering Valve – Urethane Sleeve *(Two Required) (For use with 10105518)*
4	1011201	1-1/4" NPT Close Nipple *(Two Required)*
5	10SB2S	1-1/2" NPT Brass Tank Coupling *(Two Required)*
6	1014239	1/8" 90° Swivel Fitting *(Two Required)*
7	10PAF0125	1/8" Push-On Air Hose Fitting *(Two Required)*
8	1011805	1-1/2" NPT 45° Street Elbow *(Four Required)*
9	10SFE4	1-1/2" NPT Swivel Female Air Hose Fitting *(Four Required)*
10	10103738	1-1/2" T-Bolt Hose Clamp *(Eight Required)*
11	10AH025	1/4" Push-On Air Hose - Per Foot
12	10PAF025	1/4" Push-On Hose Fitting *(Six Required)*
13	1011844	1/4" NPT Pipe Tee *(Two Required)*
14	1017019	1/4" NPT Hex Nipple *(Six Required)*
15	1013600	1-1/2" High-Flow GateKeeper Air Valve *(Two Required)*
16	1011603	1-1/2" NPT Full Port Brass Ball Valve *(Two Required)*
17	1011829	1-1/2" NPT Elbow with 3/4" Side-Out *(Two Required)*
18	10SME025	1/4" Straight Swivel *(Two Required)*
19	1019011	12-Volt AC 190 Electric Solenoid *(Two Required)*
20	10DE025	1/4" NPT Dust Eliminator *(Two Required)*
21	1011824	1/4" Street Elbow *(Two Required)*
22	1012326	1/4" Swivel 90° Fitting *(Two Required)*
23	10WS	Watts Strainer *(Two Required)*
24	10100524	3/4” X 1/4” Bushing *(Two Required)*
25	1015100	Blastmaster® 151E Remote Control Switch *(Two Required)*
26	1015555	3-Prong Twist-Lock Plug – Male *(Two Required)*
27	1015556	3-Prong Twist-Lock Plug – Female
28	1015540	16/2 SJ Power Cord – Per Foot
29	1015545	50' of 16/2 SO Power Cord with 3-Prong Twist-Lock Plugs Installed *(Includes Item #’s: 26, 27, and 28) (Three Required)*
30	1019052	Blastmaster® 190 12-Volt AC Electric Control Assembly – Complete *(Includes Item #’s: 19, 20, and 21) (Two Required)*
31	10100713	120-Volt AC to 12-Volt AC Power Converter *(Includes Item # 32)*
32	1030026	120-Volt AC Plug - Male - 3 Prong
33	10100559	2-Outlet Power Distribution Box

See page 57 for product literature

Figure 10: Complete 120-Volt AC Electric Conversion Kit – 120 Cu. Ft and Larger Abrasive Blasting Pot – 2-Outlet

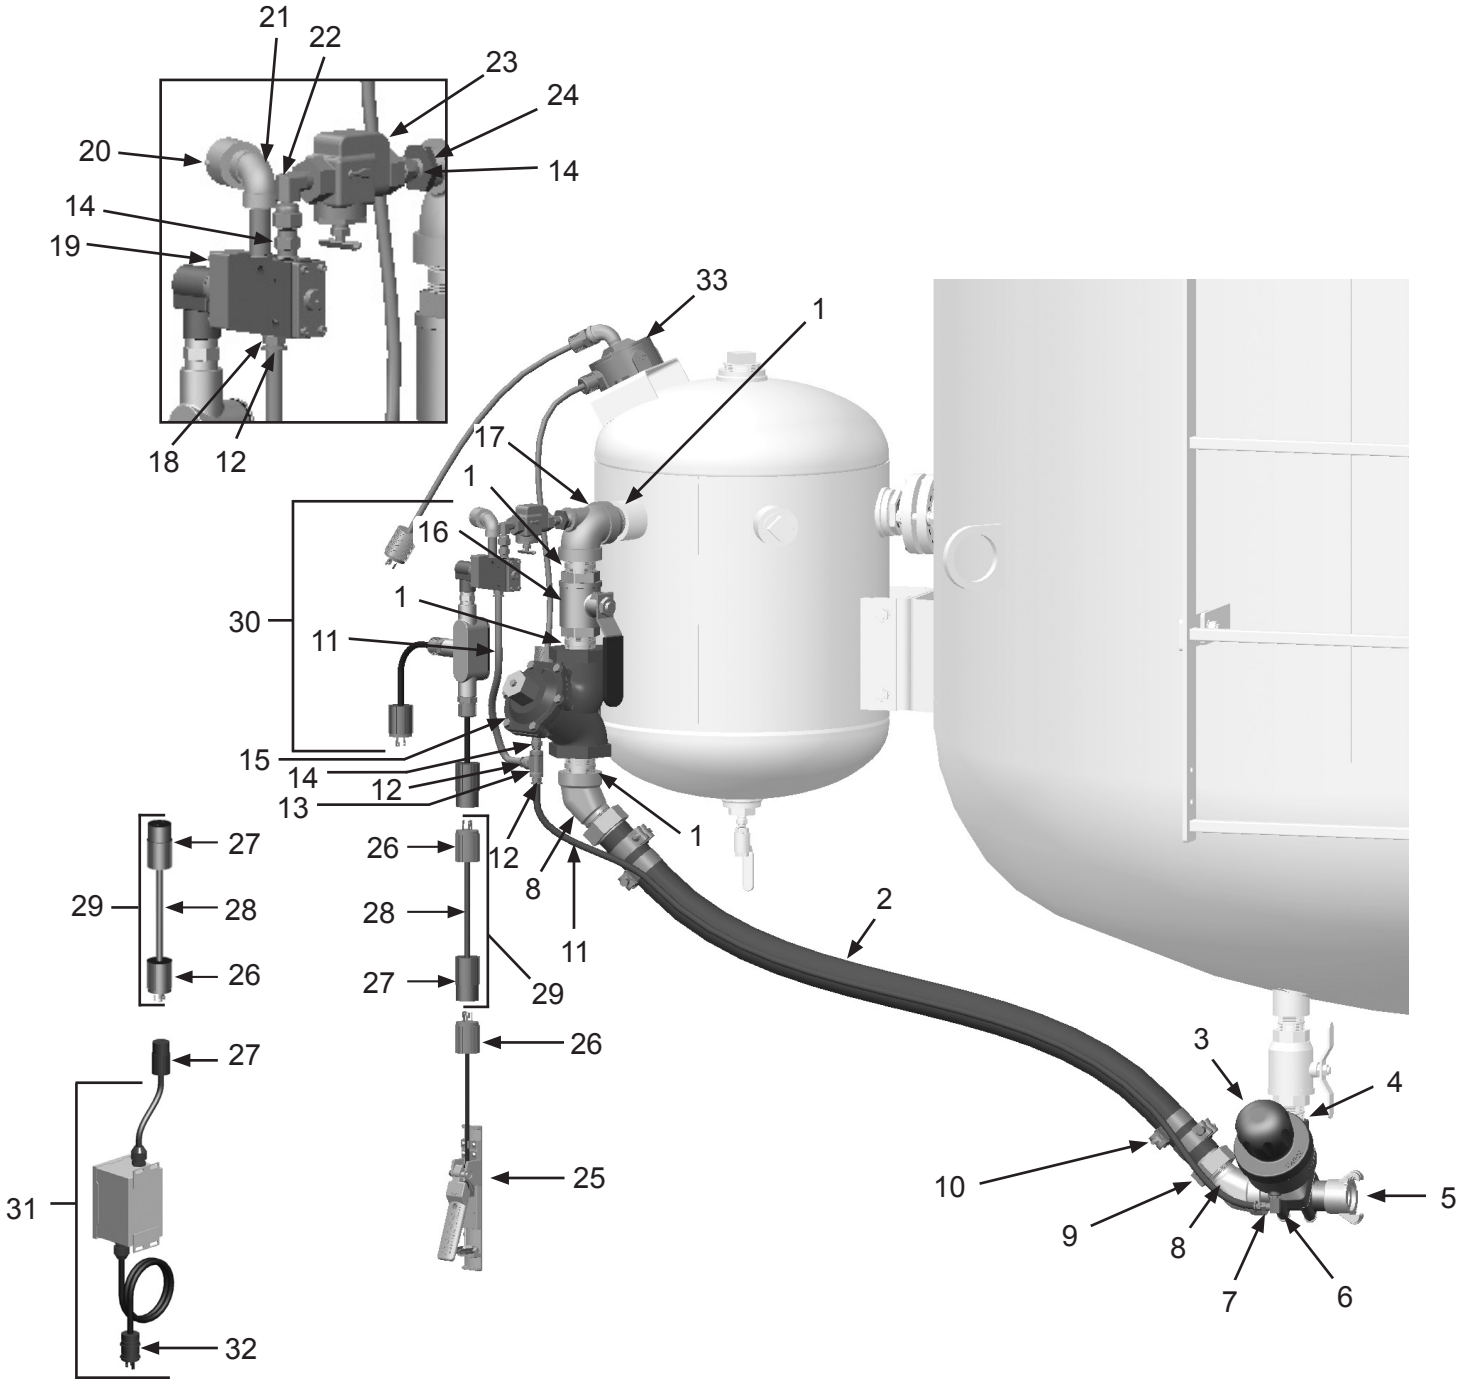


PART NUMBERS AND SCHEMATICS GUIDE

Complete 120-Volt AC Electric Conversion Kit – 120 Cu. Ft and Larger Abrasive Blasting Pot – 3-Outlet

Item #	Part #	Description
Fig. 11		
—	**10105519**	**120-Volt AC Electric Conversion Kit – 120 Cu. Ft. and Larger – 3-Outlet (Urethane)**
—	**10105513**	**120-Volt AC Electric Conversion Kit – 120 Cu. Ft. and Larger – 3-Outlet (Tungsten Carbide)**
1	1014015	1-1/2” Close Nipple *(12 Required)*
2	10AH112B	1-1/2" I.D. Air Hose - Per Foot
3	10101950	1-1/2" Maxum III Abrasive Metering Valve – Tungsten Carbide Sleeve *(Three Required)* *(For use with 10105513)*
—	10101946	1-1/2" Maxum III Abrasive Metering Valve – Urethane Sleeve *(Three Required)* *(For use with 10105519)*
4	1011201	1-1/4" NPT Close Nipple *(Three Required)*
5	10SB2S	1-1/2" NPT Brass Tank Coupling *(Three Required)*
6	1014239	1/8" 90° Swivel Fitting *(Three Required)*
7	10PAF0125	1/8" Push-On Air Hose Fitting *(Three Required)*
8	1011805	1-1/2" NPT 45° Street Elbow *(Five Required)*
9	10SFE4	1-1/2" NPT Swivel Female Air Hose Fitting *(Six Required)*
10	10103738	1-1/2" T-Bolt Hose Clamp *(12 Required)*
11	10AH025	1/4" Push-On Air Hose - Per Foot
12	10PAF025	1/4" Push-On Hose Fitting *(Nine Required)*
13	1011844	1/4" NPT Pipe Tee *(Three Required)*
14	1017019	1/4" NPT Hex Nipple *(Nine Required)*
15	1013600	1-1/2" High-Flow GateKeeper Air Valve *(Three Required)*
16	1011603	1-1/2" NPT Full Port Brass Ball Valve *(Three Required)*
17	1011829	1-1/2" NPT Elbow with 3/4" Side-Out *(Three Required)*
18	10SME025	1/4" Straight Swivel *(Three Required)*
19	1019011	12-Volt AC 190 Electric Solenoid *(Three Required)*
20	10DE025	1/4" NPT Dust Eliminator *(Three Required)*
21	1011824	1/4" Street Elbow *(Three Required)*
22	1012326	1/4" Swivel 90° Fitting *(Three Required)*
23	10WS	Watts Strainer *(Three Required)*
24	10100524	3/4” X 1/4” Bushing *(Three Required)*
25	1015100	Blastmaster® 151E Remote Control Switch *(Three Required)*
26	1015555	3-Prong Twist-Lock Plug – Male *(Three Required)*
27	1015556	3-Prong Twist-Lock Plug – Female
28	1015540	16/2 SJ Power Cord – Per Foot
29	1015545	50' of 16/2 SO Power Cord with 3-Prong Twist-Lock Plugs Installed *(Includes Item #’s: 26, 27, and 28) (Four Required)*
30	1019052	Blastmaster® 190 12-Volt AC Electric Control Assembly – Complete *(Includes Item #’s: 19, 20, and 21) (Three Required)*
31	10100713	120-Volt AC to 12-Volt AC Power Converter *(Includes Item # 32)*
32	1030026	120-Volt AC Plug - Male - 3 Prong
33	10100560	3-Outlet Power Distribution Box

See page 57 for product literature

Figure 11: Complete 120-Volt AC Electric Conversion Kit – 120 Cu. Ft and Larger Abrasive Blasting Pot – 3-Outlet

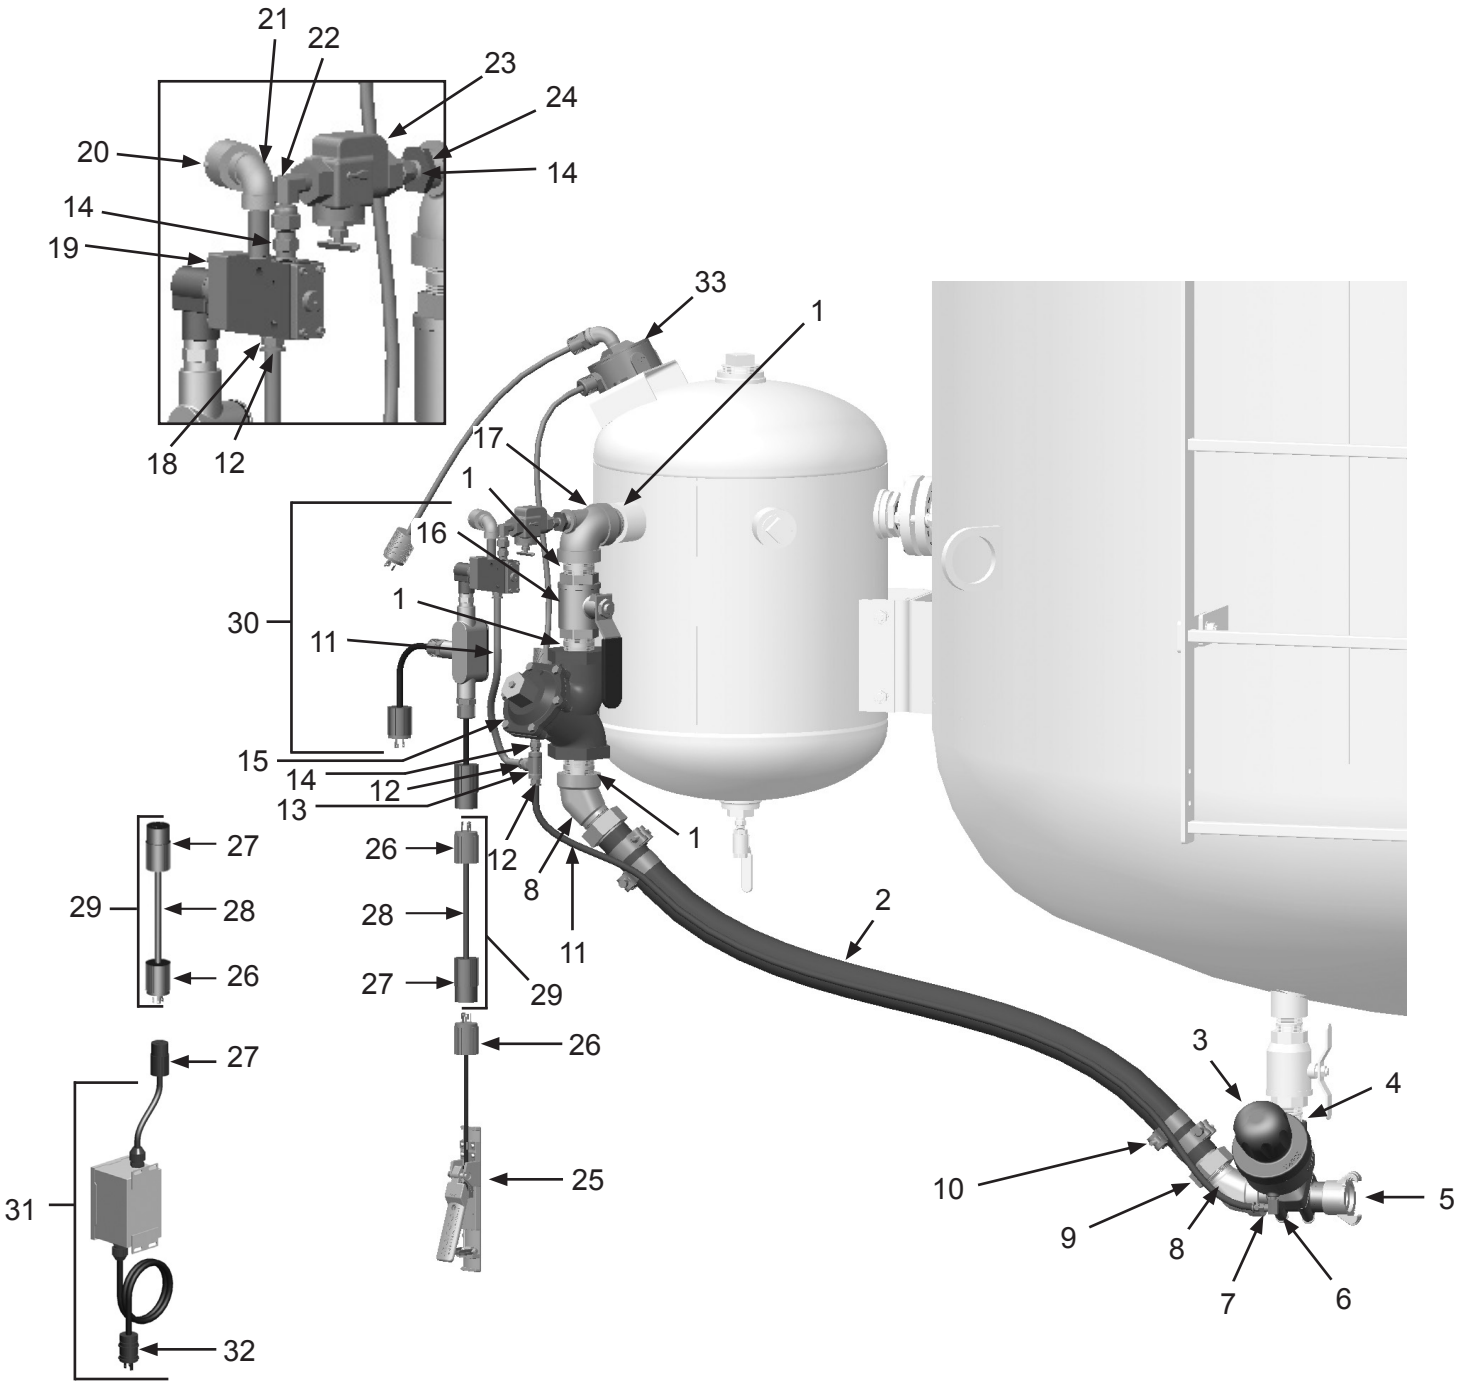


PART NUMBERS AND SCHEMATICS GUIDE

Complete 120-Volt AC Electric Conversion Kit – 120 Cu. Ft and Larger Abrasive Blasting Pot – 4-Outlet

Item #	Part #	Description
Fig. 12		
—	**10105520**	**120-Volt AC Electric Conversion Kit – 120 Cu. Ft. and Larger – 4-Outlet (Urethane)**
—	**10105514**	**120-Volt AC Electric Conversion Kit – 120 Cu. Ft. and Larger – 4-Outlet (Tungsten Carbide)**
1	1014015	1-1/2" Close Nipple *(16 Required)*
2	10AH112B	1-1/2" I.D. Air Hose - Per Foot
3	10101950	1-1/2" Maxum III Abrasive Metering Valve – Tungsten Carbide Sleeve (*Four Required*) *(For use with 10105514)*
—	10101946	1-1/2" Maxum III Abrasive Metering Valve – Urethane Sleeve (*Four Required*) *(For use with 10105520)*
4	1011201	1-1/4" NPT Close Nipple (*Four Required*)
5	10SB2S	1-1/2" NPT Brass Tank Coupling (*Four Required*)
6	1014239	1/8" 90° Swivel Fitting *(Four Required)*
7	10PAF0125	1/8" Push-On Air Hose Fitting (*Four Required*)
8	1011805	1-1/2" NPT 45° Street Elbow *(Six Required)*
9	10SFE4	1-1/2" NPT Swivel Female Air Hose Fitting *(Eight Required)*
10	10103738	1-1/2" T-Bolt Hose Clamp *(16 Required)*
11	10AH025	1/4" Push-On Air Hose – Per Foot
12	10PAF025	1/4" Push-On Hose Fitting *(12 Required)*
13	1011844	1/4" NPT Pipe Tee *(Four Required)*
14	1017019	1/4" NPT Hex Nipple *(12 Required)*
15	1013600	1-1/2" High-Flow GateKeeper Air Valve *(Four Required)*
16	1011603	1-1/2" NPT Full Port Brass Ball Valve (*Four Required*)
17	1011829	1-1/2" NPT Elbow with 3/4" Side-Out (*Four Required*)
18	10SME025	1/4" Straight Swivel (*Four Required*)
19	1019011	12-Volt AC 190 Electric Solenoid *(Four Required)*
20	10DE025	1/4" NPT Dust Eliminator (*Four Required*)
21	1011824	1/4" Street Elbow (*Four Required*)
22	1012326	1/4" Swivel 90° Fitting *(Four Required)*
23	10WS	Watts Strainer (*Four Required*)
24	10100524	3/4” X 1/4” Bushing *(Four Required)*
25	1015100	Blastmaster® 151E Remote Control Switch (*Four Required*)
26	1015555	3-Prong Twist-Lock Plug – Male (*Four Required*)
27	1015556	3-Prong Twist-Lock Plug – Female
28	1015540	16/2 SJ Power Cord – Per Foot
29	1015545	50' of 16/2 SO Power Cord with 3-Prong Twist-Lock Plugs Installed *(Includes Item #’s: 26, 27, and 28)* (*Five Required*)
30	1019052	Blastmaster® 190 12-Volt AC Electric Control Assembly – Complete *(Includes Item #’s: 19, 20, and 21)* (*Four Required*)
31	10100713	120-Volt AC to 12-Volt AC Power Converter *(Includes Item # 32)*
32	1030026	120-Volt AC Plug - Male - 3 Prong
33	10100561	4-Outlet Power Distribution Box

See page 57 for product literature

Figure 12: Complete 120-Volt AC Electric Conversion Kit – 120 Cu. Ft and Larger Abrasive Blasting Pot – 4-Outlet

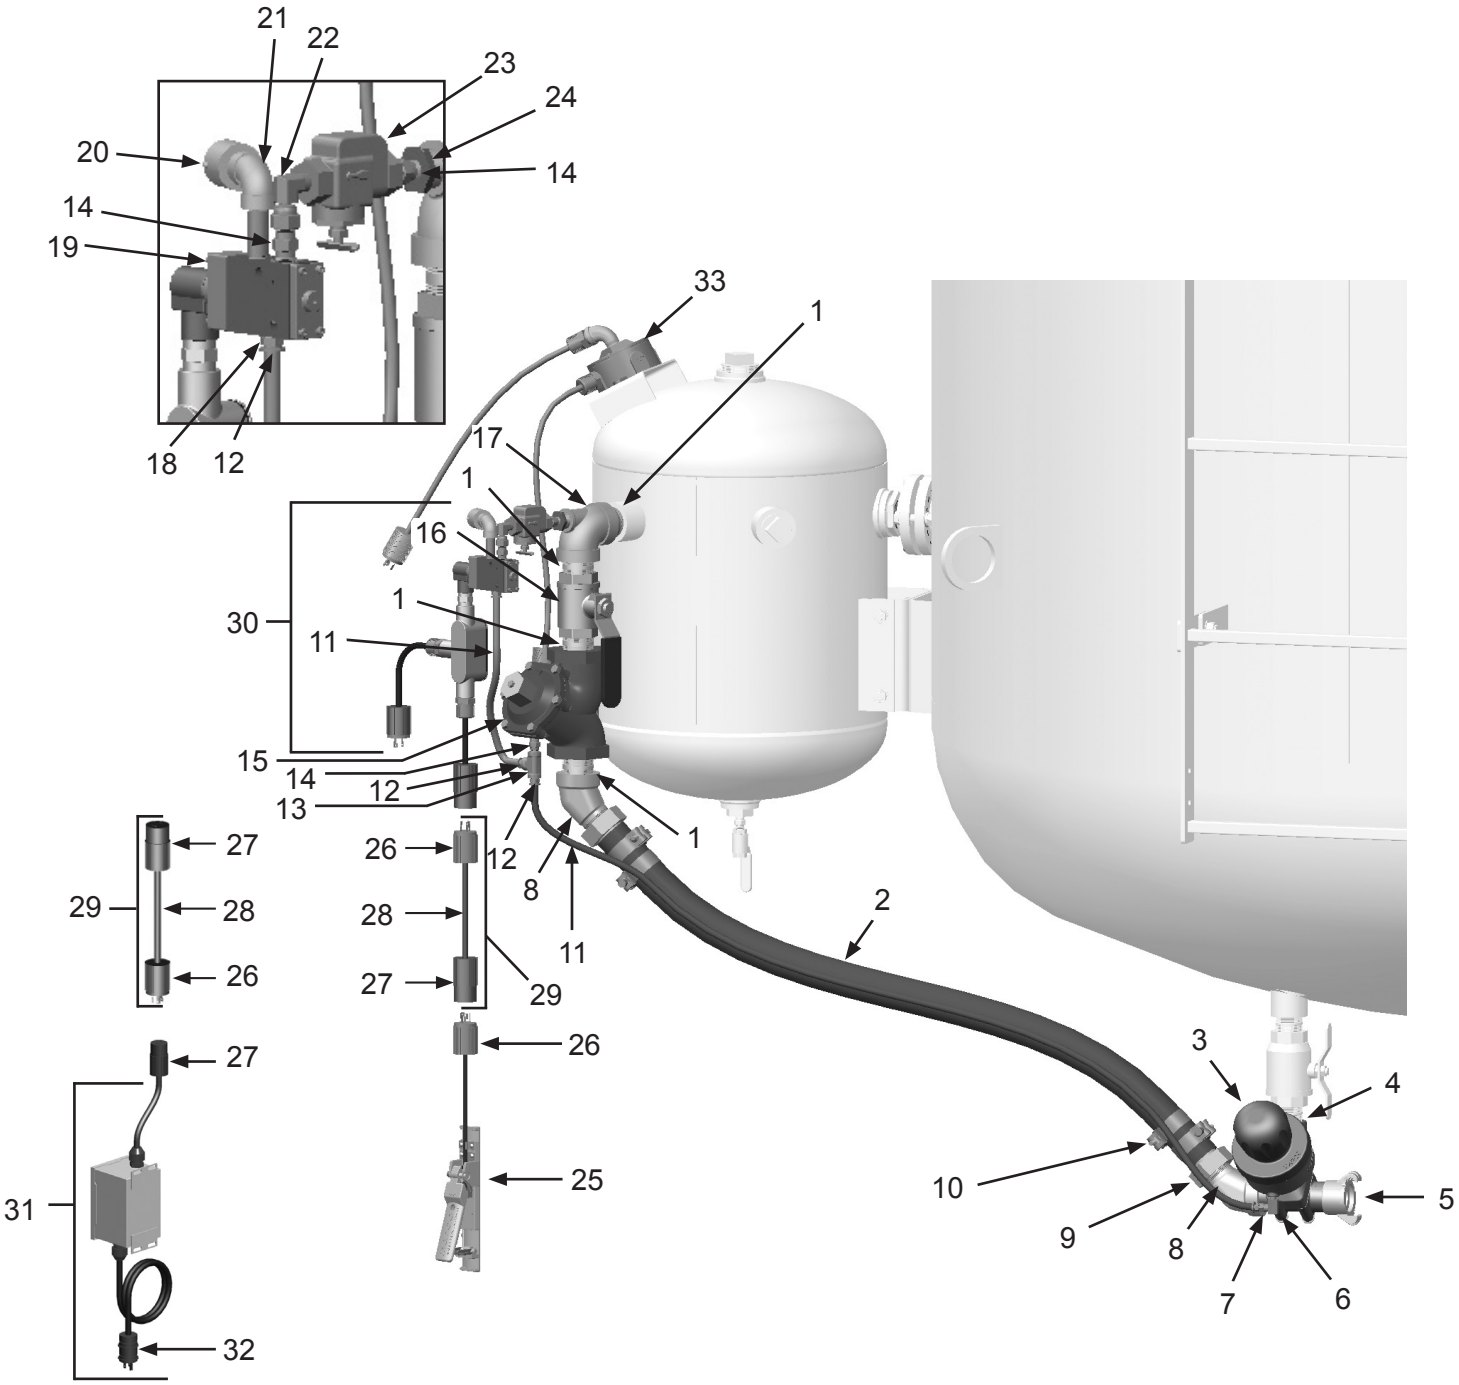


PART NUMBERS AND SCHEMATICS GUIDE

	PNEUMATIC TO 12-VOLT DC ELECTRIC CONVERSION KITS – 120 CU. FT. AND LARGER ABRASIVE BLASTING POT					
Part Numbers	**Number of Bulk Pot Outlets**	**Blastmaster® 151E Remote Control Switch**	**Electric Control Line** *(Includes Connectors)*	**Power Cord** *(Includes Connectors)*	**Junction Box**	**Battery Clamps**
10106371	1	X	50 Ft. *(Quantity of Two)*	25 Ft.		X
10104987	2	X *(Quantity of Two)*	50 Ft. *(Quantity of Three)*	25 Ft. *(Quantity of Two)*	X	X
10104988	3	X *(Quantity of Three)*	50 Ft. *(Quantity of Four)*	25 Ft. *(Quantity of Three)*	X	X
10104989	4	X *(Quantity of Four)*	50 Ft. *(Quantity of Five)*	25 Ft. *(Quantity of Four)*	X	X

For converting Pneumatic to 12-Volt DC Electric Conversion Kits
Includes: Junction Box, Control Line, Blastmaster® 151E Remote Control Switch, and Battery Clamps
Note that due to the wide variety of blast pots you may need to purchase additional fittings, bushing, etc.


PART NUMBERS AND SCHEMATICS GUIDE

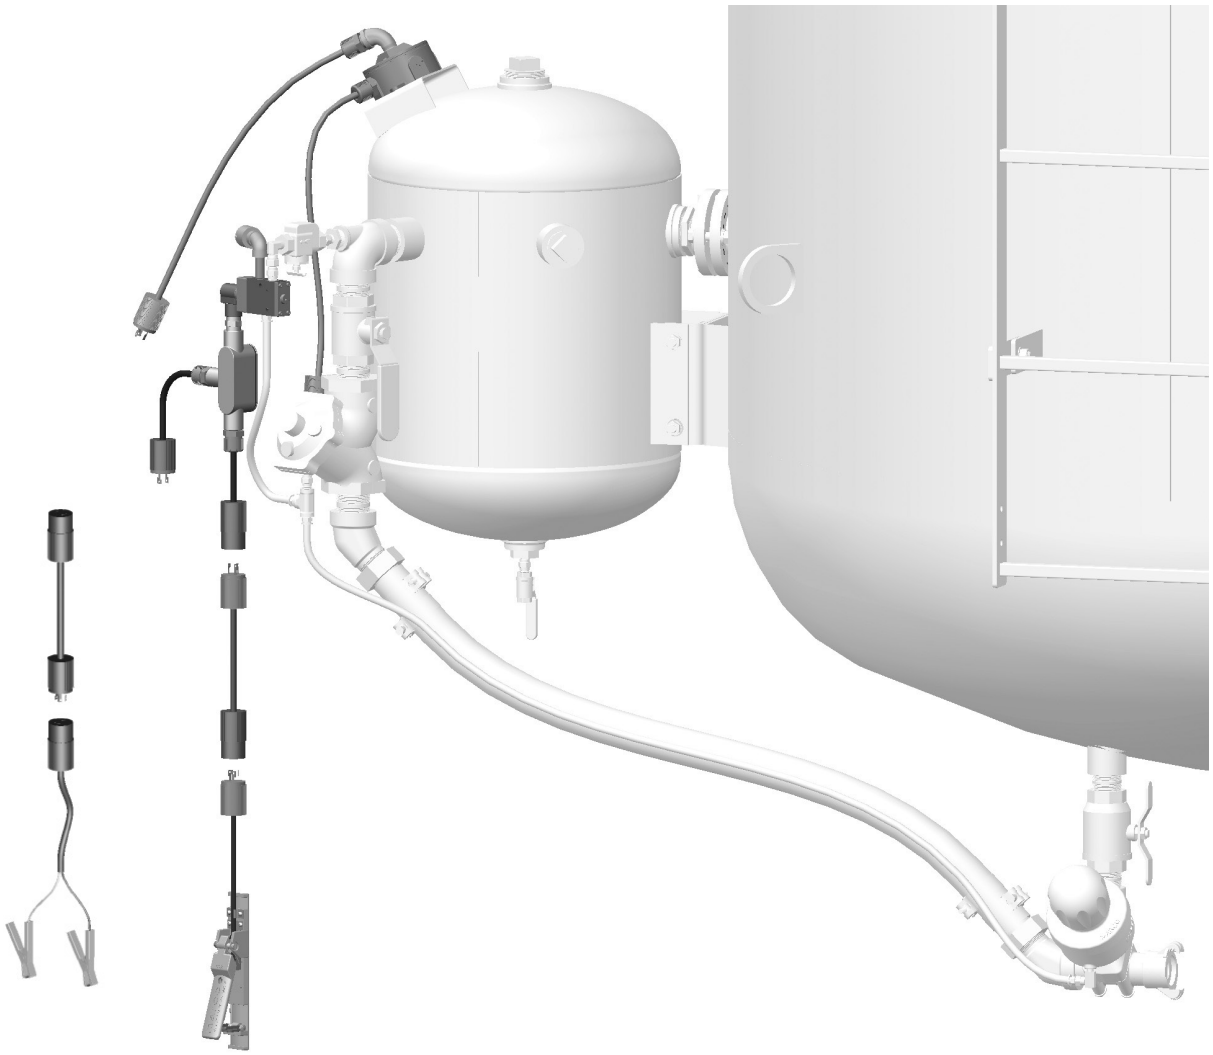

Pneumatic to 12-Volt DC Electric Conversion Kits – 120 Cu. Ft. and Larger Abrasive Blasting Pot

Item #	Part #	Description
Fig. 13	**10106371**	**Pneumatic to 12-Volt DC Electric Conversion Kits – 1-Outlet Power Distribution Box**
1	1011832	Galvanized 1/4" 90° Elbow
2	10DE025	1/4" Dust Eliminator
3	1019051	Blastmaster® 190 12-Volt DC Electric Control Assembly – Complete *(Includes Item #'s: 1, 2, and 4)*
4	1019010	12-Volt DC Electric Solenoid – Complete
5	1015555	3-Prong Twist-Lock Plug – Male
6	1015540	16/2 SJ Power Cord – Per Foot
7	1015556	3-Prong Twist-Lock Plug – Female
8	1015545	50' of 16/2 SO Power Cord with 3-Prong Twist-Lock Plugs Installed *(Includes Item #'s: 5, 6, and 7) (Two Required)*
9	1015100	Blastmaster® 151E Remote Control Switch
10	1015544	Battery Clamp Kit with 3-Prong Twist-Lock Plug Installed

Figure 13: Pneumatic to 12-Volt DC Electric Conversion Kits – 120 Cu. Ft. and Larger Abrasive Blasting Pot

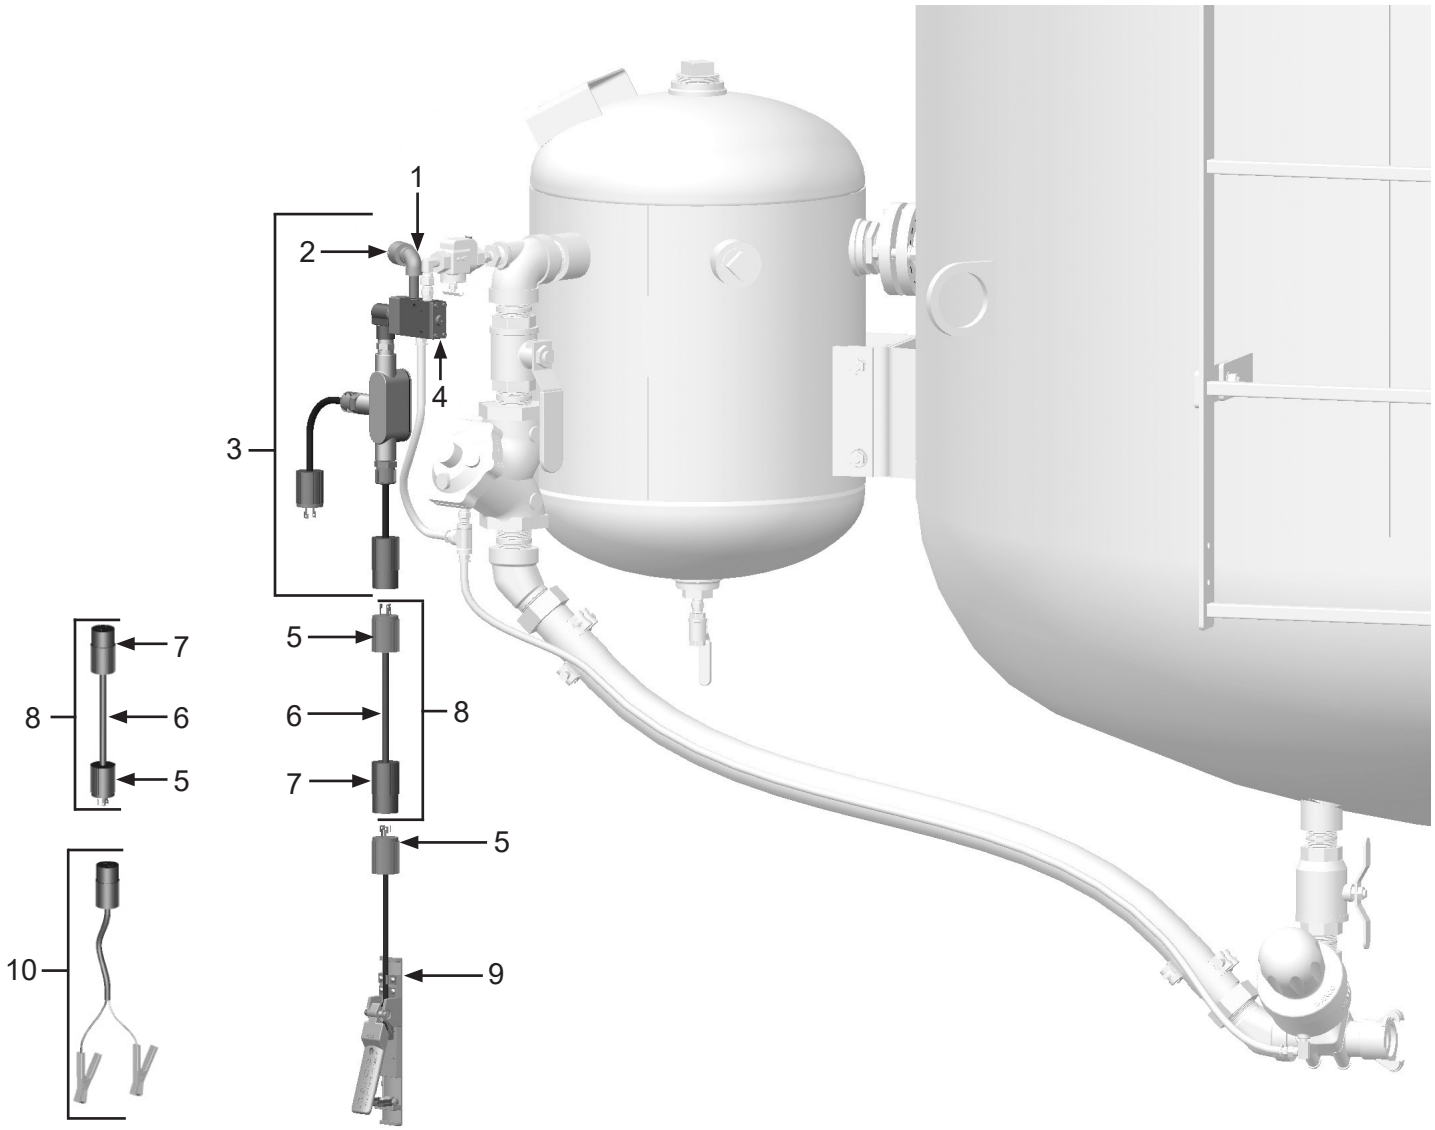

PART NUMBERS AND SCHEMATICS GUIDE


Pneumatic to 12-Volt DC Electric Conversion Kits – 120 Cu. Ft. and Larger Abrasive Blasting Pot

Item #	Part #	Description
Fig. 14	**10104987**	**Pneumatic to 12-Volt DC Electric Conversion Kits – 2-Outlet Power Distribution Box**
1	10100559	2-Outlet Power Distribution Box
2	1011832	Galvanized 1/4" 90° Elbow *(Two Required)*
3	10DE025	1/4" Dust Eliminator *(Two Required)*
4	1019051	Blastmaster® 190 12-Volt DC Electric Control Assembly – Complete *(Includes Item #'s: 2, 3, and 5) (Two Required)*
5	1019010	12-Volt DC Electric Solenoid – Complete *(Two Required)*
6	1015555	3-Prong Twist-Lock Plug – Male *(Two Required)*
7	1015540	16/2 Power Cord – Per Foot
8	1015556	3-Prong Twist-Lock Plug – Female *(Three Required)*
9	1015545	50' of 16/2 Power Cord with 3-Prong Twist-Lock Plugs Installed *(Includes Item #'s: 6, 7, and 8) (Three Required)*
10	1015100	Blastmaster® 151E Remote Control Switch *(Two Required)*
11	1015544	Battery Clamp Kit with 3-Prong Twist-Lock Plug Installed

Item #	Part #	Description
Fig. 14	**10104988**	**Pneumatic to 12-Volt DC Electric Conversion Kits – 3-Outlet Power Distribution Box**
1	10100560	3-Outlet Power Distribution Box
2	1011832	Galvanized 1/4" 90° Elbow *(Three Required)*
3	10DE025	1/4" Dust Eliminator *(Three Required)*
4	1019051	Blastmaster® 190 12-Volt DC Electric Control Assembly – Complete *(Includes Item #'s: 2, 3, and 5) (Three Required)*
5	1019010	12-Volt DC Electric Solenoid – Complete *(Three Required)*
6	1015555	3-Prong Twist-Lock Plug – Male *(Three Required)*
7	1015540	16/2 SJ Power Cord – Per Foot
8	1015556	3-Prong Twist-Lock Plug – Female *(Four Required)*
9	1015545	50' of 16/2 SO Power Cord with 3-Prong Twist-Lock Plugs Installed *(Includes Item #'s: 6, 7, and 8) (Four Required)*
10	1015100	Blastmaster® 151E Remote Control Switch *(Three Required)*
11	1015544	Battery Clamp Kit with 3-Prong Twist-Lock Plug Installed

Item #	Part #	Description
Fig. 14	**10104989**	**Pneumatic to 12-Volt DC Electric Conversion Kits – 4-Outlet Power Distribution Box**
1	10100561	4-Outlet Power Distribution Box
2	1011832	Galvanized 1/4" 90° Elbow *(Four Required)*
3	10DE025	1/4" Dust Eliminator *(Four Required)*
4	1019051	Blastmaster® 190 12-Volt DC Electric Control Assembly – Complete *(Includes Item #'s: 2, 3, and 5) (Four Required)*
5	1019010	12-Volt DC Electric Solenoid – Complete *(Four Required)*
6	1015555	3-Prong Twist-Lock Plug – Male *(Four Required)*
7	1015540	16/2 Power Cord – Per Foot
8	1015556	3-Prong Twist-Lock Plug – Female *(Five Required)*
9	1015545	50' of 16/2 Power Cord with 3-Prong Twist-Lock Plugs Installed *(Includes Item #'s: 6, 7, and 8) (Five Required)*
10	1015100	Blastmaster® 151E Remote Control Switch *(Four Required)*
11	1015544	Battery Clamp Kit with 3-Prong Twist-Lock Plug Installed


Figure 14: Pneumatic to 12-Volt DC Electric Conversion Kits – 120 Cu. Ft. and Larger Abrasive Blasting Pot

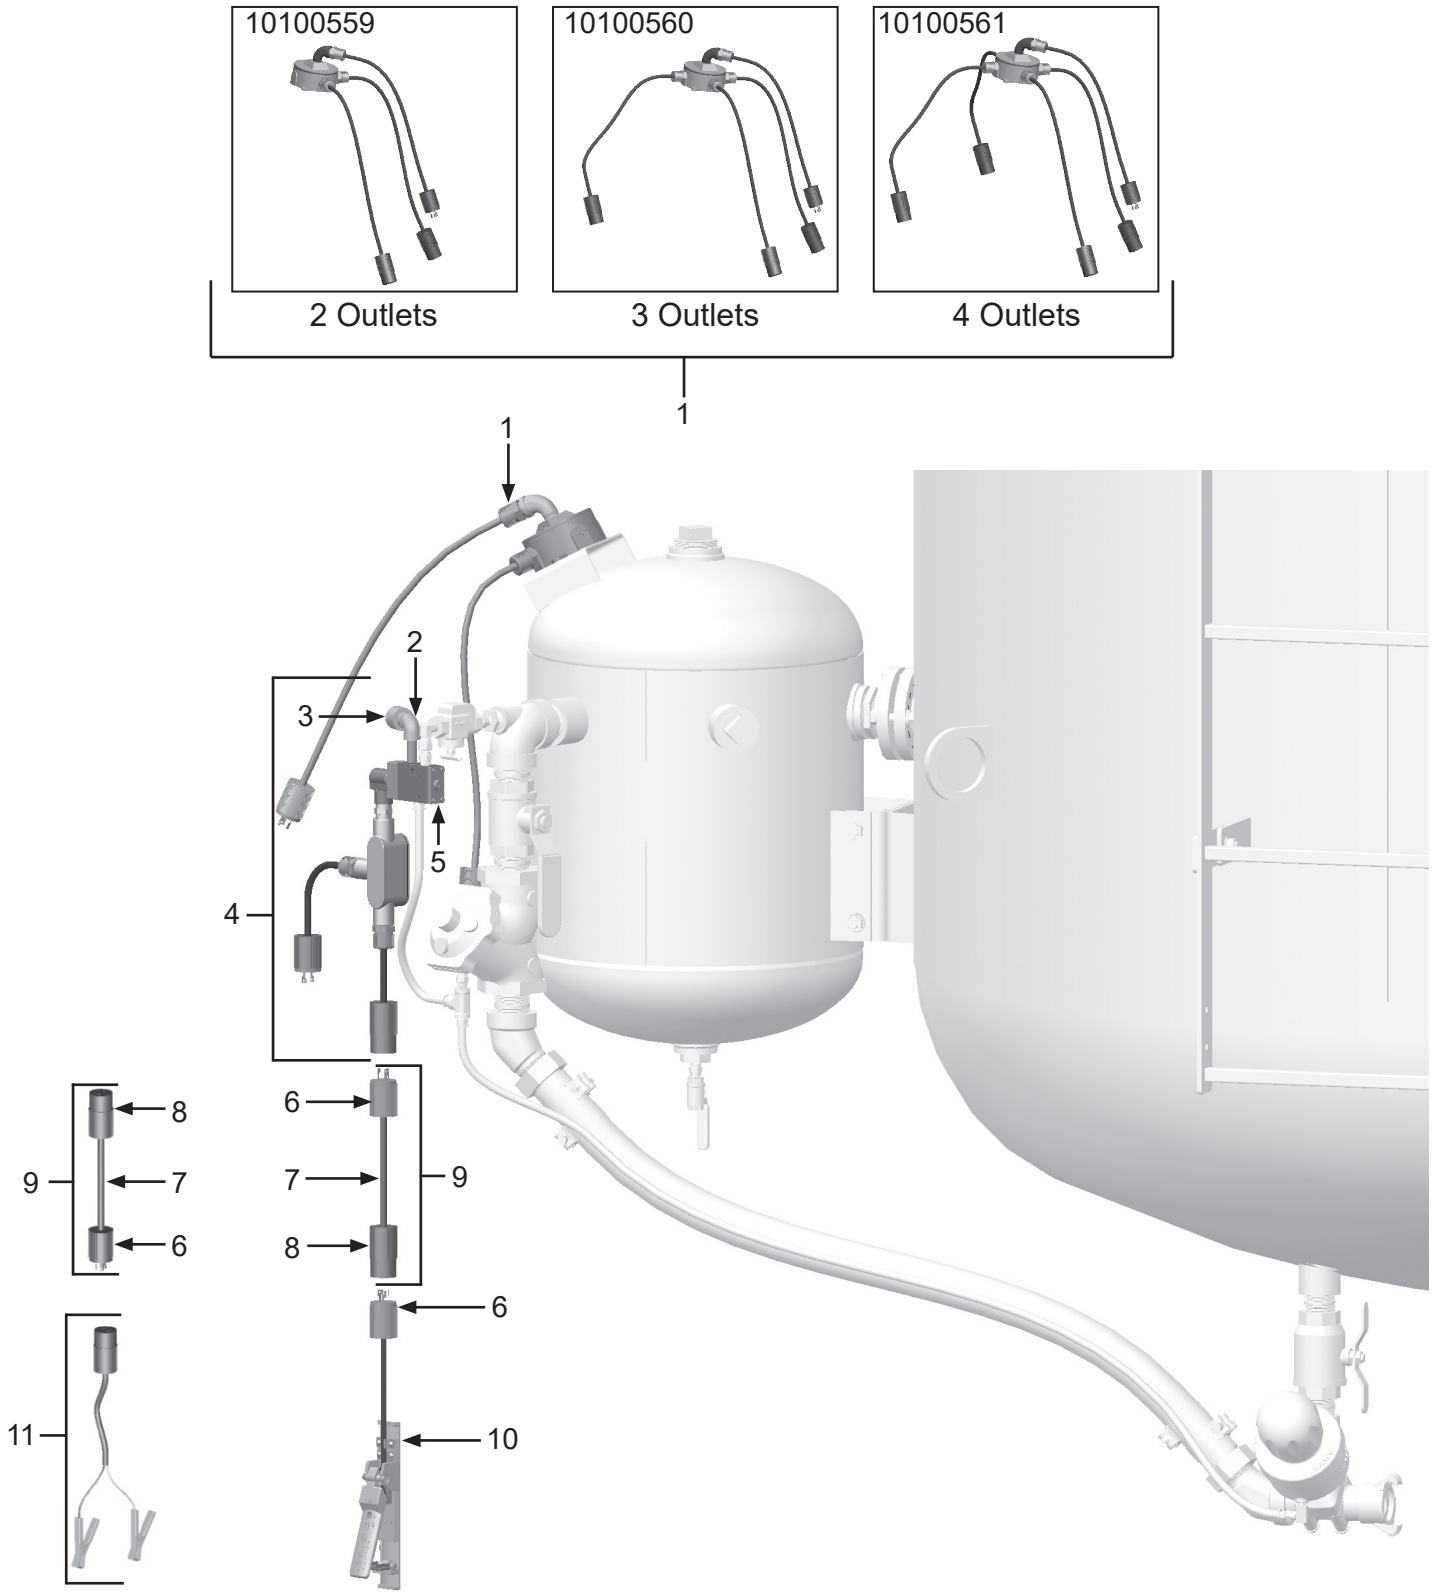

PART NUMBERS AND SCHEMATICS GUIDE

	PNEUMATIC TO 120-VOLT AC ELECTRIC CONVERSION KITS – 120 CU. FT. AND LARGER ABRASIVE BLASTING POT					
Part Numbers	**Number of Bulk Pot Outlets**	**Blastmaster® 151E Remote Control Switch**	**Electric Control Line** *(Includes Connectors)*	**Power Cord** *(Includes Connectors)*	**Junction Box**	**120-Volt AC to 12-Volt AC Power Converter**
10106372	1	X	50 Ft. *(Quantity of Two)*	25 Ft.		X
10105500	2	X *(Quantity of Two)*	50 Ft. *(Quantity of Three)*	25 Ft. *(Quantity of Two)*	X	X
10105501	3	X *(Quantity of Three)*	50 Ft. *(Quantity of Four)*	25 Ft. *(Quantity of Three)*	X	X
10105502	4	X *(Quantity of Four)*	50 Ft. *(Quantity of Five)*	25 Ft. *(Quantity of Four)*	X	X


For converting Pneumatic to 120-Volt AC Electric Conversion Kits
Includes: Junction Box, Control Line, Blastmaster® 151E Remote Control Switch, and Power Converter
Note that due to the wide variety of blast pots you may need to purchase additional fittings, bushing, etc.

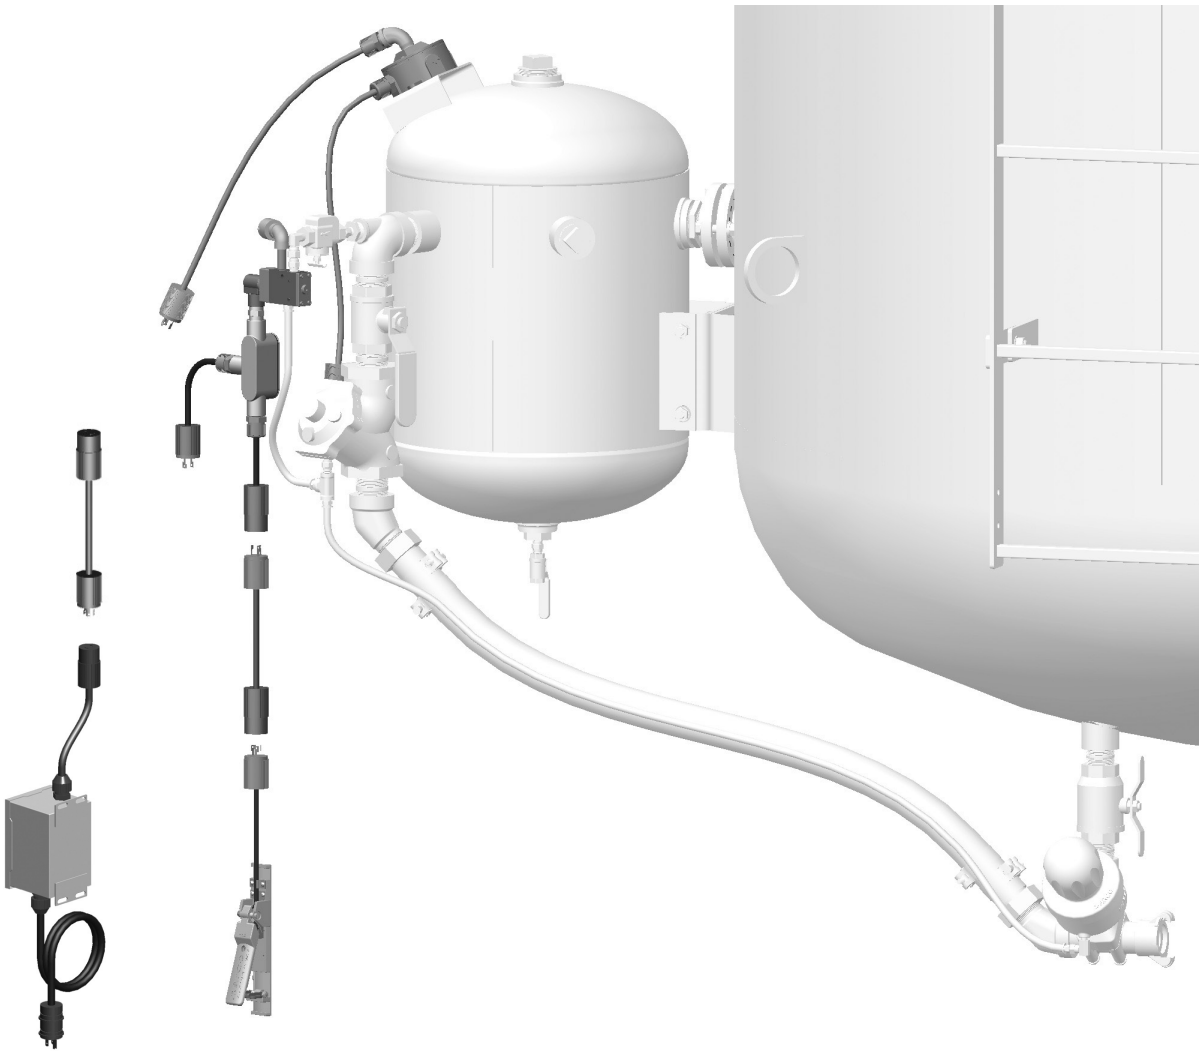

Pneumatic to 120-Volt AC Electric Conversion Kits – 120 Cu. Ft. and Larger Abrasive Blasting Pot

Item #	Part #	Description
Fig. 15	**10106372**	**Pneumatic to 120-Volt AC Electric Conversion Kits – 1-Outlet Power Distribution Box**
1	1011832	Galvanized 1/4" 90° Elbow
2	10DE025	1/4" Dust Eliminator
3	1019052	Blastmaster® 190 12-Volt AC Electric Control Assembly – Complete *(Includes Item #'s: 1, 2, and 4)*
4	1019011	12-Volt AC Electric Solenoid – Complete
5	1015555	3-Prong Twist-Lock Plug – Male
6	1015540	16/2 SJ Power Cord – Per Foot
7	1015556	3-Prong Twist-Lock Plug – Female
8	1015545	50' of 16/2 SO Power Cord with 3-Prong Twist-Lock Plugs Installed *(Includes Item #'s: 5, 6, and 7) (Two Required)*
9	1015100	Blastmaster® 151E Remote Control Switch
10	10100713	120-Volt AC to 12-Volt AC Power Converter *(Includes Item # 11)*
11	1030026	120-Volt AC Plug - Male - 3 Prong

Figure 15: Pneumatic to 120-Volt AC Electric Conversion Kits – 120 Cu. Ft. and Larger Abrasive Blasting Pot

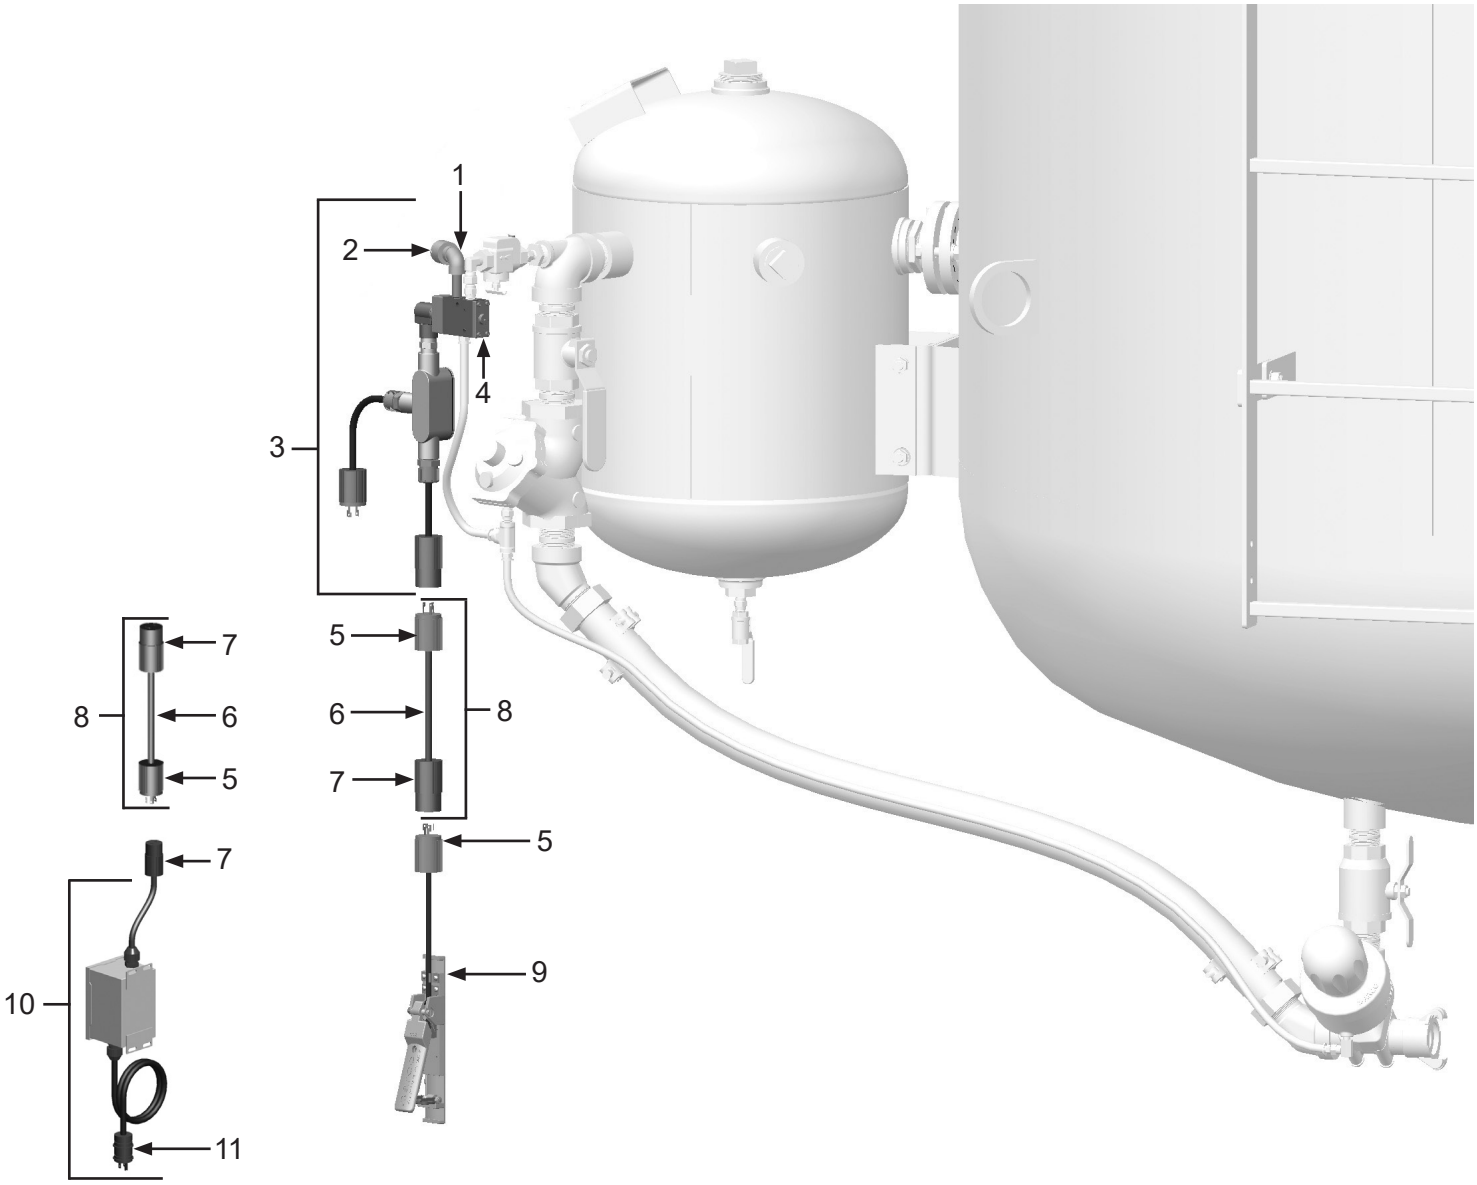

PART NUMBERS AND SCHEMATICS GUIDE


Pneumatic to 120-Volt AC Electric Conversion Kits – 120 Cu. Ft. and Larger Abrasive Blasting Pot

Item #	Part #	Description
Fig. 16	**10105500**	**Pneumatic to 120-Volt AC Electric Conversion Kits – 2-Outlet Power Distribution Box**
1	10100559	2-Outlet Power Distribution Box
2	1011832	Galvanized 1/4" 90° Elbow *(Two Required)*
3	10DE025	1/4" Dust Eliminator *(Two Required)*
4	1019052	Blastmaster® 190 12-Volt AC Electric Control Assembly *(Includes Item #'s: 1, 2, and 4) (Two Required)*
5	1019011	12-Volt AC Electric Solenoid – Complete *(Two Required)*
6	1015555	3-Prong Twist-Lock Plug – Male *(Two Required)*
7	1015540	16/2 SJ Power Cord – Per Foot
8	1015556	3-Prong Twist-Lock Plug – Female
9	1015545	50' of 16/2 SO Power Cord with 3-Prong Twist-Lock Plugs Installed *(Includes Item #'s: 6, 7, and 8) (Three Required)*
10	1015100	Blastmaster® 151E Remote Control Switch *(Two Required)*
11	10100713	120-Volt AC to 12-Volt AC Power Converter *(Includes Item # 12)*
12	1030026	120-Volt AC Plug - Male - 3 Prong

Item #	Part #	Description
Fig. 16	**10105501**	**Pneumatic to 120-Volt AC Electric Conversion Kits – 3-Outlet Power Distribution Box**
1	10100560	3-Outlet Power Distribution Box
2	1011832	Galvanized 1/4" 90° Elbow *(Three Required)*
3	10DE025	1/4" Dust Eliminator *(Three Required)*
4	1019052	Blastmaster® 190 12-Volt AC Electric Control Assembly *(Includes Item #'s: 1, 2, and 4) (Three Required)*
5	1019011	12-Volt AC Electric Solenoid – Complete *(Three Required)*
6	1015555	3-Prong Twist-Lock Plug – Male *(Three Required)*
7	1015540	16/2 SJ Power Cord – Per Foot
8	1015556	3-Prong Twist-Lock Plug – Female
9	1015545	50' of 16/2 SO Power Cord with 3-Prong Twist-Lock Plugs Installed *(Includes Item #'s: 6, 7, and 8) (Four Required)*
10	1015100	Blastmaster® 151E Remote Control Switch *(Three Required)*
11	10100713	120-Volt AC to 12-Volt AC Power Converter *(Includes Item # 12)*
12	1030026	120-Volt AC Plug - Male - 3 Prong


Item #	Part #	Description
Fig. 16	**10105502**	**Pneumatic to 120-Volt AC Electric Conversion Kits – 4-Outlet Power Distribution Box**
1	10100561	4-Outlet Power Distribution Box
2	1011832	Galvanized 1/4" 90° Elbow *(Four Required)*
3	10DE025	1/4" Dust Eliminator *(Four Required)*
4	1019052	Blastmaster® 190 12-Volt AC Electric Control Assembly *(Includes Item #'s: 1, 2, and 4) (Four Required)*
5	1019011	12-Volt AC Electric Solenoid – Complete *(Four Required)*
6	1015555	3-Prong Twist-Lock Plug – Male *(Four Required)*
7	1015540	16/2 SJ Power Cord – Per Foot
8	1015556	3-Prong Twist-Lock Plug – Female
9	1015545	50' of 16/2 SO Power Cord with 3-Prong Twist-Lock Plugs Installed *(Includes Item #'s: 6, 7, and 8) (Five Required)*
10	1015100	Blastmaster® 151E Remote Control Switch *(Four Required)*
11	10100713	120-Volt AC to 12-Volt AC Power Converter *(Includes Item #12)*
12	1030026	120-Volt AC Plug - Male - 3 Prong

Figure 16: Pneumatic to 120-Volt AC Electric Conversion Kits – 120 Cu. Ft. and Larger Abrasive Blasting Pot

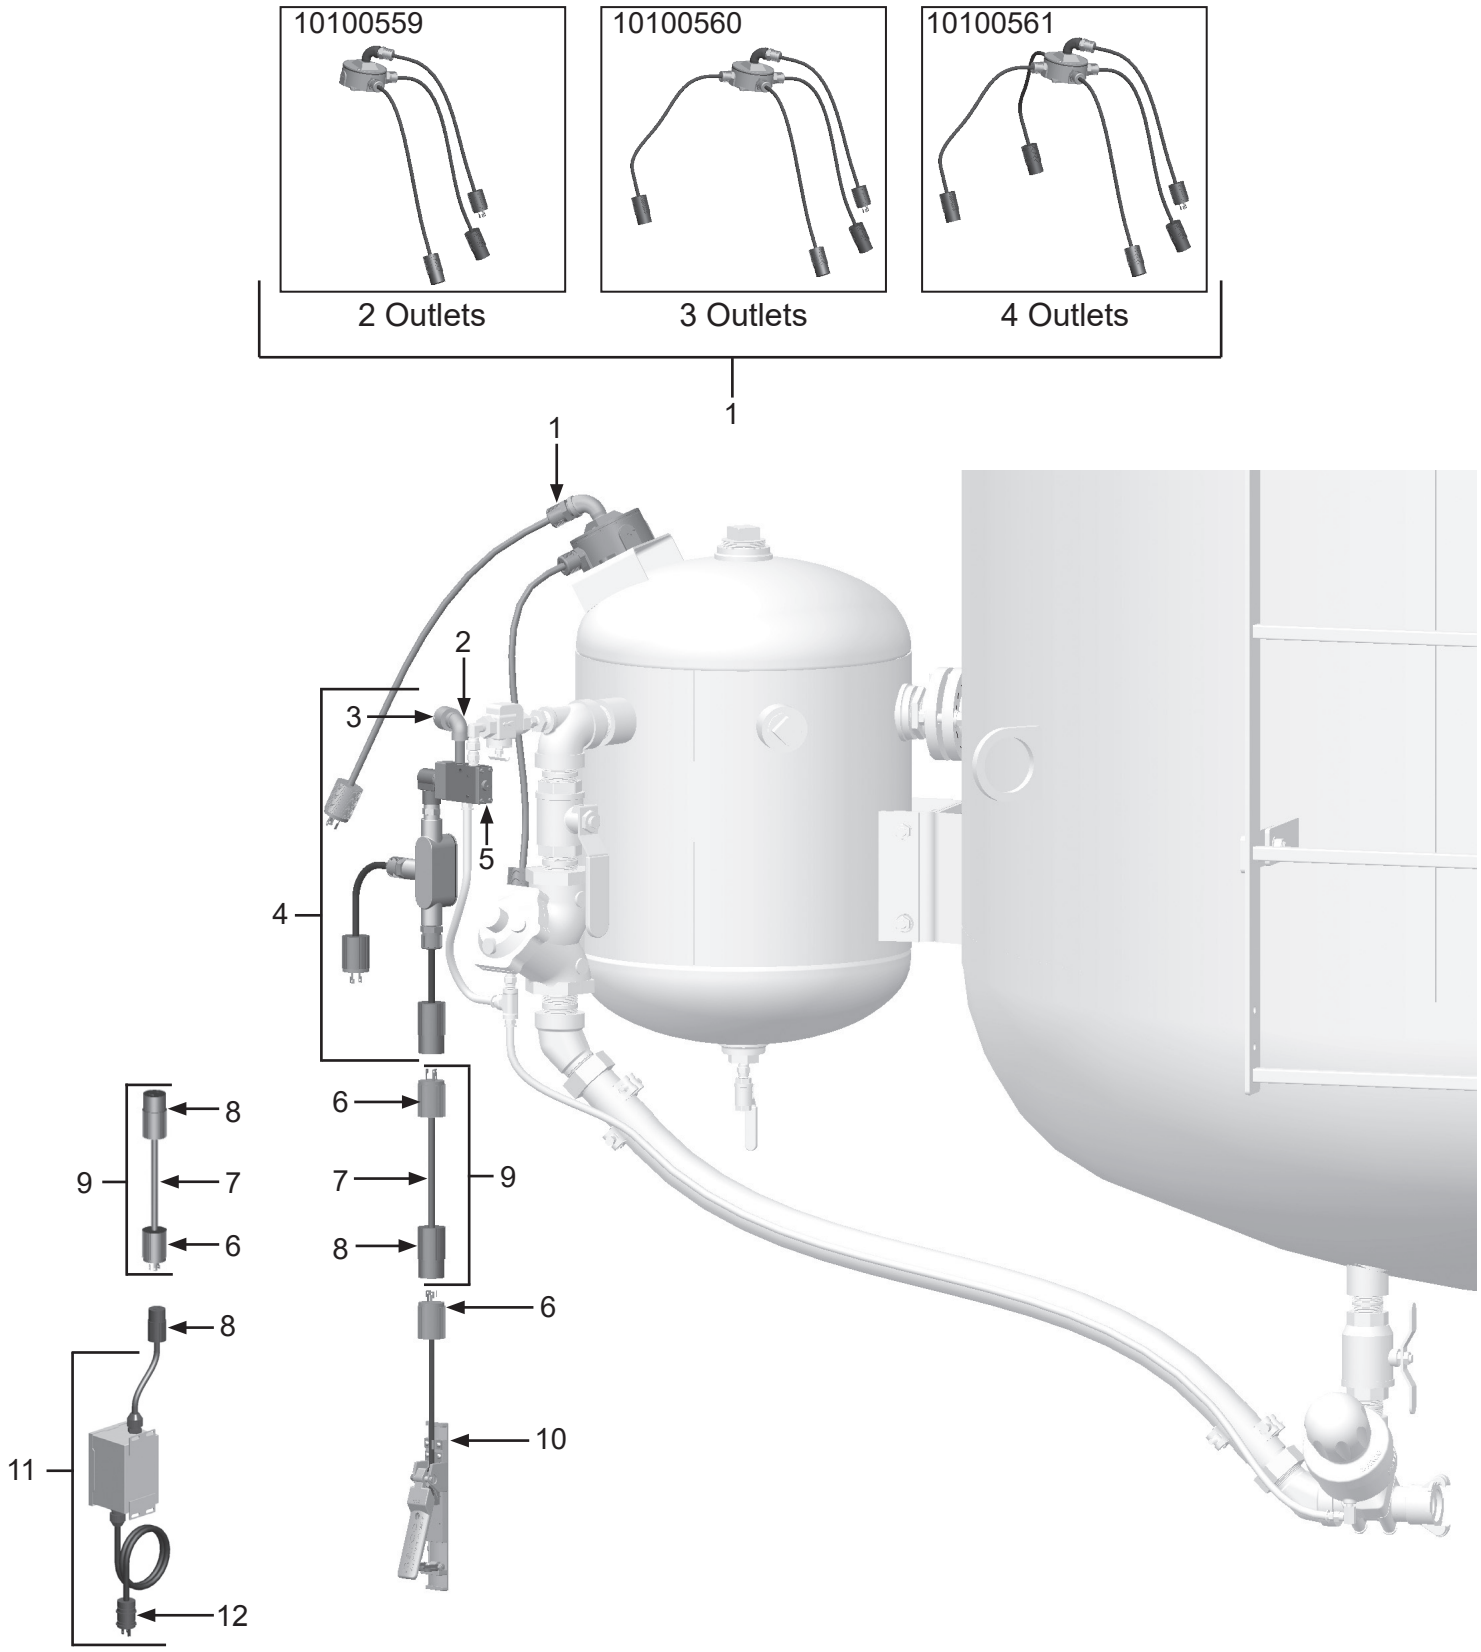

OPTIONAL ACCESSORIES


Figure 17: Blastmaster® 120-Volt AC to 12-Volt AC Power Converter For Single-Outlet Configurations

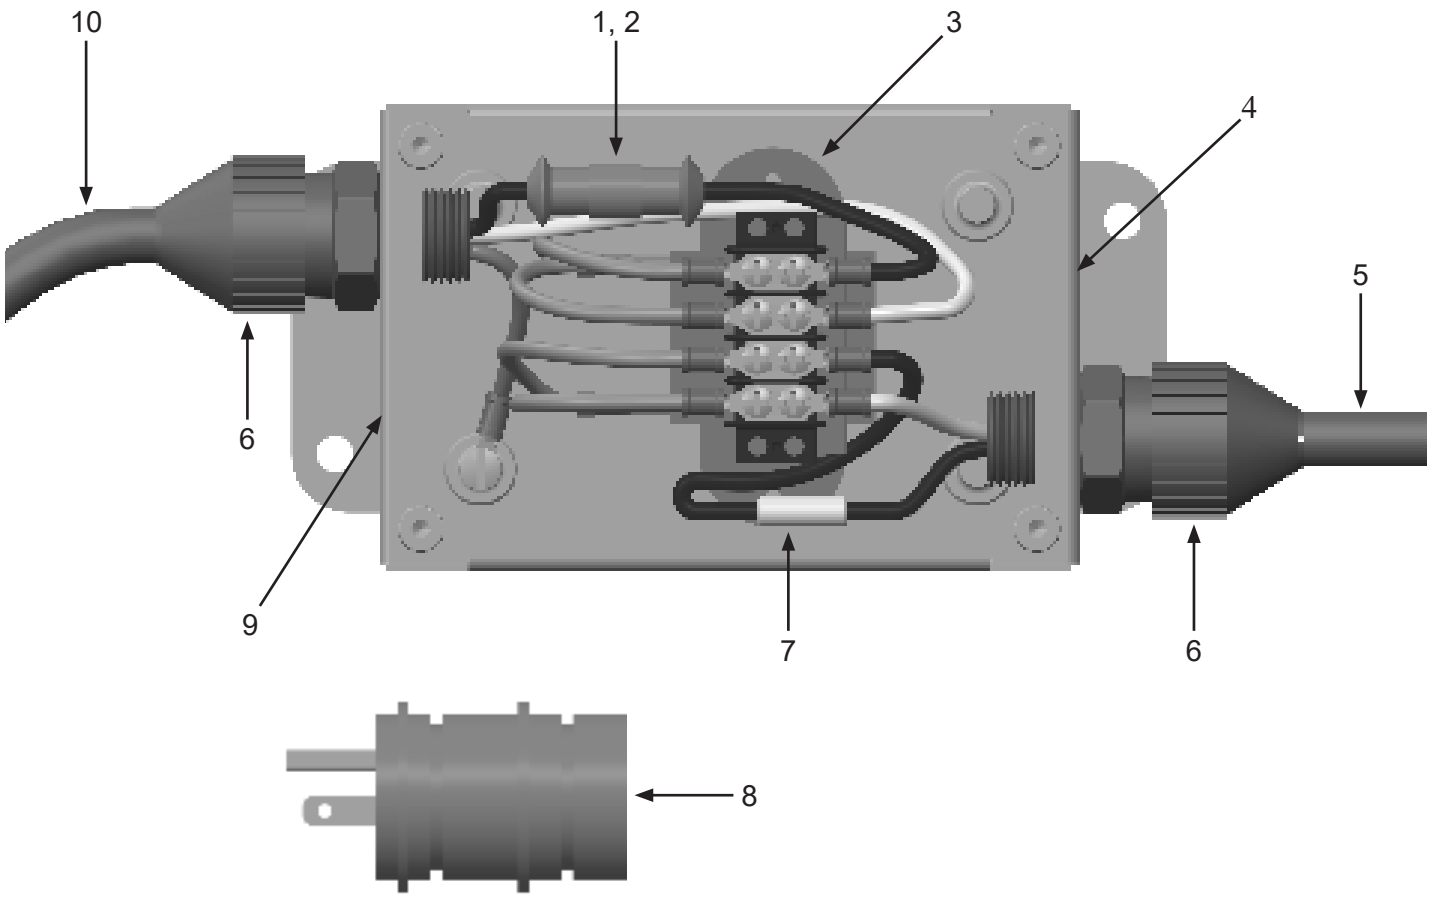

Item #	Part #	Description
Fig. 17		
—	**1030020**	**Blastmaster® 120-Volt AC to 12-Volt AC Power Converter – For Single-Outlet Configurations**
1	1030024	2 Amp Fuse
2	1030023	In-Line Fuse Holder
3	1030022	Transformer – Blastmaster® 120-Volt AC to 12-Volt AC Power Converter
4	1091067	Power-Out Decal *(Not Shown)*
5	1030013	14/2 SEOOW Electric Cord *(Per Foot)*
6	1030025	Strain Relief *(Two Required)*
7	1030021	Resistor
8	1030026	3-Prong, 120-Volt AC Plug – Male
9	1092014	Power-In Decal *(Not Shown)*
10	1015550	14/3 SEOOW Electrical Cord *(Per Foot)*
—	1091063	Hazard Identification Decal


OPTIONAL ACCESSORIES

Figure 18: Blastmaster® 120-Volt AC to 12-Volt AC Power Converter For Multiple Outlet Configurations

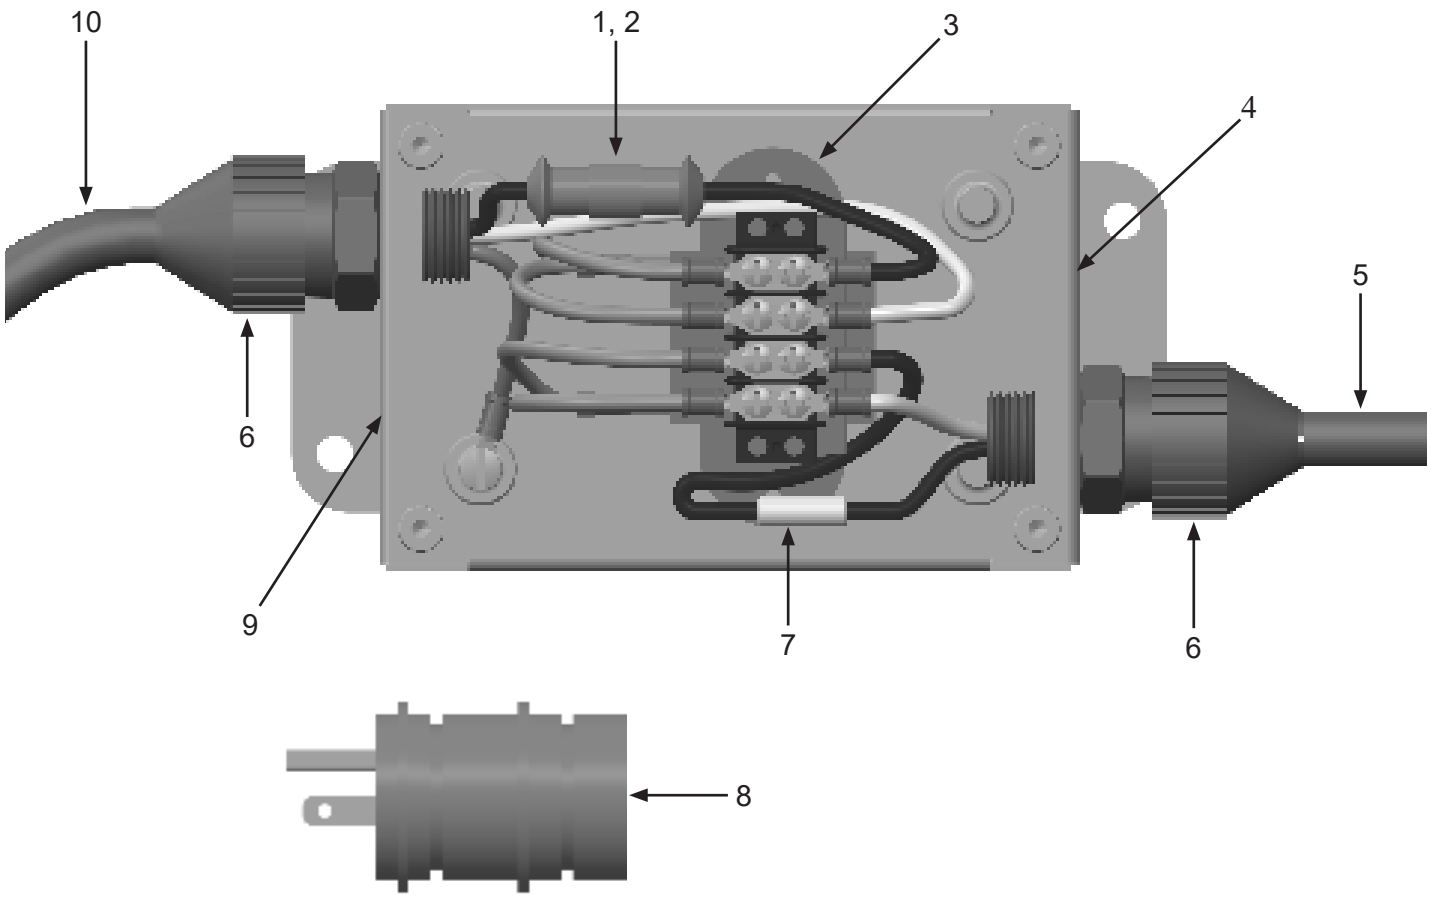

Item #	Part #	Description
Fig. 18		
—	**10100713**	**Blastmaster® 120-Volt AC to 12-Volt AC Power Converter – For Multiple Outlet Configurations**
1	1030123	3 Amp Fuse
2	1030023	In-Line Fuse Holder
3	1030022	Transformer – Blastmaster® 120-Volt AC to 12-Volt AC Power Converter
4	1091067	Power-Out Decal *(Not Shown)*
5	1030013	14/2 SEOOW Power Cord *(Per Foot)*
6	1030025	Strain Relief *(Two Required)*
7	1030021	Resistor
8	1030026	3-Prong, 120-Volt AC Plug – Male
9	1092014	Power-In Decal *(Not Shown)*
10	1015550	14/3 SEOOW Electrical Cord *(Per Foot)*
—	1091063	Hazard Identification Decal

Figure 19: Battery Clamp Kit with 3-Prong Twist-Lock Plug Installed

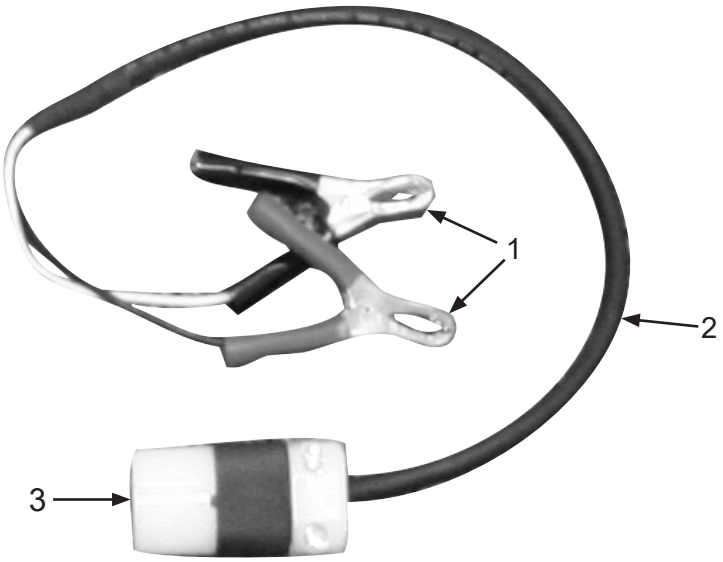

Item #	Part #	Description
Fig. 19		
—	**1015544**	**Battery Clamp Kit with 3-Prong Twist-Lock Plug Installed**
1	1030718	Battery Clamps – Pair
2	1015540	16/2 Electric Cord *(Per Foot)*
3	1015556	3-Prong Twist-Lock Plug – Female

OPTIONAL ACCESSORIES



Part Numbers	ELECTRIC CORD			
	Gauge	# of Wires	Type	Length
1015540	16	2		Per Foot
1015701	16	3		Per Foot
1030013	14	2	SEOOW	Per Foot
1015550	14	3	SEOOW	Per Foot
1015554	14	4	SEOOW	Per Foot
1015570	12	2	SOOW	Per Foot
1015571	12	3	SJEOOW	Per Foot
1015581	10	3	SEOOW	Per Foot
1015580	10	4	SEOOW	Per Foot
1015591	8	3	SEOOW	Per Foot
1015590	8	4	SEOOW	Per Foot
1015595	6	3	SEOOW	Per Foot

OPTIONAL ACCESSORIES

ELECTRIC CONTROL LINE WITH PLUGS

	Part Numbers	Gauge	# of Wires	3-Prong Male Twist-Lock Plug	3-Prong Female Twist-Lock Plug	Length
	**1015546**	16	2	1015555	1015556	25 Feet
	**1015545**	16	2	1015555	1015556	50 Feet
	**1015547**	16	2	1015555	1015556	100 Feet

ELECTRIC CONTROL LINE PLUGS

	Part Numbers	Prong Style	Plug Style
	**1015555**	3-Prong Male	Twist-Lock
	**1015556**	3-Prong Female	Twist-Lock
	**1030026**	3-Prong Male	Standard

LITERATURE REFERENCES

Remote Control System

106M087	Part Numbers and Schematics Guide – Blastmaster® 130E Remote Control System
106M423	Part Numbers and Schematics Guide – Blastmaster® GateKeeper Air Valve
1090087	Operator's Manual – Blastmaster® 130E Remote Control System

Remote Control Switch

106M063	Part Numbers and Schematics Guide – Blastmaster® 151E Remote Control Switch
1090063	Operator's Manual – Blastmaster® 151E Remote Control Switch

Abrasive Metering Valve

106M069	Part Numbers and Schematics Guide – Blastmaster® Maxum III Abrasive Metering Valve
1090069	Operator's Manual – Blastmaster® Maxum III Abrasive Metering Valve

Abrasive Blasting Pot Muffler


106M347	Part Numbers and Schematics Guide – Abrasive Blasting Pot Muffler

MAINTENANCE NOTES

DATE	TYPE OF SERVICE	PART NUMBER

MAINTENANCE NOTES

DATE	TYPE OF SERVICE	PART NUMBER

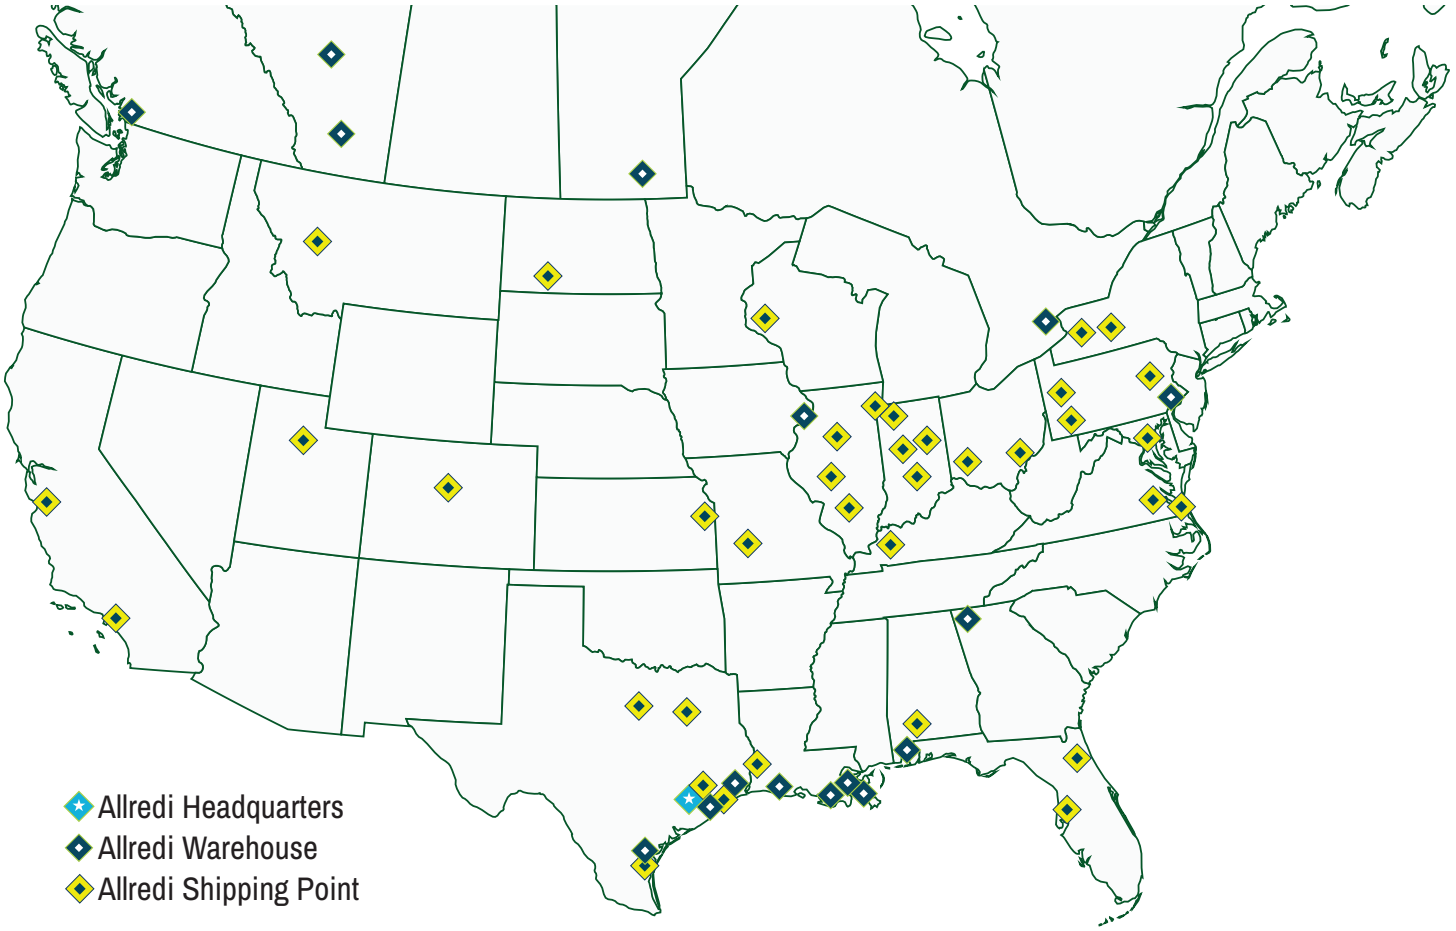

ALLREDI THERE

Serving these industries: Bridge, Pipeline, Tank & Tower, Concrete Services, Rail, Shipyard & Marine, Pools & Fountains, and Foundry

UNITED STATES

Pasadena, TX *(Headquarters)*
844.361.7038

Beaumont, TX
409.722.1284

Bristol, PA
215.826.8080

Corpus Christi, TX
361.887.2038

Davenport, IA
563.324.2519

Deer Park, TX
(Service & Rental Location)
281.930.0905

Duluth, GA
800.535.4564

Gonzales, LA
225.647.7575

Harvey, LA
504.367.8090

Houma, LA
985.580.4273

Lafayette, LA
337.267.1440

Theodore, AL
251.338.7525

CANADA

Calgary, Alberta
403.279.1924

Coquitlam, BC
604.464.6979

Edmonton, Alberta
780.468.2588 (Manus)
780.425.5510 (Mod-U-Blast)

Hamilton, Ontario
905.527.6000 / 888.794.5665

Mississauga, Ontario
905.890.5837

Winnipeg, Manitoba
204.256.3324

WWW.ALLREDI-US.COM / 800.252.7848
WWW.ALLREDI-CA.COM / 800.661.3842

Allredi™ and Marco® are registered trademarks of Allredi, LLC.
Mod-U-Blast® is a registered trademark of Allredi Blast & Abrasives Canada, Inc.
All other brand names or marks are used for identification purposes and are trademarks of their respective owners.

ALLREDI™

Literature #106M543_5/13/2025